

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☐ well gas ☒ well other ☐
2. NAME OF OPERATOR
Mobil Oil Corporation
3. ADDRESS OF OPERATOR Houston, TX
Nine Greenway Plaza-Suite 2700, 77046
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 874 FSL + 732 FEL
AT TOP PROD. INTERVAL: same as surface
AT TOTAL DEPTH: same as surface
16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:	SUBSEQUENT REPORT OF:
TEST WATER SHUT-OFF ☐	☐
FRACTURE TREAT ☐	☐
SHOOT OR ACIDIZE ☐	☐
REPAIR WELL ☐	☐
PULL OR ALTER CASING ☐	☐
MULTIPLE COMPLETE ☐	☐
CHANGE ZONES ☐	☐
ABANDON* ☒	☐
(other) ☐	☐

5. LEASE

6. IF INDIAN, ALLOTTEE OR TRIBE NAME
Jicarilla Contract #96

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME
Jicarilla H9. WELL NO.
4-A10. FIELD OR WILDCAT NAME
Blanco Mesaverde11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Sec. 1, T26N, R3W12. COUNTY OR PARISH 13. STATE
Rio Arriba New Mexico

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)
GR 7085'

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

- 1) Kill Mesa Verde w/ 9.5 lb/gal brine & POH w/ Tbg
- 2) Set 4½ cmt retainer on 2-3/8 work string at 5350' & squeeze Mesa Verde perfs (5434-5851') w/ 150 sx class H neat cmt
- 3) Spot 35' cmt plug on retainer (5350-5315') w/ 3 sx cmt
- 4) Determine free point of 4½" casing, cut&pull casing at indicated freepoint; if unable to salvage csg see notes & sketch "B"
- 5) Load hole w/ 9.5 lb/gal mud laden fluid, using 25 lbs gel /1000 gal
- 6) Spot cmt plug @ (Pictured Cliffs) 3650'-3750' w/8 sx cl "H" cmt
- 7) Spot cmt plug (50' above&below OJO Allamo)@3425-3160' w/20 sx class "H" cmt
- 8) Spot cmt plug 50' above & 50' below csg cut, cmt w/31 sx class "H" cmt
- 9) Spot cmt plug @ 250' to 350' w/ 70 sx class "H" cmt
- 10) Spot 30' cmt plug at surface & cmt w/ 10 sx cl. "H"
- 11) Erect P & A monument
- 12) Clear location upon approval from B/S (over)
Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Robbie Jay TITLE Authorized Agent DATE 9/11/79

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY: _____

SEP 14 1979

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.


Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between, and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

GPO : 1976 O - 214-149

Casing
Notes: If unable to pull ~~off~~ Follow procedure of sketch "B"
Procedure verbally approved by Carl Barrick USGS

Lease: <u>JICARILLA "H"</u>	Well No. <u>4-A</u>	County & State: <u>RIO ARriba CO NEW MEXICO</u>
Location: <u>SEC 1 T26N R3W</u>	Completion Date:	Elev: KB Elev:


CASING Pulled Sketch "A"

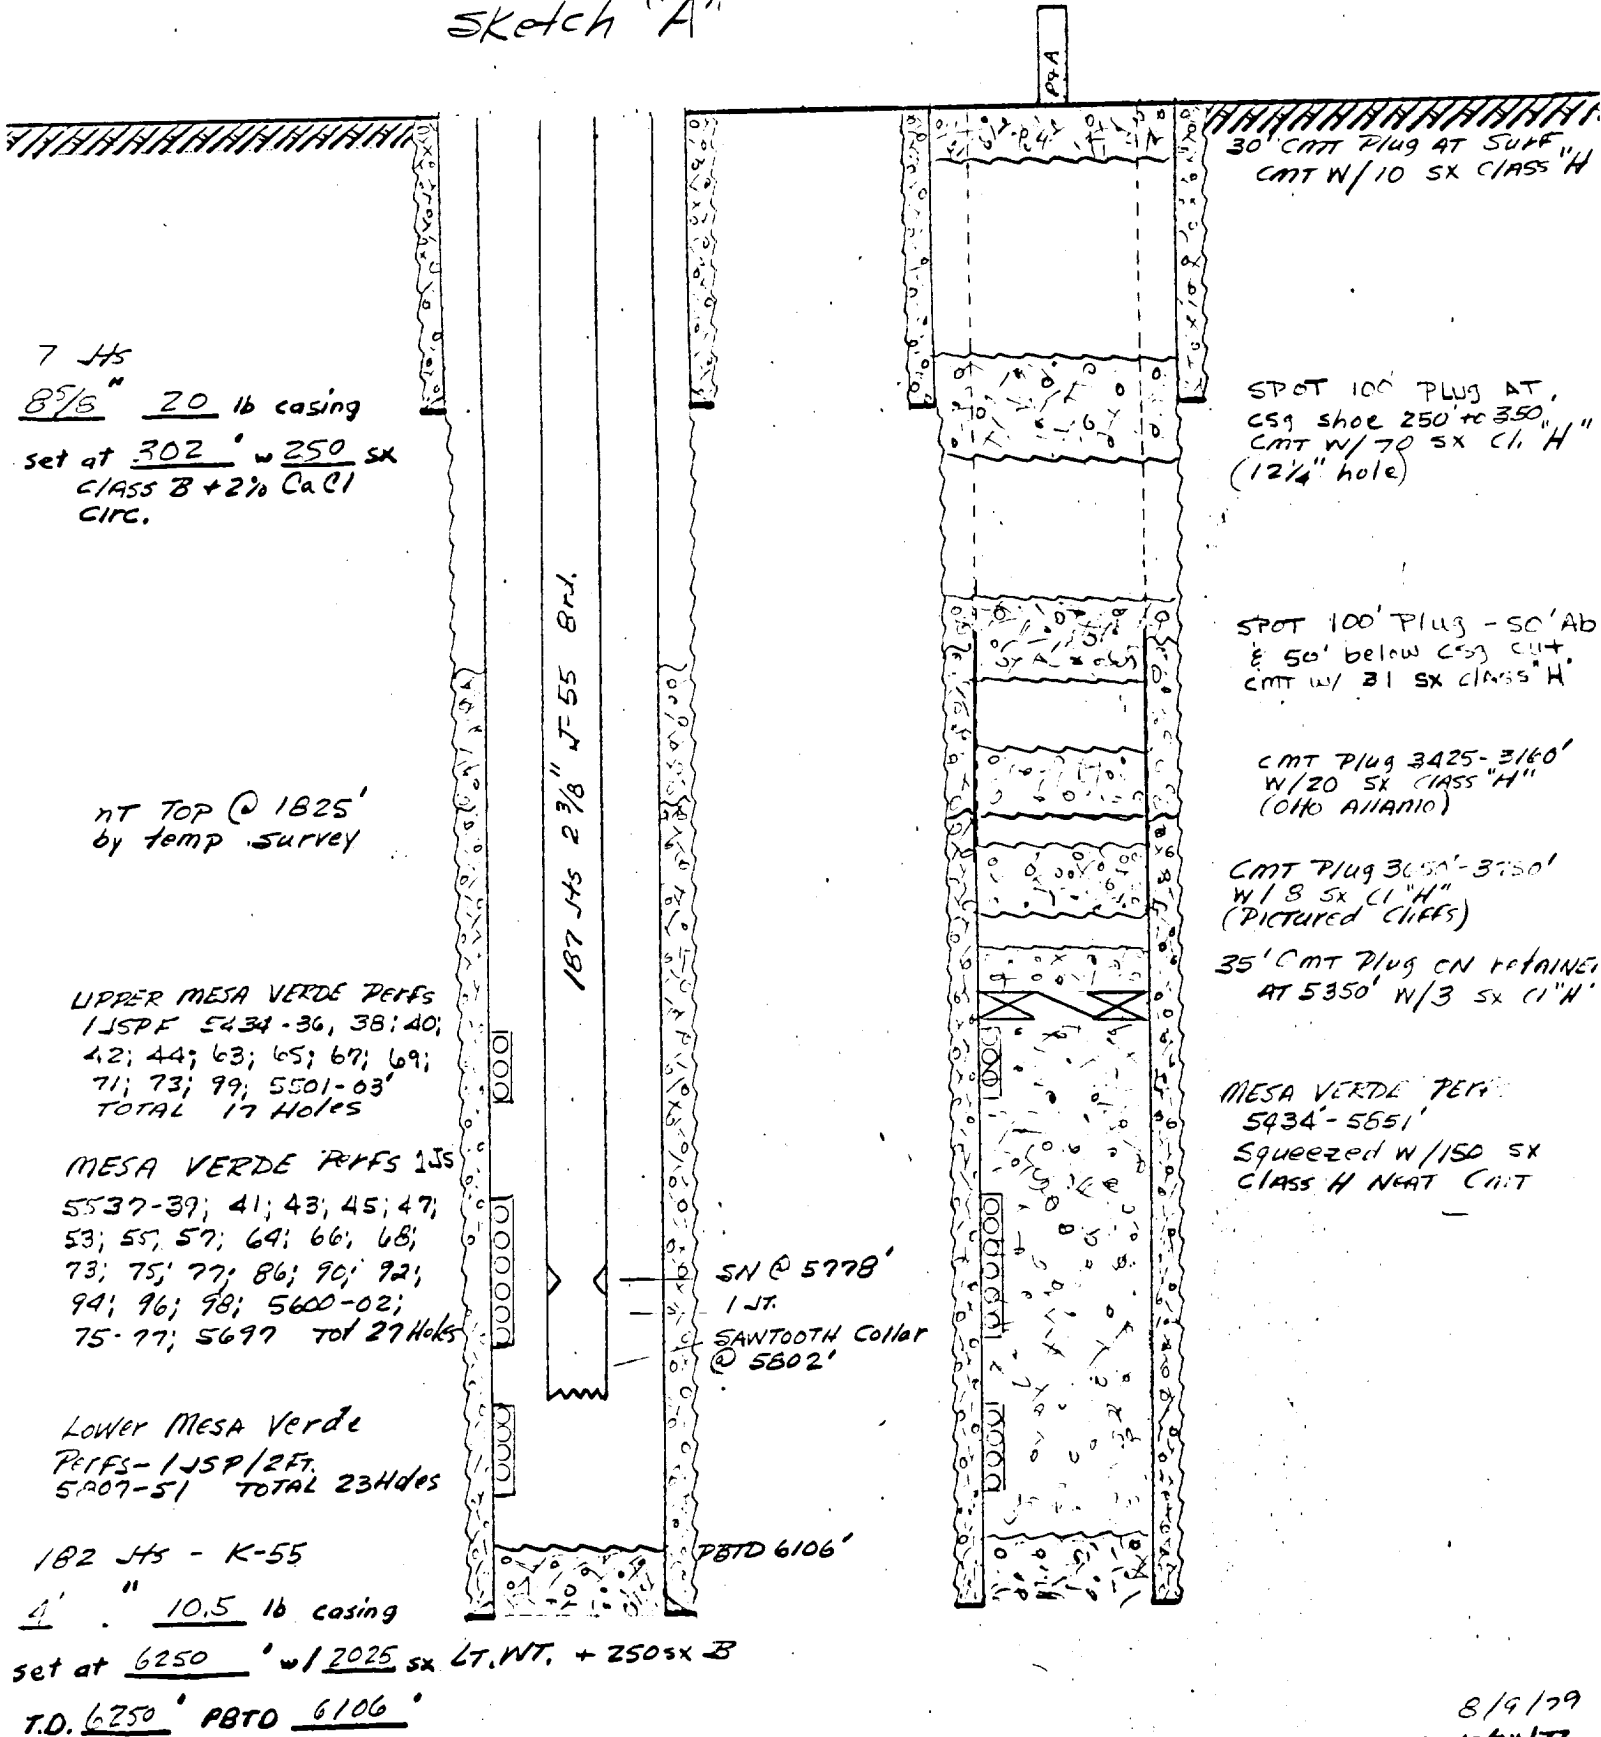

8/9/79
RDB 10/24/77

Lease: J. ARILLA "H"	Well No. 4-A	County & State: RIO ARriba Co. New Mexico
Location: SEC 1 T26N R3W	Completion Date:	Elev: KB Elev:

P. & A. NO CASING Pulled
Sketch "B"

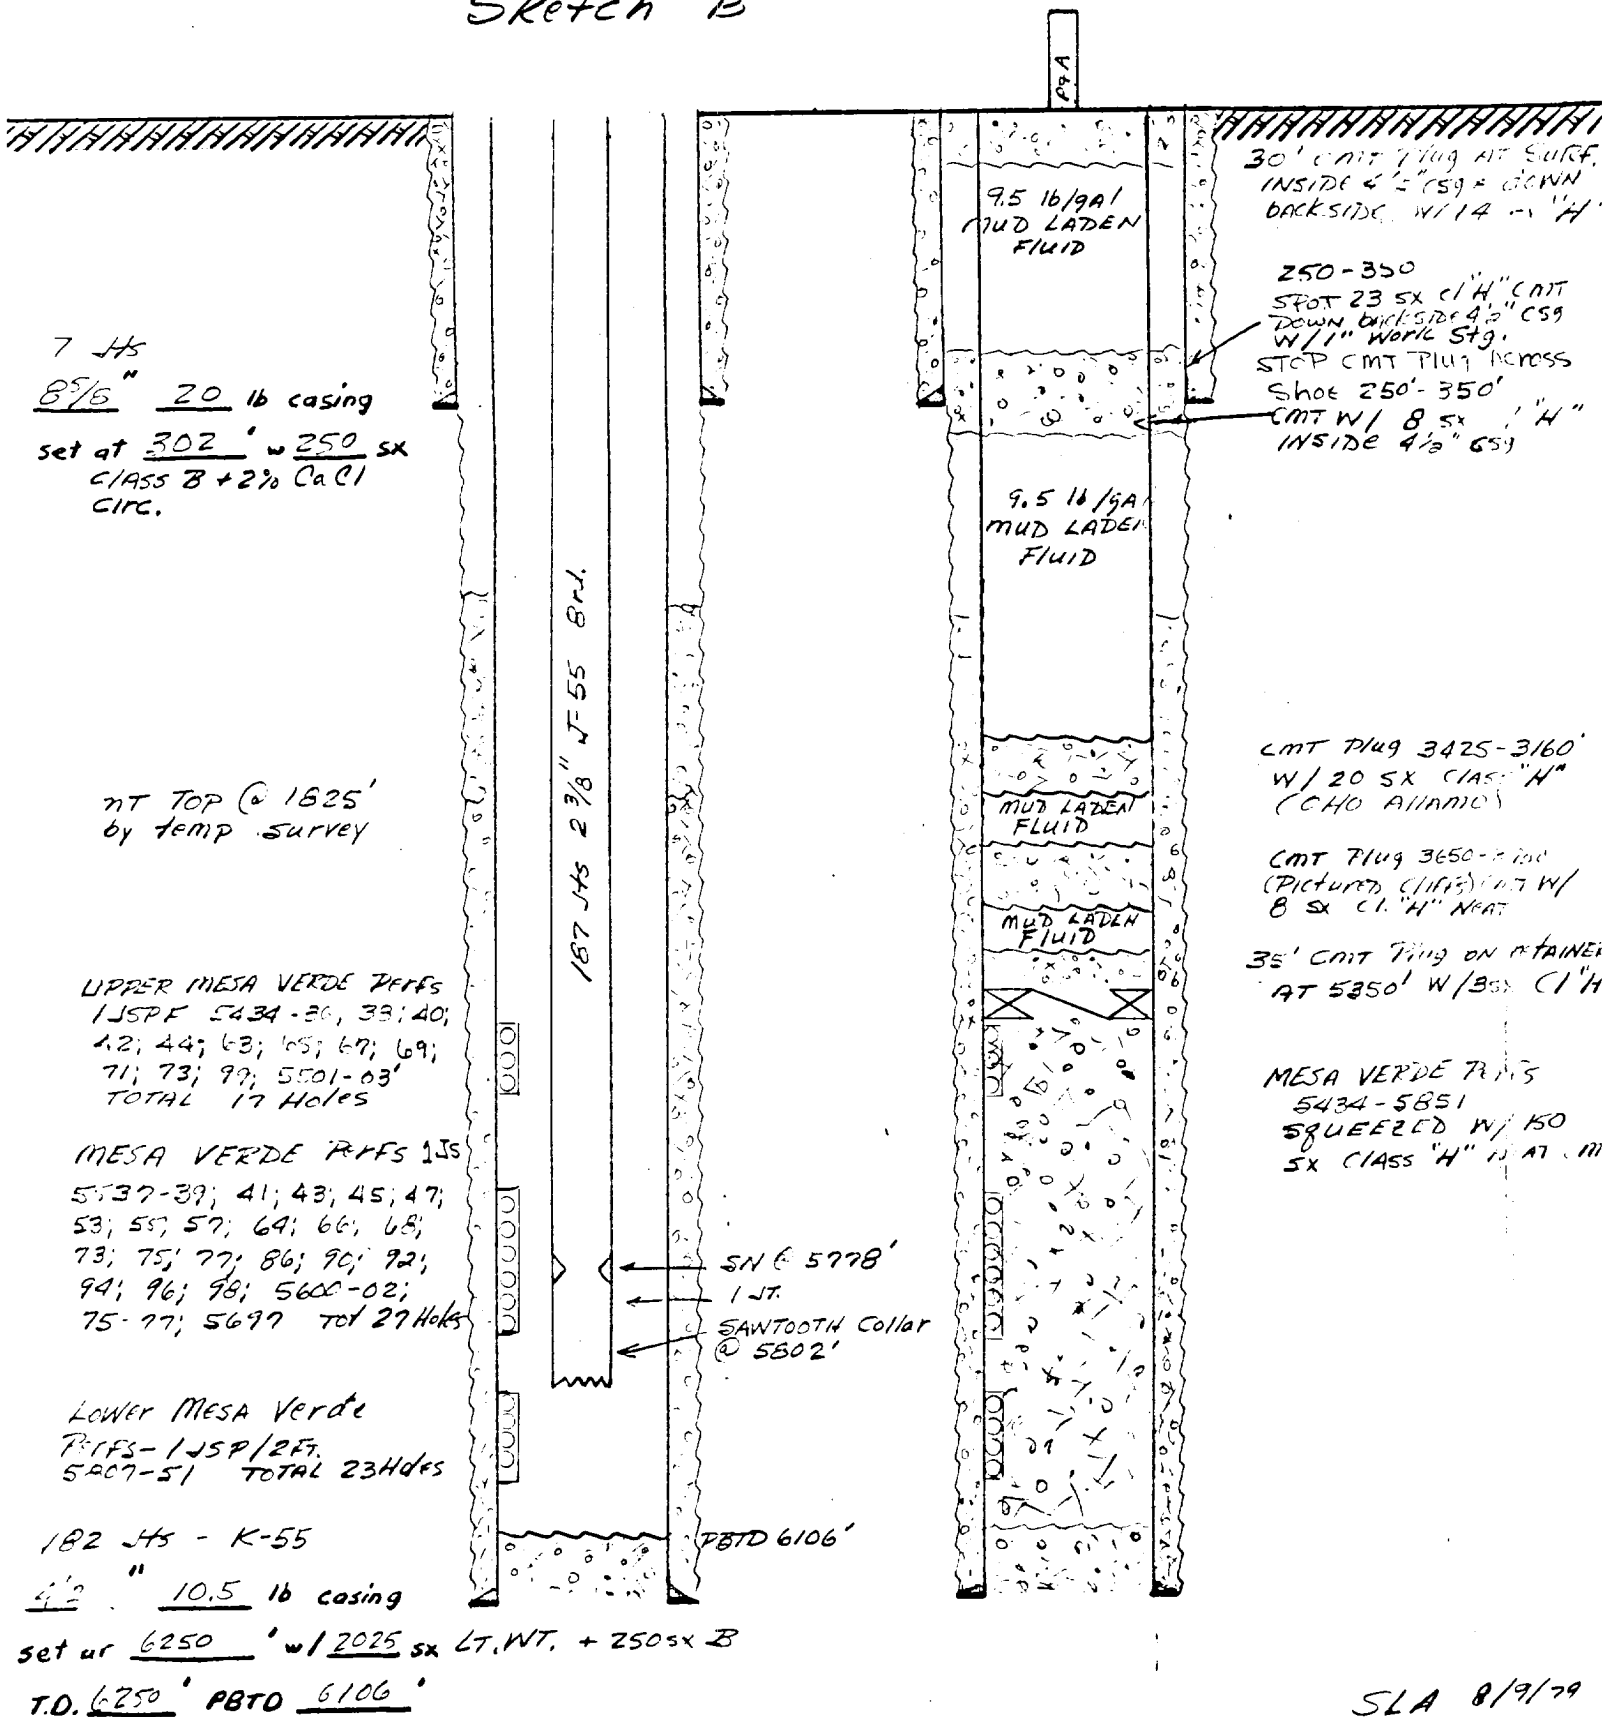

SLA 8/9/79
ROB 10/24/77

STATEMENT OF SURFACE RESTORATION INTENTION
ATTACHMENT TO USGS FORM 9-331, SUNDRY NOTICE OF INTENT TO ABANDON

Applicable To: Mobil Oil Corporation
Three Greenway Plaza East, Suite 800
Houston, Texas 77046

Lease Name: Jicarilla H

Well No: 4-A

Location: Sec. 1, T26N, R3W

This is to advise your office that surface restoration associated with the above described proposed plugging and abandonment will be conducted in accordance with applicable rules and regulations of the United States Geological Survey and the New Mexico Oil Conservation Commission; and in accordance with any existent agreement with the surface ~~landowner~~, or in a manner arrived at by agreement with the surface ~~landowner~~ *Agency (BIA)*

Such restoration work will include:

Backfilling of all pits and cellar. Levelling or contouring the location site. Clearing the location area of junk.

FORM 9-331 Dated: 9/11/79