

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

NOO-C-14-20-5320

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Navajo Tribe "BR"

9. WELL NO.

10. FIELD AND POOL, OR WILDCAT

Tocito Dome

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 3, T25N, R18W

12. COUNTY OR PARISH 13. STATE

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR
TEXACO, INC.

3. ADDRESS OF OPERATOR

P.O. Box EE Cortez, Colorado 81321

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

NE 1/4 NW 1/4 Sec. # 3

510' FNL & 1980' FWL, Sec. 3

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

X

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*


(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

This well was completed shut-in, uneconomical to produce.

Abandonment Procedure:

Fill hole with 9.5 # mud, spot and squeeze 35 sacks cement from PBTD to 6350'. Run freepoint and cut and pull casing, spot 50 sacks 100' in and 100' out fo casing stub. Spot 75 sacks 3800'-4000', and 75 sacks cement 2100'-2300'. Spot 70 sacks cement 1550'-1700' across intermediate casing shoe and 10 sacks at surface with marker. Clean and seed location.

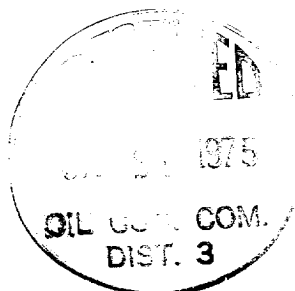

18. I hereby certify that the foregoing is true and correct

SIGNED

Alvin R. Mandy

TITLE

Field Foreman

DATE

1-20-75

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side