

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE*
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. ☐ OIL WELL ☐ GAS WELL ☐ OTHER Wildcat

2. NAME OF OPERATOR
Amoco Production Company

3. ADDRESS OF OPERATOR
501 Airport Drive, Farmington, New Mexico 87401

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface
1800' FNL x 1650' FWL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, OR, etc.)
5520' KB

5. LEASE DESIGNATION AND SERIAL NO.
N00-C-14-20-5507

6. IF INDIAN, ALLOTTEE OR TRIBE NAME
Navajo Tribe

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME
Navajo Tribal AH

9. WELL NO.
1

10. FIELD AND POOL, OR WILDCAT
Wildcat Devonian

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
SE/NW, Sec. 10, T25N, R17W

12. COUNTY OR PARISH
San Juan

13. STATE
NM

RECEIVED
MAY 09 1984

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐ PULL OR ALTER CASING ☐
FRACTURE TREAT ☐ MULTIPLE COMPLETE ☐
SHOOT OR ACIDIZE ☐ ABANDON* ☐
REPAIR WELL ☐ CHANGE PLANS ☐
(Other) Plugback

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐ REPAIRING WELL ☐
FRACTURE TREATMENT ☐ ALTERING CASING ☐
SHOOTING OR ACIDIZING ☐ ABANDONMENT* ☐
(Other) ☐

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

Amoco Production Company requests confirmation of the verbal approval given by Mr. Earl Beecher of your office, to A. M. O'Hare, of this office to plugback the referenced well according to the following procedures:

1. Spot a 100 sx plug at 10,186' with Class "B" cement.
2. Pull up and reverse out drill pipe.
3. Circulate for 2 hours.
4. Spot a 150 sx plug at 8,478' with Class "B" cement.
5. Pull up and reverse out drill pipe.
6. Circulate for 2.5 hours.
7. Spot a 150 sx plug at 6,984' with Class "B" cement.
8. Pull up and reverse out drillpipe.
9. Circulate for 3 hours.
10. Spot a 200 sx plug at 5794' with Class B cement.
11. Pull up and reverse out drillpipe.
12. Nipple up wellhead and prepare to test upper hole.

RECEIVED
MAY 11 1984
OIL CON. DIV. 1
DIST. 3

18. I hereby certify Original Signed By correct

SIGNED B. D. Shaw


TITLE Administrative Supervisor

DATE 5-7-84

(This space for Federal or State office use)

APPROVED BY
CONDITIONS OF APPROVAL, IF ANY:

TITLE

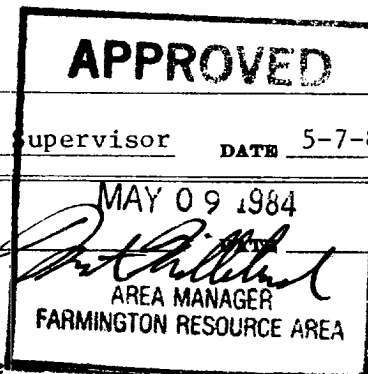

*See Instructions on Reverse Side