


Harrington		4	1	M. J. Florance		Aztec	
LEASE		WELL NO.	TEST NO.	COMPANY		DISTRICT	
LOCATION		 OIL WELL CEMENTING COMPANY				Date	9-20-52
FIELD Largo Canyon						Ticket No.	42296
COUNTY Rio Arriba						HOWCO District	Farmington
STATE New Mexico						Kind of Job	Open Hole
CONTRACTOR M. J. Florance		HOLE & TOOL DATA				Price	\$ 75.00
		Total Depth	1440'	Casing Perforations	Top	Price	\$ 75.00
		Top Packer Depth	1406'	Bottom Packer Depth	Bottom	Second Packer Assembly	
MUD DATA		Casing or Hole Size	8-3/4"	Liner or Rathole Size	-	Safety Joint	\$ 15.00
Kind Water		Formation Tested	-			Extra Folder Charge	-
Weight - lbs.-gal.		Size Drill Pipe	4 1/2" F.H.	Size Drill Collars	4 1/2" E.H.	Bowen	\$100.00
Viscosity - Sec.		Size Bottom Choke	1 1/2"	Size Surface Choke	1"	Jars Bowen	\$100.00
Filter Loss - c. c. Filter Cake - in.		Size Tool Valve	1"	Size Pilot Valve	5/8"		
BT. P.R.D. No. 69 Blanked Off No		Size Hook Wall Packer	-	Size Rings	-		
12 Hr. Clock No. 1778		Size D. E. Wall Packer	8" D.E.W.P.	No. Packers	1	Total	\$380.00
Est. Gauge Depth Temp. 100 of		PRD Device No.	3028	Blanked Off	No	Witnessed By	M. J. Florance
Pressure Readings Field Office Corrected		Size & Length Anchor	5-9/16" x 34'			Tester	H. G. Nelson
Initial Hydro Mud Pressure - 628 p.s.i.		REMARKS: Testing for oil & gas. Tool opened with strong blow and gradually					
Initial Flow Pres. - p.s.i.		decreased. Water flowed in 40 minutes. Slipped packer approx. 10'.					
Tool Open 40 Min.		Well Flowing water. 2nd. misrun, could not get to bottom. No					
Final Flow Pres. - p.s.i.		chart reproduction. 1st. misrun, drill collars were leaking.					
Time Closed In -							
Closed in Pres. - p.s.i.							
Final Hydro Mud Pressure - 612 p.s.i.		Amount of Cushion None					
		All depths measured from Rotary Table				No. Folders Reproduced	5

TIME

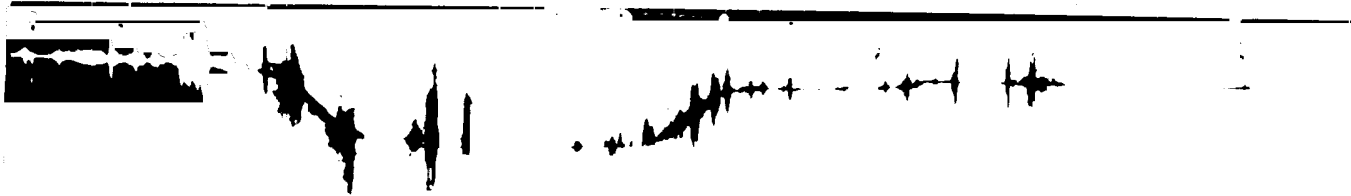

42296

PRESSURE

Each Horizontal Line Equal to 1000 p.s.i.



OIL WELL CEMENTING CO.

**Formation Testing
"Service Report"**

