Form 3160-5 (June 1990)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED				
Budget Bun	eau No.	1004-0135		
Expires:	March	31, 1 99 3		

5.	ц	ease De	signation ai	nd Seri	al No.
/	/	SF-C	79360		
16.	If	Indian.	Allottee or	Tribe	Name

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir. Use "APPLICATION FOR PERMIT—" for such proposals

7. If Unit or CA. Agreement Designation

tes any false, fictitious or fraudulent statemer


SUBMIT	RINCON UNIT			
i. Type of Well Oil Well X Gas Well Other	8. Well Name and No. RINCON #280			
2. Name of Operator UNION OIL COMPANY OF CALIFORNI	IA	9. API Well No.		
3. Address and Telephone No. P.O. Box 2620, Casper, WY 8260 4. Location of Well (Footage, Sec., T., R., M., or Survey D	02-2620 (307) 234-1563 Ext. 116 escription;	10. Field and Pool, or Exploratory Area Basin Fruitland Coal 11. County or Parish, State		
Sec. 15, T27N-R7W 2240' FNL & 1315' FEL		Rio Arriba, NM		
12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, R	EPORT, OR OTHER DATA		
TYPE OF SUBMISSION		TYPE OF ACTION		
X Nouce of Intent	Abandonment Recompletion	Change of Plans New Construction		
Subsequent Report	Plugging Back Casing Repair	Non-Routine Fracturing Water Shut-Off Conversion to Injection		
Final Abandonment Notice	Other Other Other Dipertment details, and give pertment dates, including estimated date of cold deaths for all markers and zones pertment to this work.)	Dispose Water (Note: Report results of multiple completion on Wei		
Union Oil Company of Califording to the attached	ornia proposes to plug and abandon procedure. DECENTRAL	the Rincon Unit Well #280 RECEIVED RECEIVED RECEIVED RECEIVED		
A correct				
14. Thereby centify that the foregoing is true and correct	Title Drilling Superintende	ent Date 8-25-95		
(This space for Federal or State office use)		AMENDED		
Approved by Conditions of approval, if any:		A described a sur-		

Title 13 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the finite or representations as to any matter within its jurisdiction. *See instruction on Reverse Side

P & A PROCEDURE

- 1) Test deadmen. MIRU service rig and equip. Kill well if necessary. ND tree. NU BOP's.
- 2) Tag ETD. Clean out if necessary. Strap out of hole w/2-3/8" tbg. TIH w/4½" cmt retainer on 2-3/8" tbg to 3000'. Pump thru retainer. Set retainer @ ±3000'.
- 3) Squeeze Fruitland perfs 3092'-3226' w/50 sx Class "B" cmt containing 2% Cacl. Sting out of retainer and spot 20 sx same cmt from 3000'-2750'. PU w/tbg to 2750'. Circ tbg and wellbore clean (PLUG #1).
- 4) POOH, laying down 2-3/8" tbg to 2290' (NOTE: Top of Ojo Alamo at 2234'). Pump and spot 20 sx same cmt from 2290' to 2050'. (PLUG #2).
- 5) POOH, laying down 2-3/8" tbg to 1320' (NOTE: Top of Naciemento at 1262'). Pump and spot 20 sx same cmt from 1320' to 1070' (PLUG #3).
- 6) POOH to $\pm 120'$. Pump and spot 15 sx same cmt from 120' to surface. (PLUG #4). Lay down tbg.
- 7) Cut off csg 4' below GL. Install dry hole marker. Clean up and restore location.

RINCON UNIT #280 BASIN FRUITLAND COAL UNIT H 15, 27N, 7W, RIO ARRIBA COUNTY, NM

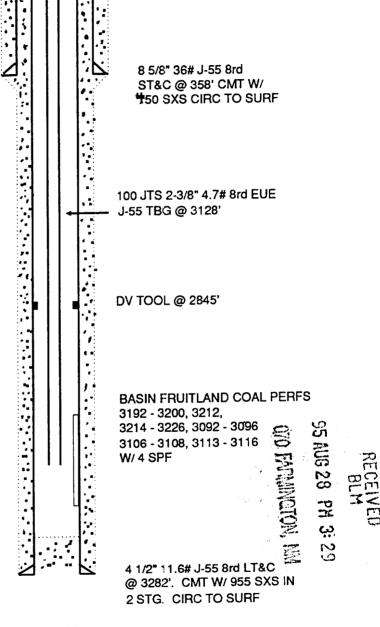

PBTD @ 3279'

TD 3283'