

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPPLICATE*
(Other instructions on re-verse side)

Form approved.
Budget Bureau No. 42 R1424.
5. LEASE DESIGNATION AND SERIAL NO.

SE 73392

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT--" for such purposes.)

1. OIL WELL GAS WELL OTHER

2. NAME OF OPERATOR
Skelly Oil Company

3. ADDRESS OF OPERATOR
1300 Lincoln Street, Denver, Colorado

4. LOCATION OF WELL (Report location clearly and in accordance with an **OIL CON. COM. DIST. 3** requirements.*
See also space 17 below.)
At surface
1850' T1L & 1850' T1L Section 14-26N-11W

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME
O. E. Randel

9. WELL NO.
1

10. FIELD AND POOL, OR WILDCAT
Gallegos Gallup


11. SEC., T., R., M., OR BKG. AND SURVEY OR AREA
Section 14-26N-11W

12. COUNTY OR PARISH
San Juan

13. STATE
New Mexico

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)
6446' DF

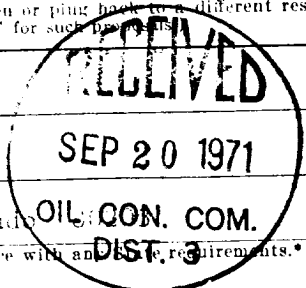

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>	WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>	FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input type="checkbox"/>	SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input checked="" type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	(Other) _____	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

All Depths shown are from Ground Level

8/14/71 - Moved in and rigged up Aztec casing pulling unit. Cut Gallup zone 2' tubing string off at 5203' and recovered. Set baker cement retainer at 5143'. Squeezed Gallup and Dakota perforations 6400-6416' and perfs. 5665-5465' with 60 sacks of regular cement with 1700# max. pressure. Pulled tubing and Baker setting tool. Cut off 7' csg. at 335', recovered 10 jts. of 7"OD 23# J-55 (300') and 17 jts. of 7"OD 20# J-55 (535') casing.

Perforated 7"OD casing at 1640', set cement plug 1640-1540'. Perforated 7"OD casing at 1105', set cement plug 1105-905'. Cement plug 880-780', 50' inside casing stub and 50' above casing stub.

Spotted 10' cement plug in surface casing. Installed dry hole marker. Completed P&A 8/17/71.

18. I hereby certify that the foregoing is true and correct

SIGNED B. L. Birkel TITLE Lead Clerk DATE September 17, 1971

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY: