

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

MM 016089

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

W. P. Saunders

9. WELL NO.

1

10. SURFACE AND POOL OF WILDCAT

Gallup & Dakota - Wildcat

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Sec. 11 - 26-N - 11-W

12. COUNTY OR PARISH

San Juan

13. STATE

New Mexico

1.

OIL WELL ☒ GAS WELL ☒ OTHER ☐

2. NAME OF OPERATOR

Skelly Oil Company

3. ADDRESS OF OPERATOR

Box 730 - Hobbs, New Mexico

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.)
At surface

660' FSL & 1900' FSL Sec. 11 - 26-N - 11-W

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

6484' DF

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

(Other) ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

ABANDON* ☐

CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐

FRACTURE TREATMENT ☐

SHOOTING OR ACIDIZING ☐

(Other) ☐

REPAIRING WELL ☐


ALTERING CASING ☐

ABANDONMENT* ☒

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. Moved in and rigged up workover rig on October 16, 1963.
2. Pulled rods and tubing from Gallup Zone.
3. Pulled tubing from Dakota Zone.
4. Milled over and pulled Baker Model "D" Production Packer, which was set at 6416'.
5. Drilled out cement from 6454' to 6504'.
6. Milled over bridge plug at 6504' and pushed plug to 6553'.
7. Spotted 50 sack cement plugs at the following depths:
6537-6271' - Dakota Zone
5746-5480' - Gallup Zone
8. Rigged down and moved out workover rig.
9. Shut down operations for 19 days.
10. Moved in and rigged up casing puller.
11. Cut 7" OD casing off at 2089' and pulled same.
12. Spotted cement plugs at the following depths:
2140-1990' - 75 sacks - Cut off point.
1950-1850' - 50 sacks - Picture Cliffs
1000- 900' - 50 sacks - Ojo Alamo
13. 10 sack cement plug at surface in 10-3/4" OD casing with 4" steel marker.
14. All intervals not cemented are filled with heavy mud laden fluid.

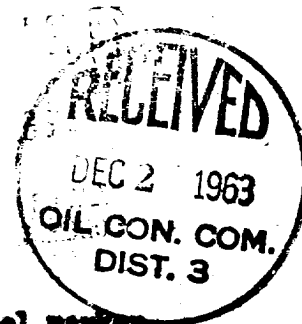

18. I hereby certify that the foregoing is true and correct

SIGNED **(SIGNED) H. E. Aab**

TITLE **Dist. Supt.**

DATE **Nov. 26, 1963**

(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____

DATE _____

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.