

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

APPLICATION FOR PERMIT TO DRILL, DEEPEN, OR PLUG BACK

1a. TYPE OF WORK PLUG BACK	5. LEASE NUMBER USA-SF-078135
1b. TYPE OF WELL GAS	6. IF INDIAN, ALL. OR TRIBE NAME
2. OPERATOR EL PASO NATURAL GAS CO. <i>Mexican Oil Co.</i>	7. UNIT AGREEMENT NAME HUERFANITO UNIT
3. ADDRESS & PHONE NO. OF OPERATOR P.O. BOX 4289 FARMINGTON, NM 87499 (505) 326-9700	8. FARM OR LEASE NAME
4. LOCATION OF WELL 990' FNL; 990' FEL	9. WELL NO. 70
14. DISTANCE IN MILES FROM NEAREST TOWN	10. FIELD, POOL, OR WILDCAT BASIN FRUITLAND COAL
15. DISTANCE FROM PROPOSED LOCATION TO NEAREST PROPERTY OR LEASE LINE.	11. SEC. T. R. M OR BLK. A SEC. 10, T26N, R09W
16. ACRES IN LEASE	12. COUNTY SAN JUAN
17. ACRES ASSIGNED TO WELL 320.00	13. STATE NM
18. DISTANCE FROM PROPOSED LOCATION TO NEAREST WELL DR. COMPL., OR APPLIED FOR ON THIS LEASE.	20. ROTARY OR CABLE TOOLS
21. ELEVATIONS (DF, FT, GR, ETC.) 6284' <i>DF 6L</i>	22. APPROX. DATE WORK WILL START
23. PROPOSED CASING AND CEMENTING PROGRAM	
*SEE OPERATIONS PLAN	
24. AUTHORIZED BY: <i>[Signature]</i> (CRB) REGULATORY AFFAIRS	<i>8-3-90</i> DATE

PERMIT NO. _____ APPROVAL DATE _____

APPROVED BY _____ TITLE _____ DATE _____

NOTE: THIS FORMAT IS ISSUED IN LIEU OF US BLM FORM 3160-3.
(NO ADDITIONAL DIRT WORK WILL BE REQUIRED)

APPROVED

OCT 10 1990

AREA MANAGER

Submit to Appropriate
District Office
State Lease - 4 copies
Fee Lease - 3 copies

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-102
Revised 1-1-89

OIL CONSERVATION DIVISION

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

WELL LOCATION AND ACREAGE DEDICATION PLAT

All Distances must be from the outer boundaries of the section

Operator El Paso Natural Gas		Lease Huerfanito Unit (SF-078135)		Well No. 70
Unit Letter A	Section 10	Township 26 North	Range 9 West	County San Juan
Actual Footage Location of Well: 990 feet from the North line and 990 feet from the East line				
Ground level Elev. 6284'	Producing Formation Fruitland Coal	Pool Basin	Dedicated Acreage: 320 Acres	

1. Outline the acreage dedicated to the subject well by colored pencil or machine marks on the plat below.
2. If more than one lease is dedicated to the well, outline each and identify the ownership thereof (both as to working interest and royalty).
3. If more than one lease of different ownership is dedicated to the well, have the interest of all owners been consolidated by communitization, unitization, force-pooling, etc.?
☒ Yes ☐ No If answer is "yes" type of consolidation unitization
If answer is "no" list the owners and tract descriptions which have actually been consolidated. (Use reverse side of this form if necessary.)
No allowable will be assigned to the well until all interests have been consolidated (by communitization, unitization, forced-pooling, or otherwise) or until a non-standard unit, eliminating such interest, has been approved by the Division.

Not resurveyed. Taken
from plat by D.H.Oheim
dated 3-7-61

990'
990'

OPERATOR CERTIFICATION

I hereby certify that the information
contained herein is true and complete to the
best of my knowledge and belief.

Signature

Peggy Bradfield

Printed Name

Regulatory Affairs

Position

El Paso Natural Gas

Company

Date
8-3-90

SURVEYOR CERTIFICATION

I hereby certify that the well location shown
on this plat was plotted from field notes of
actual surveys made by me or under my
supervision, and that the same is true and
correct to the best of my knowledge and
belief. 8-2-90

Date Surveyed

Signature

Professional

Surveyor

Neale C. Edwards

6857

6857

REGISTERED LAND SURVEYOR

Neale C. Edwards

RECEIVED
OCT 25 1990
OIL CON. DIV.
DIST. 3

0 330 660 990 1320 1650 1980 2310 2640 2970 3300 3630 3960 4290 4620 4950 5280 5610 5940 6270 6600 6930 7260 7590 7920 8250 8580 8910 9240 9570 9900

Huerfanito Unit #70
Procedure to Recomplete Fruitland Coal


1. Check location anchors.
2. MOL and rig up daylight pulling unit with rig pump and blow tank.
3. Kill PC with water as needed. ND wellhead. NU BOP. TOOH with 1" tubing.
4. Run CNL-GR-CCL. Set cast iron bridge plug at 2026'.
5. Pressure test casing to 3000 psi for 15 minutes.
6. Perforate the Fruitland Coal interval.
7. Pick up retrievable bridge plug and packer. TIH on 2 3/8" tubing. Isolate each coal interval and breakdown.
8. Fracture stimulate well.
9. Open well through variable choke and flow back slowly.
10. TIH with 2 3/8" tubing with expendable check on bottom. Blow well with air.
11. Obtain and record gauges. When returns dry up, TOOH with 2 3/8" tubing.
12. TIH with 2 3/8" 4.7# EUE tubing with pump out plug on bottom and common pump seating nipple one joint off bottom. Land tubing at 2016'. Nipple down BOP. Nipple up wellhead.

HUERFANITO UNIT #70


WELLBORE DIAGRAMS

BEFORE R/C

AFTER R/C

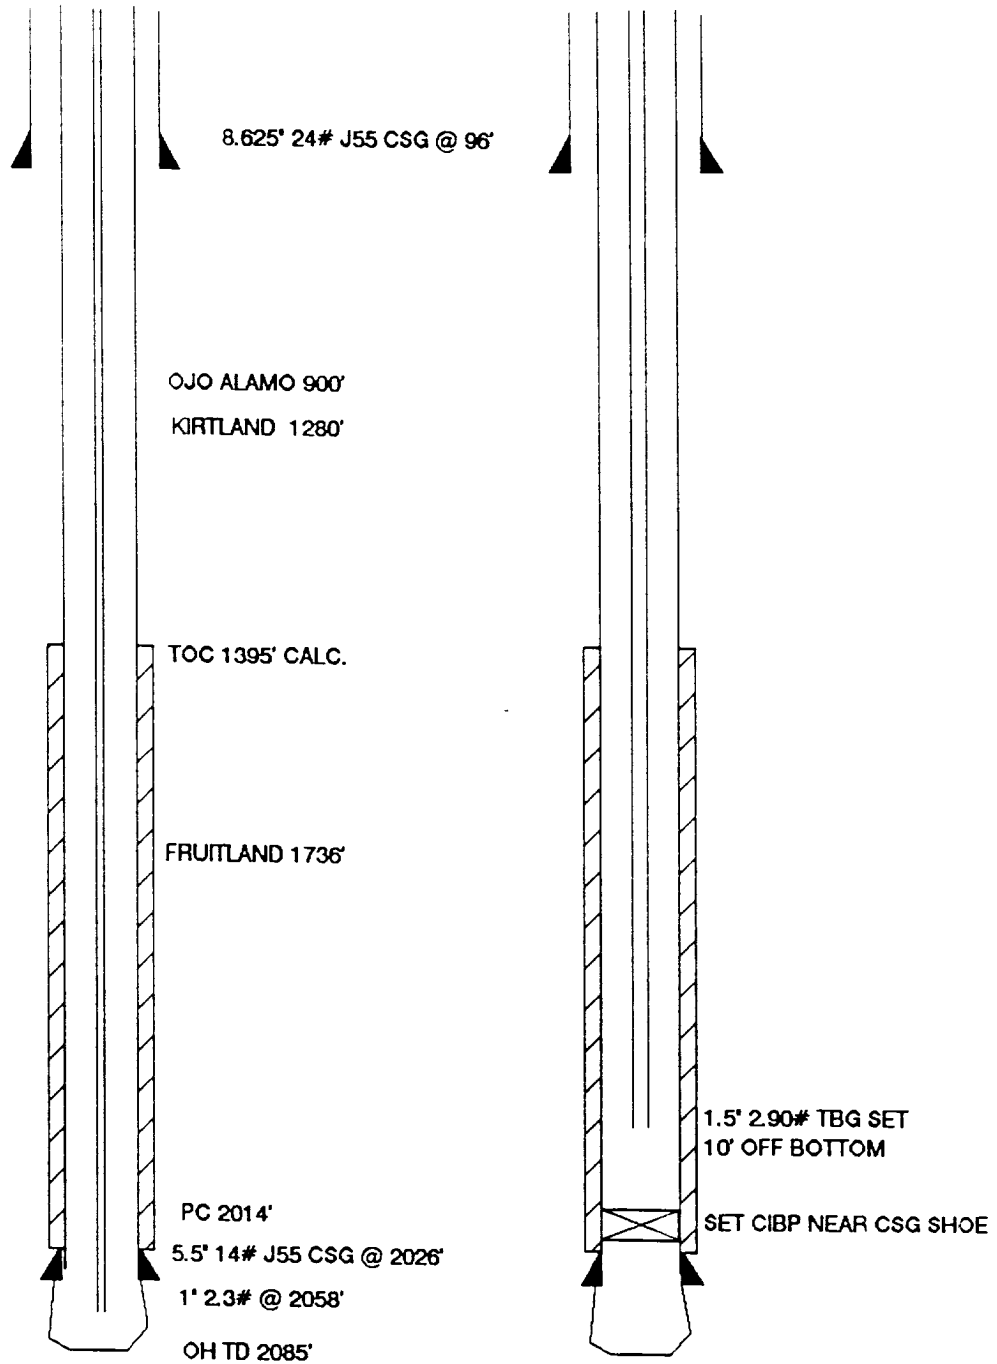

WORKOVER / RECOMPLETION B.O.P. SCHEMATIC

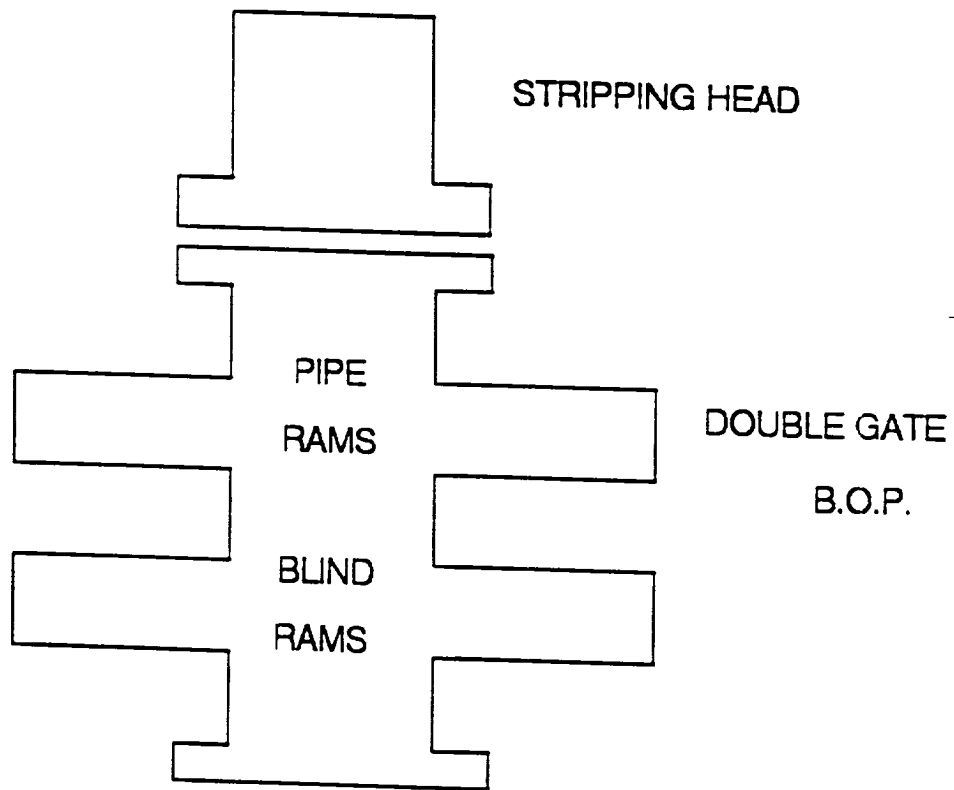

MINIMUM: 6" 2000 PSI DOUBLE GATE B.O.P.
MAXIMUM ANTICIPATED SHUT-IN WELLHEAD
PRESSURE IS LESS THAN 2000 PSI