

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPPLICATE*
(Other instructions on re-
verse side)Form 10-551
Revised Edition, No. 42-11421
5. LEASE REGISTRATION AND SERIAL NO.

SF-079679

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR EL PASO PRODUCTS COMPANY	8. FARM OR LEASE NAME Delhi Taylor
3. ADDRESS OF OPERATOR Post Office Box 1560, Farmington, New Mexico 87401	9. WELL NO. 3
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 660'/N, 1980'/E, Section 17, Township 26 North, Range 11 West	10. FIELD AND POOL, OR WILDCAT Gallegos Gallup
14. PERMIT NO.	15. ELEVATIONS (Show whether DF, RT, GR, etc.) 6163' GR
	12. COUNTY XXXXXXXX 13. STATE San Juan New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF ☐	PULL OR ALTER CASING ☐	WATER SHUT-OFF ☐	REPAIRING WELL ☐
FRACTURE TREAT ☐	MULTIPLE COMPLETE ☐	FRACTURE TREATMENT ☐	ALTERING CASING ☐
SHOOT OR ACIDIZE ☐	ABANDON* ☐	SHOOTING OR ACIDIZING ☐	ABANDONMENT* ☒
REPAIR WELL ☐	CHANGE PLANS ☐	(Other) ☐	(Other) ☐


(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work).*

Started Operations 6-5-68.

Finished Operations 6-8-68.

1. Load hole with mud laden fluid.
2. Squeeze Gallup perforations 5314' to 5183' - 15 sx. cement.
3. Shoot pipe loose at free point 2532' and pull.
4. Spot 30 sx. cement plug 4% gel 2584' to 2439' and pull.
5. Spot 30 sx. cement plug 4% gel 1436' to 1326' Across top of Picture Cliff.
6. Spot 30 sx. cement plug 4% gel 550' to 440' base of Ojo Alamo.
7. Place 10 sx. cement plug in top surface casing with welded marker in place.
8. Clean location.

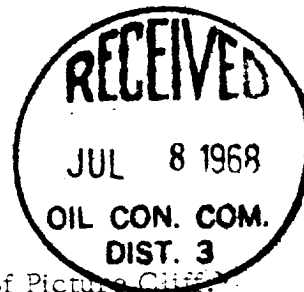

RECEIVED

JUL 3 1968

U. S. GEOLOGICAL SURVEY
FARMINGTON, N. M.

18. I hereby certify that the foregoing is true and correct

Original Signed By:

SIGNED Jim PayneTITLE AgentDATE July 6, 1968

(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____ DATE _____