

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT - " for such proposals

5. Lease Designation and Serial No.

NM-012202

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Bolack B LS #2

9. API Well No.

3004506629

10. Field and Pool, or Exploratory Area

Basin Fruitland Coal

11. County or Parish, State

San Juan

NM

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

Amoco Production CompanyCarley

Attention:

Bobbe Bren-Carley

3. Address and Telephone No.

P.O. Box 800, Denver, Colorado 80201

(303) 830-4542

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1650'FSL

1650'FW

Sec. 12 T 27 R 8W

Unit K

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

TYPE OF ACTION

- ☒ Notice of Intent:
☐ Subsequent Report
☐ Final Abandonment Notice

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other

- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Amoco Production Company requests approval to plug and abandon the subject location per the attached procedure. For your further information, a wellbore diagram of the current condition of the well is also attached. Upon abandonment, the well-site will be reclaimed and a final abandonment notice filed requesting inspection and release of bond.

If you require any further information regarding the proposed abandonment procedure, please contact CarolAnne Wyett at (303) 830-5578.

RECEIVED
NOV 8 1993

OIL CON. DIV
DIST. 3

SEE ATTACHED FOR
CONDITIONS OF APPROVAL

RECEIVED
BLM
OCT 29 11:11:22
OCT 29 11:11:22

Attachment

14. I hereby certify that the foregoing is true and correct

Signed Bobbe Bren-Carley

Title

Sr. Staff Assistant

Date

10-26-1993

(This space for Federal or State office use)

Approved by

Conditions of approval, if any:

Title

APPROVED

NOV 11 1993

DISTRICT MANAGER

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious, or fraudulent statements or representations as to any matter within its jurisdiction.


* See Instructions on Reverse Side

NMOCD

Bolack B LS #2
PXA Procedures

1. Check location for anchors. Install if necessary. Test anchors.
 2. MIRUSU. Blow down well. Kill if necessary with fresh water.
 3. POOH with 1" tbg. RIH with tbg and cement retainer. Set retainer at 2750'. Test casing integrity to 500#. Squeeze perfs at 2799'-2883' with 82.23 cuft of cement. Pull out of retainer and spot cement plug to 2150". (120.24 cuft)
 4. RIH with perfing gun and shoot squeeze holes at 1047'. Squeeze perfs with 25.26 cuft cement (100% excess). Pull out of hole and spot cement plug to 750' with 59.51 cuft cement.
 5. RIH with perfing gun and shoot squeeze holes at 50'. Attempt to circulate to surface through squeeze holes and displace cement to surface (35.25 cuft cement).
 6. Cut off casing and wellhead. Install PXA marker according to BLM or State requirements.
 7. Turn over to John Schwartz for reclamation.
 8. Rehabilitate location according to BLM or state requirements.
-

BOLACK B LS 002
LOCATION - 12 - 27N - 8W
SINGLE FT
ORIG.COMPLETION - 5/92 TO FT
LAST FILE UPDATE - 8/93 BY CSW

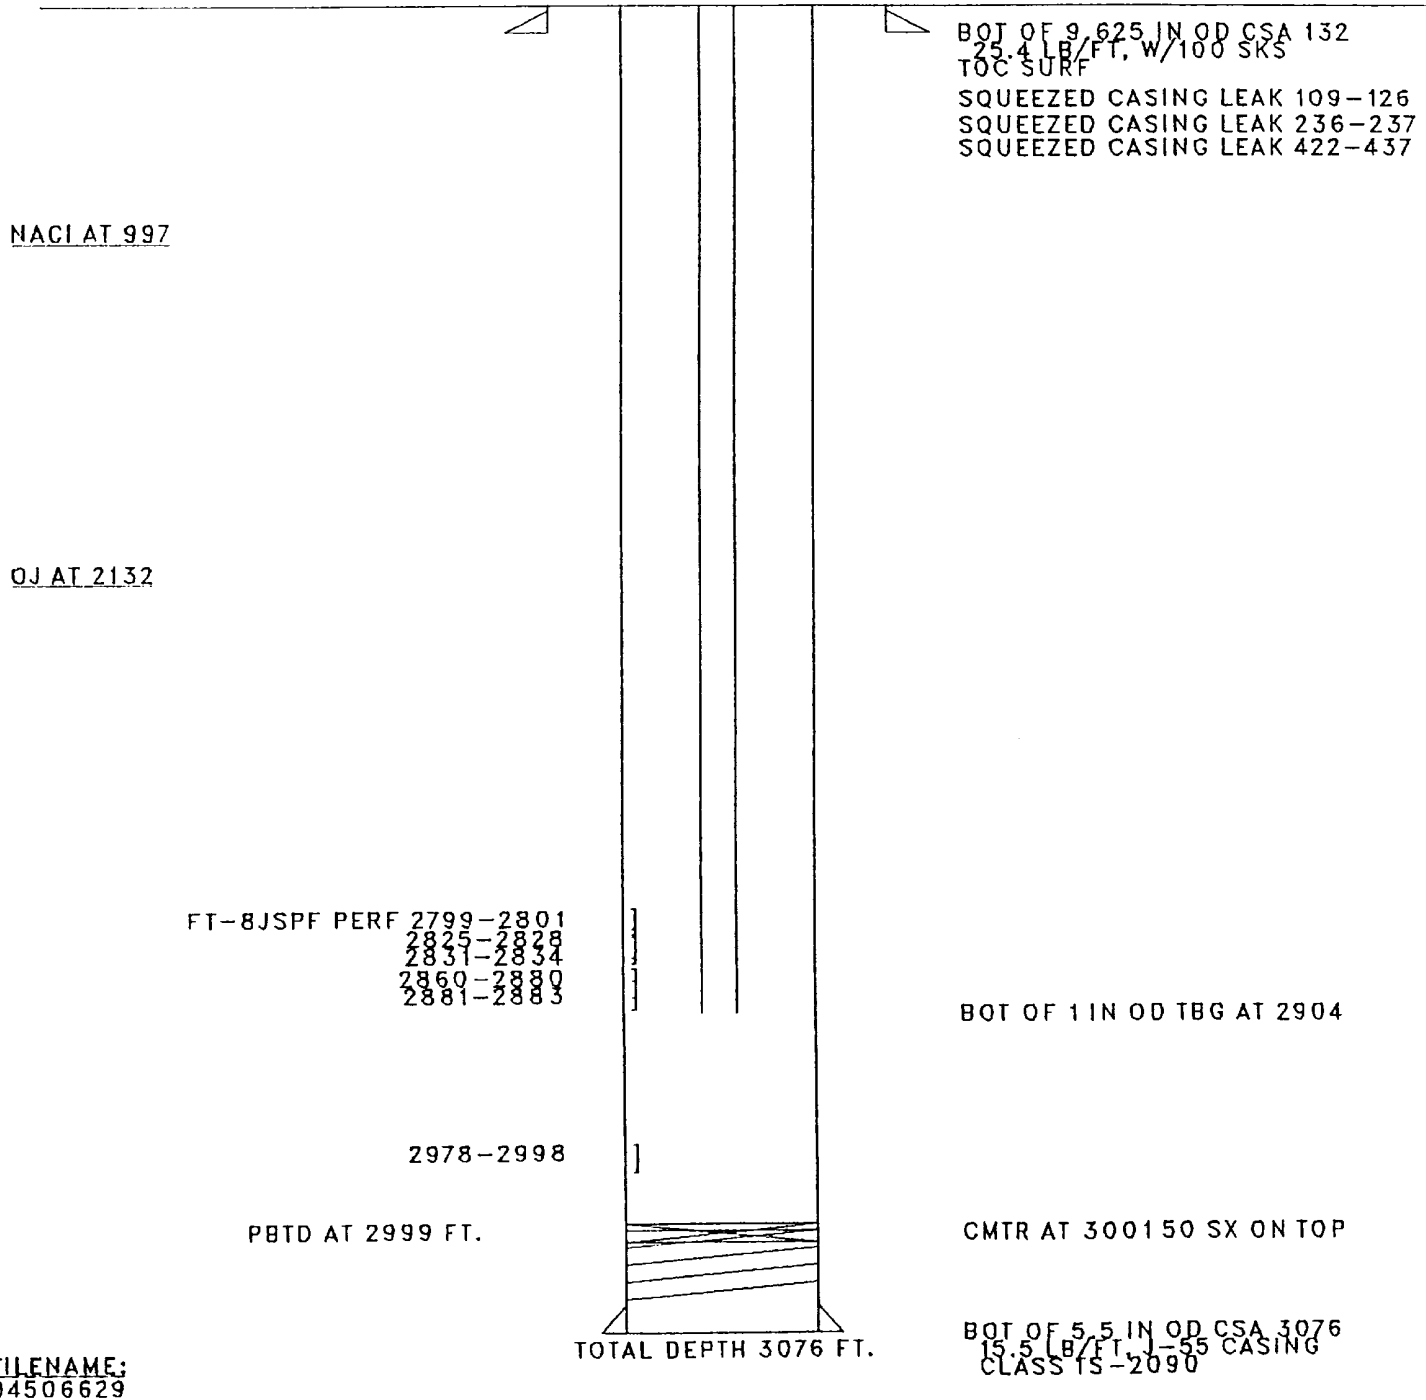

5/92 PLUGGED OFF PC
5/92 FIXED CASING LEAKS

UNITED STATES DEPARTMENT OF THE INTERIOR

BUREAU OF LAND MANAGEMENT
FARMINGTON DISTRICT OFFICE
1235 La Plata Highway
Farmington, New Mexico 87401

Attachment to Notice of

Re: Permanent Abandonment

Intention to Abandon

Well: 2 Bolack BLS

CONDITIONS OF APPROVAL

1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Leases."
2. Mike Flaniken with the Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 599-8907.
3. The following modifications to your plugging program are to be made (when applicable):

- 1.) Extend cement plug from 2750' (Top of retaining) to 2082' (50' above Top of Ojo Alamo @ 2132')
- 2.) Adjust cement volume placed behind the casing @ 1047' to fill 100' plus 100% excess.
(5 1/2" cas - 7 7/8" hole - @ 35 ft³)
- 3.) Perforate @ 182' and circulate cement to the surface. (50' below surface cas. @ 132')

Office Hours: 7:45 a.m. to 4:30 p.m.
