

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN THE
(Other instruct.
verse side)ICATE*
OR reForm 9-331-1
Budget Bureau No. 42-11/2-

5. LEASE DESIGNATION AND SERIAL NO.

14-20-0603-1249

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Navajo #33*

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT

Wildcat

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec 25, 26-N, 20-W

12. COUNTY OR PARISH 13. STATE

San Juan

New Mexico

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)1. OIL WELL ☐ GAS WELL ☐ OTHER ☒ Dry

2. NAME OF OPERATOR

Gulf Oil Corporation

3. ADDRESS OF OPERATOR

Box 670, Hobbs, New Mexico 88240

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

780' FNL & 1840' FEL, Section 25, 26-N, 20-W, N.M.P.M.

PLEASE CONSIDER THIS INFORMATION CONFIDENTIAL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, OR, etc.)

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

Plugged and Abandoned

(Note: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

REPAIRING WELL


ALTERING CASING

ABANDONMENT*

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting and proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

7030' TD.

Drilled 12-1/4" hole to 2817'. Drilled 8-3/4" hole to TD at 7030', June 9, 1969. No indication of commercial production. Obtained permission from Mr. Eddy Wyatt with 80' of hole in Roswell and plugged and abandoned as follows: Spotted 50 sack cement plug No. 1 from 6626' to 6626'; 50 sack cement plug No. 2 from 6539' to 6439'; 25 sack plug No. 3 from 3938' to 3882'; 40 sack plug No. 4 from 2144' to 2094'; 85 sack plug No. 5 from 469' to 369' across 12-3/8" casing shoe at 415' and 15 sack plug No. 6 from 30' to surface. Installed dry hole marker. Plugged and abandoned June 11, 1969.

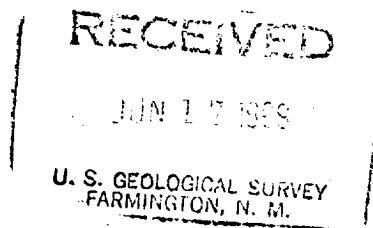

18. I hereby certify that the foregoing is true and correct

ORIGINAL SIGNED BY

SIGNED C. D. BORLAND

TITLE Area Production Manager

DATE June 16, 1969

(This space for Federal or State office use)

APPROVED
CONDITIONS OF APPROVAL, IF ANY:

OCT 18 1969

M. L. SEELINGER
ACTING DISTRICT ENGINEER

TITLE

DATE

*See Instructions on Reverse Side