

5-USGS

1-JTH
1-HLKendrick
1-F

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 42-R1424.
5. LEASE DESIGNATION AND SERIAL NO.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☐ OTHER ☒		7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR Beta Development Co.		8. FARM OR LEASE NAME Thompson Federal
3. ADDRESS OF OPERATOR 125 Petr. Club Plaza, Farmington, N.M.		9. WELL NO. 1
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 790/N 790/E		10. FIELD AND POOL, OR WILDCAT
14. PERMIT NO.		11. SEC. 1, 2, 3, 4, OR BLK. AND SURVEY OR AREA Basin Dakota 3-27N-12W NMPM
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 5913' GL		12. COUNTY OR PARISH San Juan
		13. STATE New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data


NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF ☐	PULL OR ALTER CASING ☐	WATER SHUT-OFF ☐	REPAIRING WELL ☐
FRACTURE TREAT ☐	MULTIPLE COMPLETE ☐	FRACTURE TREATMENT ☐	ALTERING CASING ☐
SHOOT OR ACIDIZE ☐	ABANDON* ☐	SHOOTING OR ACIDIZING ☐	ABANDONMENT* ☐
REPAIR WELL ☐	CHANGE PLANS ☒	(Other) ☐	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Propose to plug & abandon the above well, as follows:

Load hole w/water, circ. out drlg mud & shale to T.D. 6248'. Spot 50 sx cement in bottom to cover all Dakota perforations. Pull tbg up hole & pump in 15 sx cement @ base of Gallup @ 5202'; pull tbg up hole, put 15 sk plug @ base of Point Lookout @ 4320'; pull tbg up hole & put 15 sk plug @ base of Pictured Cliffs & DV tool @ 1831'. Perforate 4-1/2" csg @ base of Ojo Alamo @ 480'. Squeeze in formation approx. 20 sx cement, leave 20 sk plug in csg; put 15 sk plug in surface pipe w/marker.

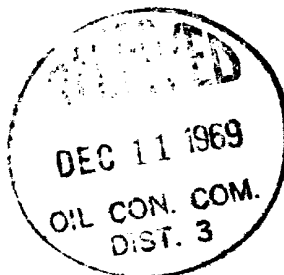

DEC 10 1969

18. I hereby certify that the foregoing is true and correct

SIGNED Original signed by: D. E. MAXTER TITLE Superintendent DATE December 8, 1969

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

