

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE\*  
(Other instructions on reverse side)

Form approved.  
Budget Bureau No. 42-B-1434.

**SUNDRY NOTICES AND REPORTS ON WELLS**

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER		5. LEASE DESIGNATION AND SERIAL NO. <b>SF-046563</b>
2. NAME OF OPERATOR <b>Petroleum Corporation of Texas</b>		6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR <b>P. O. Box 911, Breckenridge, Texas 76024</b>		7. UNIT AGREEMENT NAME
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface <b>1660' FSL and 950' FWL</b>		8. FARM OR LEASE NAME <b>Feasel</b>
14. PERMIT NO.		9. WELL NO. <b>1</b>
15. ELEVATIONS (Show whether DF, RT, GR, etc.)		10. FIELD AND POOL, OR WILDCAT <b>Fulcher Kutz P. C.</b>
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA <b>Sec. 33-T28N-R10W N.M.P.M.</b>
		12. COUNTY OR PARISH <b>San Juan</b>
		13. STATE <b>New Mex.</b>

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐  
FRACTURE TREAT ☐  
SHOOT OR ACIDIZE ☐  
REPAIR WELL ☐  
(Other) ☐

PULL OR ALTER CASING ☐  
MULTIPLE COMPLETE ☐  
ABANDON\* ☐  
CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐  
FRACTURE TREATMENT ☐  
SHOOTING OR ACIDIZING ☐  
(Other) ☐

REPAIRING WELL ☐  
ALTERING CASING ☐  
ABANDONMENT\* ☒


(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

12-3-74

This well was plugged and abandoned in the following manner:

1. No casing was cut off and pulled from well.
2. 60 sx. cement plug set from 1750'-2040'.
3. Perforate 5-1/2" casing at 1160' base of Ojo Alamo and squeeze with 40 sxs cement. Left top of cement at 1050' in 5-1/2" casing.
4. Spot 20 sx cement plug at base of surface casing.
5. Set 10 sx cement plug at surface and installed Dry Hole Marker.

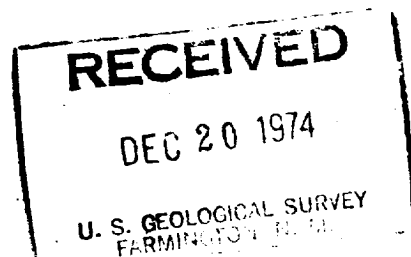

For: Petroleum Corporation of Texas

18. I hereby certify that the foregoing is true and correct

SIGNED Ewell N. Walsh, P. E.  
(This space for Federal or State office use)

President, Walsh Engineering  
& Prod. Corp.

DATE December 19, 1974

APPROVED BY \_\_\_\_\_  
CONDITIONS OF APPROVAL, IF ANY:

TITLE \_\_\_\_\_

DATE \_\_\_\_\_