

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

5. Lease Designation and Serial No.
SF-046563

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Kutz Government #4

9. API Well No.

10. Field and Pool, or Exploratory Area

Fulcher Kutz PC

11. County or Parish, State

San Juan County, N.M.

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT--" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

BRECK OPERATING CORPORATION

3. Address and Telephone No. c/o Walsh Engr. & Prod. Corp.

7415 E. Main Farmington, N.M. 87402 505 327-4892

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

990'FNL & 990'FEL
Section 34, T28N, R10W

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other _____
☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

BRECK OPERATING CORPORATION plans to plug and abandon this well as per attached procedure.

RECEIVED
JUN - 5 1995
OIL CON. DIV.
BUREAU

14. I hereby certify that the foregoing is true and correct

Signed Paul C. Thompson

Title Paul C. Thompson, Agent

Date 5/26/95

(This space for Federal or State office use)

Approved by _____
Conditions of approval, if any:

Title _____

Date _____

UNOCOD

Walsh Engineering and Production

**Plug and Abandon Procedure for
Breck Operating Corporation
Kutz Government #4**

Location: NE/4 Sec 34 T28N R10W
San Juan County, NM


Date: May 26, 1995

Field: Fulcher Kutz Pictured Cliffs
Surface: BLM
Minerals: BLM SF 04563

Elev: GL 5884'
PBSD 1952'


Procedure:

1. MOL and RU P&A rig. Hold safety meeting.
2. Blow well down and ND tubing head and NU BOP. Lay 2-3/8" flow lines to pit. Pressure test BOP.
3. Release donut but do not TOH with 1-1/2" tubing.
4. Spot 32 sx (38 cu. ft.) of cement from 1821' to 1952' (50' above PC to PBSD with 100% excess in open hole and 50% excess in casing).
5. POH to 1500' and WOC 4 hrs. TIH and tag cement.
6. POH to 878'. Spot 12 sx (14 cu. ft.) of cement from 878' to 778' (50' above and below top of Ojo Alamo with 50% excess).
7. POH to 150'. Spot 17 sx. (20 cu.ft.) of cement from 150' to surface. Finish TOH.
8. ND BOP and cut off wellhead below surface casing. Install P&A marker. Rig down and release rig.
9. Clean location and restore as per BLM requirements.



Paul C. Thompson, P.E.

BRECK OPERATING KUTZ GOVERNMENT #4
 990 FNL 990 FEL SEZ 34, T2PN R10W R2E S10N
 CURRENT STATUS.

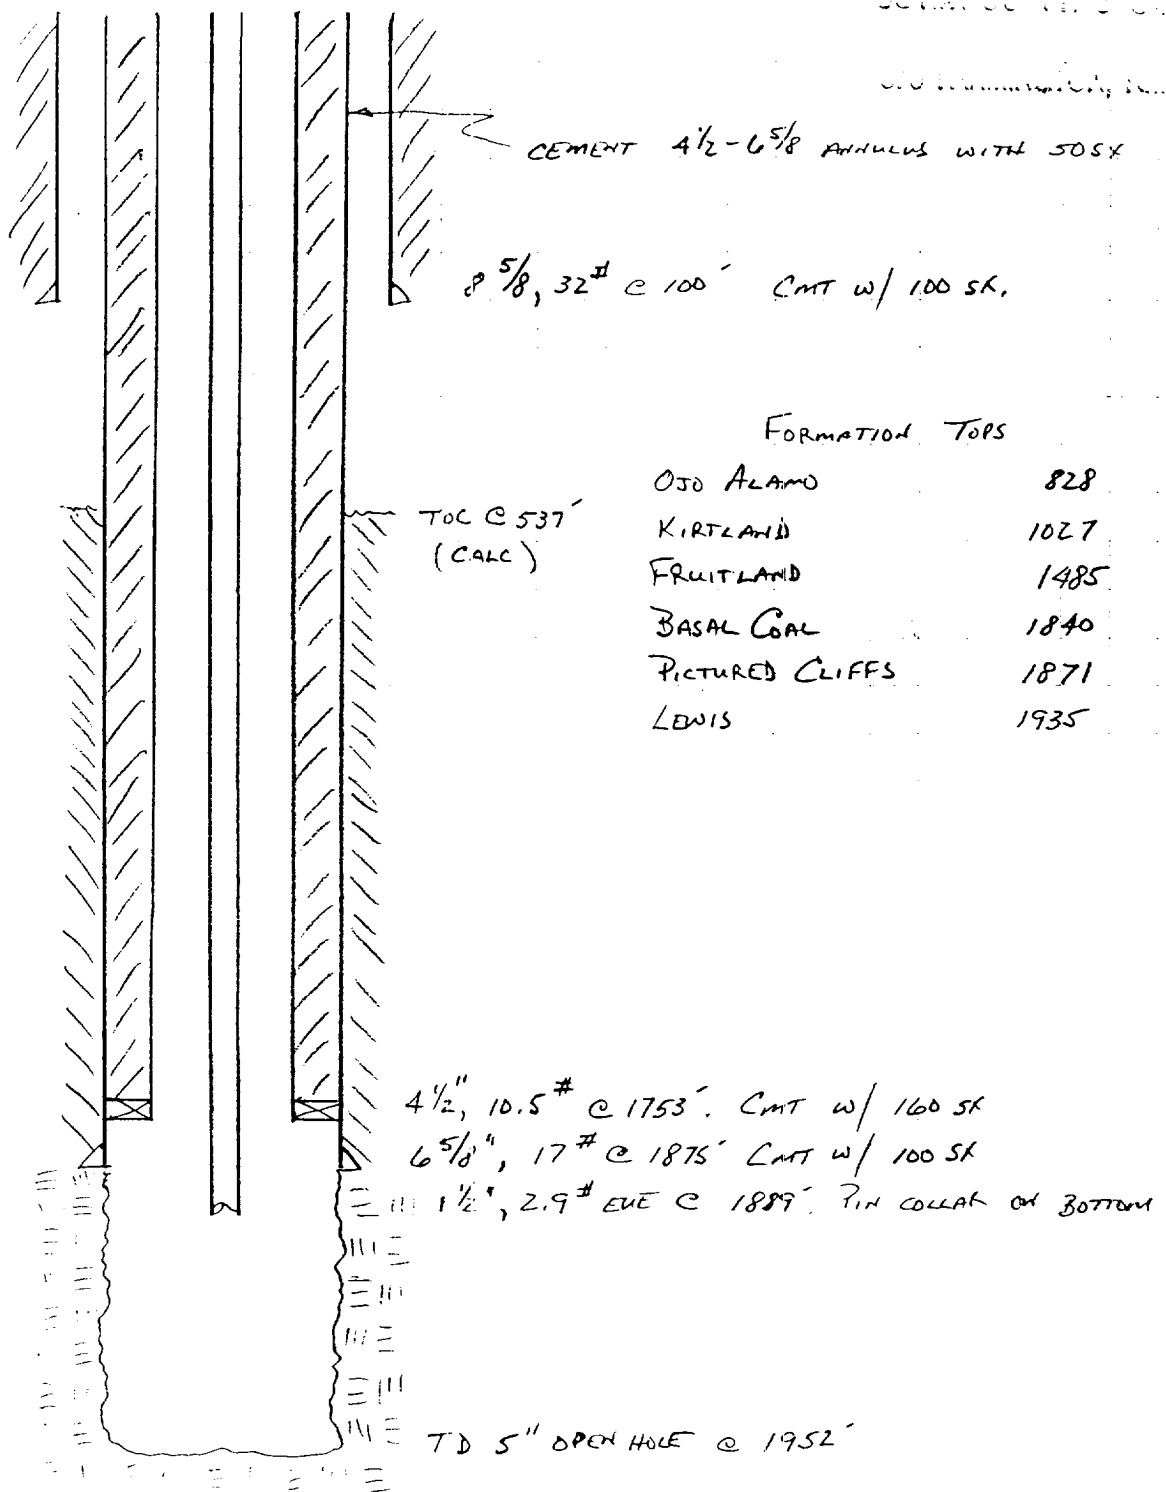


FRAC W/ 500 GAL SNG 1953
 FRAC W/ 38,000# SAND 1956

BRECK OPERATING KUTZ GOVERNMENT #4

990 FNL 990 FEL SEZ 34, T28N R10W

P&A STATUS.

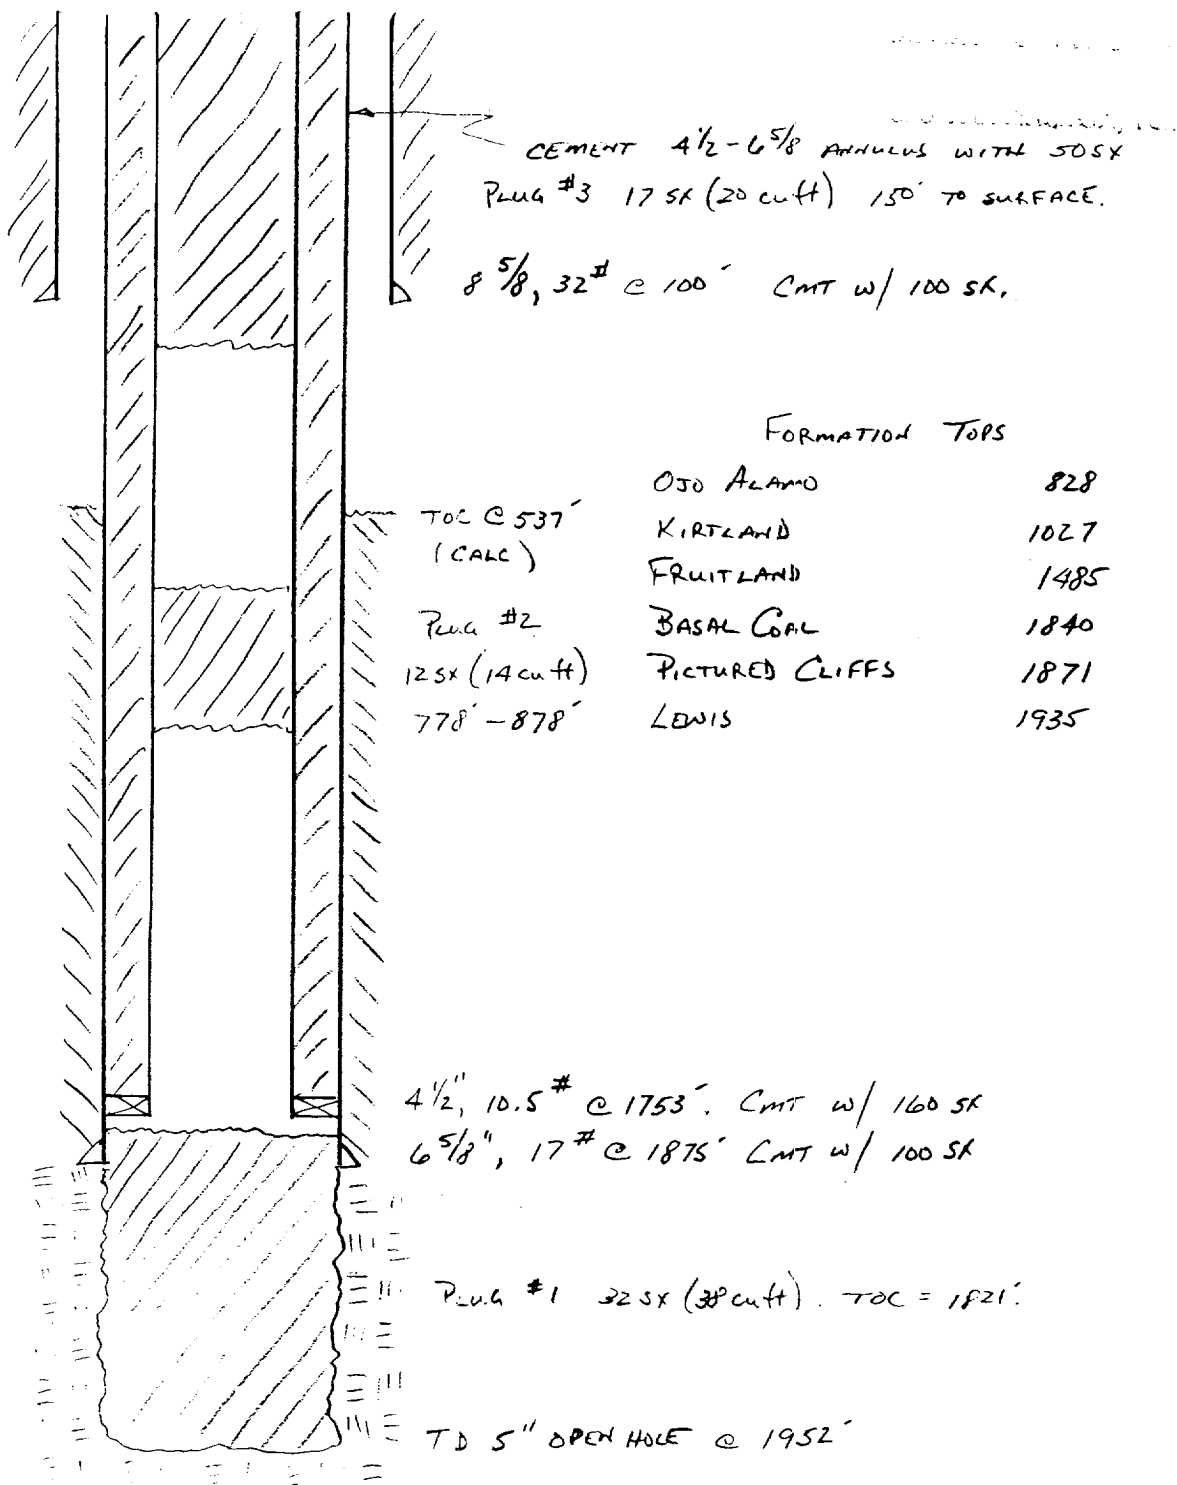

FRAC W/ 500 GAL SNG 1953

FRAC W/ 38,000# SAND 1956