

Form 9-331  
Dec. 1973

Form Approved.  
Budget Bureau No. 42-R1424

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

**SUNDRY NOTICES AND REPORTS ON WELLS**

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well ☐ gas well ☒ other ☐

2. NAME OF OPERATOR  
El Paso Natural Gas Company

3. ADDRESS OF OPERATOR  
P.O. Box 289, Farmington, NM 87401

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)  
1180'N, 1460'E  
AT SURFACE:  
AT TOP PROD. INTERVAL:  
AT TOTAL DEPTH:


16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐  
FRACTURE TREAT ☐  
SHOOT OR ACIDIZE ☐  
REPAIR WELL ☐  
PULL OR ALTER CASING ☐  
MULTIPLE COMPLETE ☐  
CHANGE ZONES ☐  
ABANDON\* ☐  
(other) Casing Repair

SUBSEQUENT REPORT OF:

☐  
☐  
☐  
☐  
☐  
☐  
☐  
☐  
☐  
☒

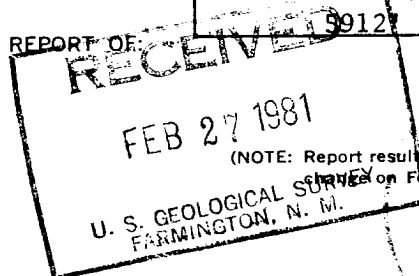

5. LEASE  
SF 077106

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME  
Lackey B

9. WELL NO.  
16

10. FIELD OR WILDCAT NAME  
Basin Dakota

11. SEC., T., R., M. OR BLK. AND SURVEY OR AREA  
Sec. 20, T-28-N, R-9-W  
NMPM

12. COUNTY OR PARISH  
San Juan

13. STATE  
New Mexico

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)  
1912' GL

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

- 1-20-81: MOL & RU. Trying to release packer, packer was stuck. Parted tubing.  
1-29-81: Tried to jar packer, couldn't get loose.  
1-31-81: Cut packer.  
2-6-81: Milled on packer & fished same.  
2-7-81: Set Bridge Plug at 6525'. Found bottom hole at 3885' and top hole at 2304'. Set cement retainer at 2100'. Cemented w/ 236 cu. ft. cement. WOC 18 hours.  
2-9-81: Drilling out cement. Found top hole at 2396' bottom at 2457'. Set cement retainer at 2141'. Cemented w/ 118 cu. ft. cement.  
2-12-81: Ran 212 joints of 2 3/8", 4.7#, J-55 6636' set at 6647'. Seating Nipple set at 6616'. Baker Model R Packer set at 6455'.

Subsurface Safety Valve: Manu. and Type \_\_\_\_\_ Set @ \_\_\_\_\_ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED A. J. Duico TITLE Drilling Clerk DATE February 25, 1981

(This space for Federal or State office use)

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_  
CONDITIONS OF APPROVAL, IF ANY:

NMCCC

ACCEPTED FOR RECORD  
MAR 5 1981  
FARMINGTON DISTRICT  
BY R.B.