

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well ☐ gas well ☒ other

2. NAME OF OPERATOR

Continental Oil Company

3. ADDRESS OF OPERATOR

Box 460, Hobbs, N.M. 88240

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)

AT SURFACE: 990' FSL + 1550' FEL

AT TOP PROD. INTERVAL:

AT TOTAL DEPTH: None.

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

CHANGE ZONES ☐

ABANDON* ☒

(other)

SUBSEQUENT REPORT OF:

☐

☐

☐

☐

☐

☐

☐

☐

☐

5. LEASE

NM 18315

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Coronado 29-4

9. WELL NO.

10. FIELD OR WILDCAT NAME

Gobernador Pictured Cliffs

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Sec. 2, T-29N, R-4W

12. COUNTY OR PARISH

Rio Arriba

13. STATE

N.M.

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)

7015' GR

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Drilled 7 7/8" hole from 500' to 4065' T.D. Logged the well 4-13-78, IT IS PROPOSED TO PLUG THE WELL AS FOLLOWS:
1. Run in hole with drill pipe + circulate 9.0 ppq mud for 30 min.
2. Spot a 500' cement plug across the Pictured Cliffs from ± 4068 to ± 3575' w/ 170 sx of class B cement.
3. Pull w/ drill pipe to ± 3100'. Spot 350' cement plug across from ± 3100' to ± 2750' w/ 150 sx cement.
4. Pull w/ drill pipe to ± 550'. Spot 100' cement plug across 8 1/2" csg shoe from ± 550' to ± 450' w/ 50 sx cement.
5. Pull w/ drill pipe to ± 30'. Spot 30' cement plug from ± 30' to surface w/ 10 sx cement. Rel Rig. Erect Dry hole marker.

Subsurface Safety Valve: Make and Type

Verbal Approval Recd from Mr. Jerry Long Set @ 4-14-78

18. I hereby certify that the foregoing is true and correct



SIGNED Wm. A. Rutterfield

TITLE Admin. Supv. DATE 4-14-78

(This space for Federal or State office use)

APPROVED BY
CONDITIONS OF APPROVAL, IF ANY:

TITLE

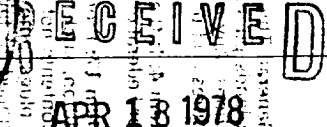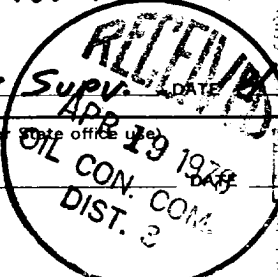

U.S. GEOLOGICAL SURVEY

DURANGO, COLORADO

*See Instructions on Reverse Side

USGS-Durango (5), North Western Pipeline, El Paso, NTH, DEA, F.I.e.