

NO. OF COPIES RECEIVED	3
DISTRIBUTION	
SANTA FE	1
FILE	1
U.S.G.S.	
LAND OFFICE	
OPERATOR	1

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.		

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. <input type="checkbox"/> OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER	7. Unit Agreement Name
2. Name of Operator AMOCO PRODUCTION COMPANY	8. Farm or Lease Name Gutierrez Gas Com
3. Address of Operator 501 Airport Drive, Farmington, New Mexico 87401	9. Well No. 1
4. Location of Well UNIT LETTER <u>B</u> <u>990</u> FEET FROM THE <u>North</u> LINE AND <u>1650</u> FEET FROM THE <u>East</u> LINE, SECTION <u>4</u> TOWNSHIP <u>29N</u> RANGE <u>9W</u> NMPM.	10. Field and Pool, or Wildcat Blanco Mesaverde
15. Elevation (Show whether DF, RT, GR, etc.) GL 5611'	12. County San Juan

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:


PERFORM REMEDIAL WORK <input checked="" type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JQB <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

The above referenced well is suspected of having a casing leak. It is intended to repair the leak in the following manner.

1. Set a bridge plug above the Mesaverde perfs in the existing 5" liner.
2. Locate and determine severity of leak.
3. Cement squeeze leak if necessary to get circulation to surface.
4. Run 5" liner inside of 7" casing and set liner above existing liner at 3734'.
5. Cement liner in place and circulate cement to surface between casing strings.
6. Clean out to TD and return to production.

The work will commence on this casing repair upon receiving approval.

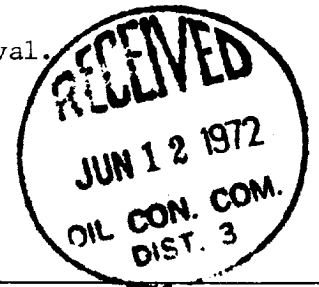

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

Signed J. ARNOLD SNELL Title Area Engineer DATE June 9, 1972

APPROVED BY [Signature] TITLE PETROLEUM ENGINEER DIST. NO. 3 DATE JUN 12 1972
CONDITIONS OF APPROVAL, IF ANY: