

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER		5. LEASE DESIGNATION AND SERIAL NO. SF 079383	
2. NAME OF OPERATOR El Paso Natural Gas Company		6. IF INDIAN, ALLOTTEE OR TRIBE NAME	
3. ADDRESS OF OPERATOR Box 990, Farmington, New Mexico		7. UNIT AGREEMENT NAME San Juan 30-6 Unit	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1485' FNL, 1695' FEL, Sec. 27, T-30-N, R-7-W		8. FARM OR LEASE NAME Wilson #3 30-6 U.	
14. PERMIT NO.		9. WELL NO. 3 #97	
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 6717' DF		10. FIELD AND POOL, OR WILDCAT Blanco Mesa Verde	
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 27, T-30-N, R-7-W N.M.P.M.	
		12. COUNTY OR PARISH San Juan	13. STATE New Mexico


16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF ☐	PULL OR ALTER CASING ☐	WATER SHUT-OFF ☐	REPAIRING WELL ☐
FRACTURE TREAT ☒	MULTIPLE COMPLETE ☐	FRACTURE TREATMENT ☐	ALTERING CASING ☐
SHOOT OR ACIDIZE ☐	ABANDON* ☐	SHOOTING OR ACIDIZING ☐	ABANDONMENT* ☐
REPAIR WELL ☒	CHANGE PLANS ☐	(Other) ☐	
(Other) Case & Cement Mesa Verde		(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)	

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

Due to a casing leak it is intended to workover and recomplete this well in the following manner:

Pull tubing or cut off tubing if it is stuck.
Test 7" casing, isolate leaks and squeeze w/cement. Perforate at approximately 2785' (Top of Kirtland) and block squeeze with 100 sacks. If leaks are near 2785', there will be no extra squeeze at the top of the Kirtland.
Clean out old hole or drill new side-tracked hole through Mesa Verde to 5960'. Run full string of 4 1/2" production casing and sand-water frac Mesa Verde in two stages. If it is necessary to cut off the tubing, squeeze the open hole through a retainer set near the bottom of the 7" casing with approximately 250 sacks of cement.

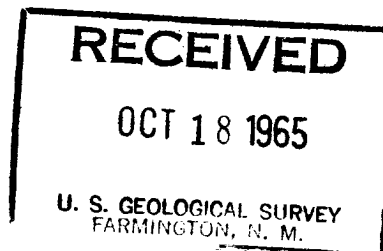

18. I hereby certify that the foregoing is true and correct

Original signed by
SIGNED Carl E. Matthews TITLE Petroleum Engineer DATE 10-15-65

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY: _____

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.