

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.
5. LEASE DESIGNATION AND SERIAL NO.
SF 080713-A
6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER		7. UNIT AGREEMENT NAME	
2. NAME OF OPERATOR El Paso Natural Gas Company		8. FARM OR LEASE NAME Barron Kidd	
3. ADDRESS OF OPERATOR PO Box 990, Farmington, NM 87401		9. WELL NO. 1-B (T&A)	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) ft surface 990'N, 930'E		10. FIELD AND POOL, OR WILDCAT Blanco Mesa Verde	
14. PERMIT NO.		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 22, T-30-N, R-6-W NMPM	
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 6517'GL		12. COUNTY OR PARISH Rio Arriba	
		13. STATE New Mexico	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input checked="" type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
(Other) <input type="checkbox"/>	

SUBSEQUENT REPORT OF:

WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input type="checkbox"/>
(Other) <input type="checkbox"/>	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

This well was temporarily abandoned in the following manner:

A 100 sk. cement plug was placed across the open hole section.

It is planned to permanently abandon the well in the following manner:

Spot a 50 sk. cement plug across the 7" casing shoe.


Perforate a squeeze hole opposite the Pictured Cliffs. Spot a 50 sk. cement plug, displacing cement into the formation.

Determine the free point of production casing, shoot off casing.

Spot a 50 sk. cement plug on the casing stub.

Spot a 25 sk. cement plug at the base of the surface pipe.

Place a 15 sk. cement plug at the surface, install a dry-hole marker and clean up location.

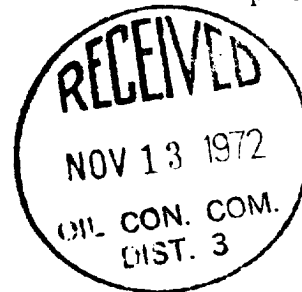

18. I hereby certify that the foregoing is true and correct

SIGNED

[Signature]

TITLE Petroleum Engineer

DATE November 8, 1972

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

U. S. GEOLOGICAL SURVEY
WASHINGTON, D. C.