

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)OIL
WELL ☒GAS
WELL ☐OTHER ☐

Name of Operator

James Hatcher

Address of Operator

Bloomfield Oilfield Service, Box 1641, Bloomfield, N.M.

Location of Well

UNIT LETTER _____ FEET FROM THE _____ LINE AND _____ FEET FROM

THE _____ LINE, SECTION 21 TOWNSHIP 29N RANGE 11W NMPM.

15. Elevation (Show whether DF, RT, GR, etc.)

5a. Indicate Type of Lease

State ☐Fee ☒

5. State Oil & Gas Lease No.

7. Unit Agreement Name

8. Farm or Lease Name

Elvis Roberts Bergin

9. Well No.

10. Field and Pool, or Wildcat

Farmington Sand

12. County

San Juan

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:PERFORM REMEDIAL WORK ☐TEMPORARILY ABANDON ☐PULL OR ALTER CASING ☐PLUG AND ABANDON ☒CHANGE PLANS ☐OTHER ☐REMEDIAL WORK ☐COMMENCE DRILLING OPS. ☐CASING TEST AND CEMENT JOB ☐OTHER ☐ALTERING CASING ☐PLUG AND ABANDONMENT ☒

7. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

12-9-81 - Moved rig and equipment on location and rigged up, killed well, pull 1040 ft. of 1 in. tubing out of hole.

12-10-81 - Attempt to release packer, unable to, backed 2 7/8 tubing off and tripped out of the hole. Recovered 1060 ft of 2 7/8.

12-11-81 - Tripped in the hole with 25 joints tubing. Mixed and pumped 35 sacks, plug from 750 to 600, pulled tubing back out of the hole. Perf. 5 1/2 @ 450, tripped in the hole with 15 joints, mix and pump 30 sacks, plug from 350 to 450, didn't hold. Mix and pumped 30 sacks, tripped out of the hole.


12-12-81 - Tripped in the hole with 5 joints tubing, mix and pumped 20 sacks, circ. cement to surface.

12-13-81 - Cut off well head and clean location. Install dry hole marker, location ready for inspection.

8. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

James Hatcher

TITLE

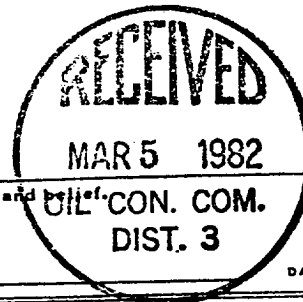

DATE 12-21-81

APPROVED BY: *Charles Shoben*

TITLE DEPUTY OIL & GAS INSPECTOR, DIST. #3

DATE DEC 21 1981

CONDITIONS OF APPROVAL, IF ANY:

911 2/1