

Form 9-331  
(May 1963)UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEYSUBMIT IN TRIPPLICATE\*  
(Other instructions on re-  
verse side)Form approved.  
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

14-20-0603-10010

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

Navajo

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

North Hogback 12

9. WELL NO.

4

10. FIELD AND POOL, OR WILDCAT

Slickrock-Dakota

11. SEC., T., R., M., OR BLK. AND  
SURVEY OR AREA

Sec. 12, T29N, R17W

12. COUNTY OR PARISH

San Juan

13. STATE

N.M.

## SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1.

OIL WELL ☒ GAS WELL ☐ OTHER

2. NAME OF OPERATOR

Walter Duncan

3. ADDRESS OF OPERATOR

P. O. Box 234, Farmington, New Mexico 87401

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.\*

See also space 17 below.)  
At surface

362' FNL, 1004' FEL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

4983 G.L.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

## NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON\*

CHANGE PLANS

## SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT\*

(NOTE: Report results of multiple completion on Well  
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

8-25-72 Move in backhoe to clear location and move in Gatewood  
cable tool rig.8-29-72 Finished driving 7 5/8" surface csg to 30' - rig down  
cable tools and move to North Hogback 1 #12.9-6-72 Rig up Lee Wilson rig and drill 6 3/4" hole to 280' with water.  
Top Gallup by samples 55'.9-7-72 Drilled 6 3/4" hole to 657' with water. Prepare to run casing.  
Top Dakota by samples 656'.9-8-72 Ran 22 Jts. 5 1/2" O.D., 15.5#, 8Rd., S.T.&C. "B" condition  
casing. T.E. 663.23' set at 657 G.L. cemented with 50 sacks  
class "A" plus 2% CaCl. Good mud returns while cementing,  
bumped plug with 1300 psi, left shut in with 600 psi.  
P.O.B. 4:00 p.m., 9-7-72, W.O.C.

18. I hereby certify that the foregoing is true and correct

Original signed by

SIGNED

Jim L. Jacobs

TITLE Agent


DATE 9-15-72

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

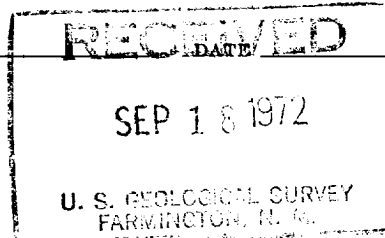

\*See Instructions on Reverse Side