

DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

NEW MEXICO OIL CONSERVATION COMMISSION

Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT --" (FORM C-101) FOR SUCH PROPOSALS.)

1.

OIL WELL ☐

GAS WELL ☒

OTHER -

2. Name of Operator
Flag-Redfern Oil Co.

3. Address of Operator
P O Box 208, Farmington, NM 87401

4. Location of Well
UNIT LETTER A 220' FEET FROM THE North LINE AND 500 FEET FROM
THE East LINE, SECTION 4 TOWNSHIP 29N RANGE 12W NMPM.

15. Elevation (Show whether DF, RT, GR, etc.)
5720' G.L.

7. Unit Agreement Name

8. Farm or Lease Name
Crouch Mesa

9. Well No.
#1

10. Field and Pool, or Wildcat
Fulcher-Kutz *PC*

12. County
San Juan

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

TEMPORARILY ABANDON ☐

PULL OR ALTER CASING ☐

OTHER ☐

PLUG AND ABANDON ☐

CHANGE PLANS ☐

OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐

COMMENCE DRILLING OPNS. ☒

CASING TEST AND CEMENT JOB ☐

OTHER ☐

ALTERING CASING ☐

PLUG AND ABANDONMENT ☐

OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

See attached reports for spud and surface casing, 5-29 thru 6-9-81.




18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED *Thomas A. Dugan* Thomas A. Dugan TITLE Agent DATE 6-12-81

APPROVED BY Original Signed by FRANK T. CHAVEZ TITLE SUPERVISOR DISTRICT # 3 DATE JUN 15 1981

CONDITIONS OF APPROVAL, IF ANY:

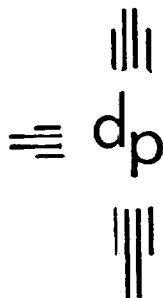


dugan production corp.

FLAG-REDFERN
Crouch Mesa #1
220' FNL - 500' FEL
Sec 4 T29N R12W
San Juan County, NM

MORNING REPORT **

- 5-29-81 Moved in Bryce Chivers Cable tool rig. Spud 10" hole at 2:00 p.m. 5-29-81. Drilling 10' river boulders.
- 5-30-81 Drilling to 18' - out of river boulders at 15'
- 5-31-81 Did not work - Sunday
- 6-1-81 Drilling to 21' Ran 1 jt. 9-5/8" OD 36# K-55, 8R, ST&C csg. and drove into sand rock. Set at 22' ground level. Released cable tool rig.
- 6-2-81 Moved in Morrow Drilling Co. Rigged up. Drilled 8-3/4" hole to 40'. Hit another layer of boulder. Unable to drill with Morrow. Rigged down. Moved Bryce Chivers cable tool rig back on hole.
- 6-3-81 Attempt to deepen hole with cable tools. Drilled to 50'. Boulders falling in hole. Lost 10' of hole. End of day drilling at 40'. Decided to drive 9-5/8" csg.
- 6-4-81 Cut joint 9-5/8" csg. in 5' increments. Drove csg. to 51'. Drilled to 60'.
- 6-5-81 Drilling at 62' when 9-5/8" csg. parted at a weld. Unable to continue drlg. Pulled 30' 9-5/8" csg.
- Started new hole. Drilling at 40' with 30' 9-5/8" csg. in hole.
- 6-6-81. Drove 9-5/8" csg. to 45'. Had some trouble sticking bit underneath drive shoe.
- 6-7-81. Drilled and drove 9-5/8" csg. to 56'. Drill 9" hole to 80'.
- 6-8-81. Drilled 9" hole to 116'.

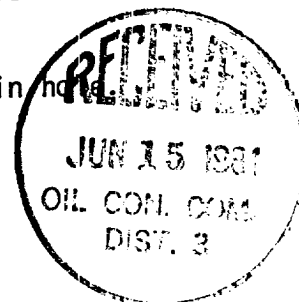

**Working daylight only - dated as a daily report, the day of the work.

FLAG-REDFERN
Crouch Mesa #1
Page 2

- 6-9-81 Ran 3 jts. 7" OD, 23# K-55, 8R, ST&C csg. T.E. 114'. Set at 116' GL. Attempted to pull 9-5/8" csg. Unable to recover 9-5/8". Cemented 7" csg. with 35 sx class "B" 2% CaCl. POB at 3:00 p.m. 6-9-81. Good cement to surface.
- 6-10-81 Moved in Morrow Drlg. Co. Installed BOP. Press. tested BOP and 7" csg. to 500 psi. Held OK. Drlg. 5-1/8" hole to 330'.
- 6-11-81 Drlg. 5-1/8" hole at 680' w/ wtr.