


UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

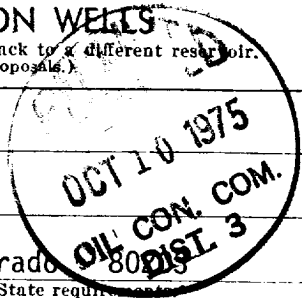

1. OIL WELL GAS WELL OTHER

2. NAME OF OPERATOR
Tenneco Oil Company

3. ADDRESS OF OPERATOR
1860 Lincoln St., Suite 1200, Denver, Colorado 80202

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.)
At surface
1680 FNL and 830 FEL

5. LEASE DESIGNATION AND SERIAL NO.
079511-A

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME
Florance

9. WELL NO.
44

10. FIELD AND POOL, OR WILDCAT
Mesa Verde/Dakota

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Unit H, Sec 31, T30N R8W

12. COUNTY OR PARISH
San Juan

13. STATE
New Mexico

14. PERMIT NO.


15. ELEVATIONS (Show whether DF, RT, GR, etc.)
5827 KB

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>	WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREAT <input checked="" type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>	FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOT OR ACIDIZE <input checked="" type="checkbox"/>	ABANDON* Dakota <input checked="" type="checkbox"/>	SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	(Other) <input type="checkbox"/>	
(Other) Recomplete Mesaverde <input checked="" type="checkbox"/>		(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)	

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. MIRUPU and pull tbq.
2. Set CIBP and dump 2 sxs cmt on top to close off Dakota.
3. Run tbq with pkr and set at \pm 3500. Sqz M.V. perf 5172-to 4879 w/ \pm 250 sxs cmt. W.O.C.
4. Drill out cmt and tst csg.
5. Run GR collar log and perf Pt. Lookout with \pm 12 holes, 4732-4738.
6. Perf Cliffhouse with \pm 12 holes, 4262-4268.
7. Perfs will be treated as necessary to establish commercial gas production.
8. Run tbq, swab well.
9. Clean up area.

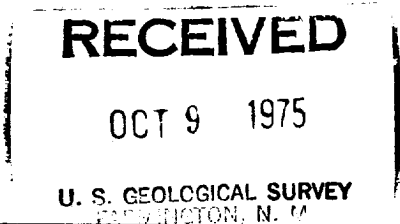

18. I hereby certify that the foregoing is true and correct

SIGNED [Signature] TITLE Production Clerk DATE 10-8-75

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY: