


UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

Sundry Notices and Reports on Wells

1. Type of Well
GAS

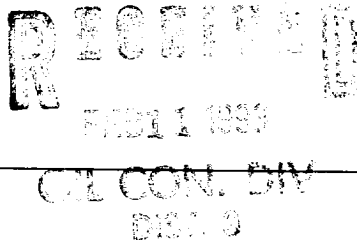

2. Name of Operator
Meridian Oil Inc.

3. Address & Phone No. of Operator
PO Box 4289, Farmington, NM 87499 (505) 326-9700

4. Location of Well, Footage, Sec., T, R, M
990'FSL, 990'FWL Sec.10, T-31-N, R-9-W, NMPM

5. Lease Number
SF-078626

6. If Indian, All. or
Tribe Name

7. Unit Agreement Name
San Juan 32-9 Unit

8. Well Name & Number
San Juan 32-9 U #12

9. API Well No.

10. Field and Pool
Blanco MV

11. County and State
San Juan Co, NM

12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA
Type of Submission

☒ Notice of Intent

☐ Subsequent Report

☐ Final Abandonment

Type of Action

☐ Abandonment

☐ Recompletion

☐ Plugging Back

☐ Casing Repair

☐ Altering Casing

☒ Other - Sidetrack workover

☐ Change of Plans

☐ New Construction

☐ Non-Routine Fracturing

☐ Water Shut off

☐ Conversion to Injection

13. Describe Proposed or Completed Operations

It is intended to workover the subject well in the following manner:

TOOH w/tbg. If tbg is stuck, cut off tbg approx. 100' below csg shoe. Set a cmt ret near bottom of 7" csg. TIH w/2 3/8" tbg. CO, sting into ret. Test tbg to 2500 psi. Sting all the way through ret, load backside w/wtr, PT to 500 psi. Squeeze open hole w/cmt. Pull out of ret, spot cmt on top of ret. Pull up one joint and reverse excess cmt out. Run CBL. Perf squeeze holes above TOC and squeeze cmt to 50' above Ojo Alamo. Drl to 10' below 7" csg shoe and sidetrack using knuckle joint. Drill to 6229'. Run a full string of 4 1/2" csg and cmt. Selectively perf and frac the Mesa Verde formation. Return well to production.

14. I hereby certify that the foregoing is true and correct.

Signed Joan D. Hild (GL) Title Regulatory Affairs Date 1/29/93

(This space for Federal or State Office use)

APPROVED BY _____ Title _____ Date _____

CONDITION OF APPROVAL, if any:

APPROVED

FEB 08 1993
AREA MANAGER