

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

5. Lease Designation and Serial No.

NM 28277

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

ARBOLES 20 A #1Y

9. API Well No.

30-039-23562

10. Field and Pool, or Exploratory Area

BASIN FRUITLAND COAL

11. County or Parish, State

RIO ARRIBA COUNTY, NM

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or deepen or reentry to a different reservoir.

Use "APPLICATION FOR PERMIT--" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator


VASTAR RESOURCES, INC.

3. Address and Telephone No.

1816 E. MOJAVE ST., FARMINGTON, NM 87401 (505) 599-4308

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1525' FSL, 750' FWL, Section 20, T32N, R4W

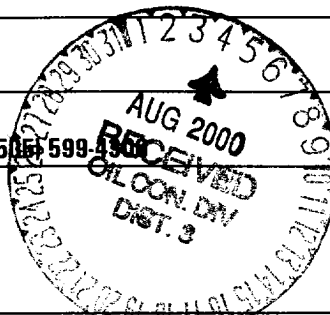

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

☐ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☒ Other Option to Sidetrack

☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

As a supplement to the Re-entry APD approved July 20, 2000 the following option to Sidetrack is proposed:

1. Set CIBP at 3945' (3' above 7" casing collar at 3948') and pressure test casing.
2. Set whipstock on top of CIBP at 3945' and mill window in 7" casing.
3. Drill 6-1/4" Fruitland Coal sidetrack to TD of 4300' (100' below bottom of coal for rathole).
4. Underream open hole to 8" diameter.
5. Run 5-1/2" 15.50# L80 HY511 Flush Joint liner hung in hole (uncemented) from 3865' to TD.
6. Log, perforate, breakdown, frac, run production tubing, and flow test Fruitland Coal.

cc: BLM, Farmington (Or + 3)

N. Hall

Well File

14. I hereby certify that the foregoing is true and correct

Signed [Signature]

Title **ENGINEER 505 599 4308**

Date **7-28-00**

(This space for Federal or State office use)

Approved by JL

Title _____

Date **8-2-00**

Conditions of approval, if any:

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

*See instruction on Reverse Side

NMOC

directional survey
is sidetracked