

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

SUBMIT IN TRIPPLICATE\*  
(Other instructions on re-  
verse side)

Form approved.  
Budget Bureau No. 42-R1424

5. LEASE DESIGNATION AND SERIAL NO.

SF 079048

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1.

OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR

El Paso Natural Gas Company

3. ADDRESS OF OPERATOR

PO Box 990, Farmington, NM 87401

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.\*  
See also space 17 below.)

At surface

1628'N, 1634'E

7. UNIT AGREEMENT NAME

San Juan 32-9 Unit

8. FARM OR LEASE NAME

San Juan 32-9 Unit NP

9. WELL NO.

10 (P&A)

10. FIELD AND POOL, OR WILDCAT

Blanco Mesa Verde

11. SEC., T., R., M., OR BLK. AND  
SURVEY OR AREA

Sec. 34, T-32-N, R-9-W

14. PERMIT NO.

15. ELEVATION OF WELL HEAD, GR., etc.)

6610'GL

12. COUNTY OR PARISH

San Juan

13. STATE

New Mexico

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

☐  
☐  
☐  
☐  
☐

PULL OR ALTER CASING

☐  
☐  
☐  
☐  
☐

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON\*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

☐  
☐  
☐

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT\*

☐  
☐  
☒

(NOTE: Report results of multiple completion on Well  
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

This well has been plugged and abandoned in the following manner:

Cut off stuck tubing at 5677', spotted a 50 sk. cement plug at 5677'.


Perforated 4 squeeze holes at 2735', spotted a 50 sk. cement plug at 2735', squeezed 25 sks. thru perforations.

Shot off 7" casing at 475', spotted a 50 sk. cement plug at 500'.

Spotted a 25 sk. cement plug at the base of the surface casing.

Placed a 15 sk. plug at surface with a Plug & Abandoned marker.

Plug & Abandonment completed on 2-5-72.

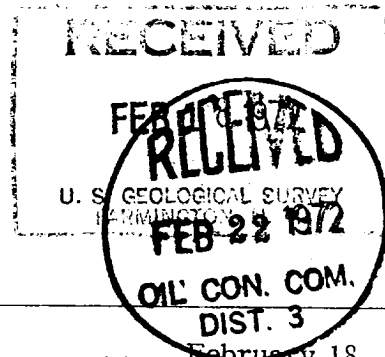

18. I hereby certify that the foregoing is true and correct

SIGNED W. H. Lawson

TITLE Petroleum Engineer

DATE February 18, 1972

(This space for Federal or State office use)

APPROVED BY \_\_\_\_\_  
CONDITIONS OF APPROVAL, IF ANY:

TITLE \_\_\_\_\_

DATE \_\_\_\_\_