Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an

NMOCD Hobbs

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

5. Lease Serial No. NMLC065447

6. If Indian, Allottee or Tribe Name

	II. Use form 3160-3 (AP			CD	l	
SUBMIT IN	7. If Unit or CA/Agree	ement, Name and/or No.				
Type of Well	ECF		8. Well Name and No. SHARP NOSE FE	ED 01 /		
 Name of Operator XTO ENERGY INCORPORAT 	RABADUE)	9. API Well No. 30-025-31397-0	00-S1		
3a. Address 500 W ILLINOIS STREET SU MIDLAND, TX 79701	o. (include area code) 20.6714		10. Field and Pool or I TEAS	Exploratory Area		
4. Location of Well (Footage, Sec., T	., R., M., or Survey Description	1)			11. County or Parish,	State
Sec 13 T20S R33E NWSE 23			LEA COUNTY,	NM		
12. CHECK THE AI	PPROPRIATE BOX(ES)	TO INDICA	TE NATURE O	F NOTICE,	REPORT, OR OTH	IER DATA
TYPE OF SUBMISSION						
■ Notice of Intent	☐ Acidize	□ Dec	epen	☐ Production (Start/Resume		☐ Water Shut-Off
	☐ Alter Casing	☐ Hy	draulic Fracturing	g Reclamation		■ Well Integrity
☐ Subsequent Report	☐ Casing Repair	□ Ne	w Construction	Recomp	olete	☐ Other
☐ Final Abandonment Notice	☐ Change Plans	☐ Plu	g and Abandon	☐ Tempor	arily Abandon	
	☐ Convert to Injection	☐ Plu	g Back	☐ Water I	Disposal	
If the proposal is to deepen directions Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for fix XTO Energy, Inc respectfully r with the following procedure: 1. Freepoint & Fish tbg @ TAC 2. CO to PBTD: 9765'. 3. TIH w/cmt retainer. Sqz exis 4. DO/CO cmt & retainer. Test 5. CO to 11,300'. 6. Run CBL & Csg Inspection 7. Set CIBP @ 11,300' w/35' of 8. Perf fr/11,010-11,144' in 4 r 9. Set pkr @ 10,900'. Test.	rk will be performed or provide l operations. If the operation repandonment Notices must be fil inal inspection. requests to recomplete the C. POOH w/equip. sting perfs fr/9422-9450'. t sqz to 500psi. fr/11,300'-8000'. More than in 10' intervals. 44 sh	the Bond No. o sults in a multip led only after all e referenced	n file with BLM/BIA le completion or reco requirements, includ well to the Teas;	Required sulmpletion in a ling reclamatio	bsequent reports must be new interval, a Form 316 in, have been completed a	filed within 30 days 0-4 must be filed once and the operator has
	Electronic Submission #	RGY INCORP	RATED, sent to the IFER SANCHEZ of	the Hobbs	(17JAS0107SE)	
Signature (Electronic S	Submission)		Date 11/25/20	016	APPROVE	M/X/
3	THIS SPACE FO	OR FEDERA	AL OR STATE	OFFICE U	SE /	
Approved By			Title		DEC 13 /2/1	M park /h/
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.			Office	BUJ	EAU OF LANDMANAI	LENT /
Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent s				willfully to/ma	ake to any department or	agency of the United
(Instructions on page 2) ** BLM REV	ISED ** BLM REVISED	O ** BLM R	EVISED ** BLM	REVISED	** BLM REVISE	11**

Additional data for EC transaction #358930 that would not fit on the form

32. Additional remarks, continued

10. Frac well fr/11,010-11,144'.
11. CO well.
12. Set 2 7/8" tbg & pkr @ 10,960'.
13. Flowback & monitor.
14. Put well on production.


A closed-loop system will be used for this operation.



Schematic - Vertical with Perfs

Well Name: Sharp Nose Federal 001

API/UWI	XTO Accounting ID	Permit Number	State/Province	County	\neg
3002531397			New Mexico	Lea	
Location	Spud Date	Original KB Elevation (ft)	Gr Elev (ft)	KB-Ground Distance (ft)	\neg
	11/29/1991 00:00	3,634.00	3,610.00	24.0	00

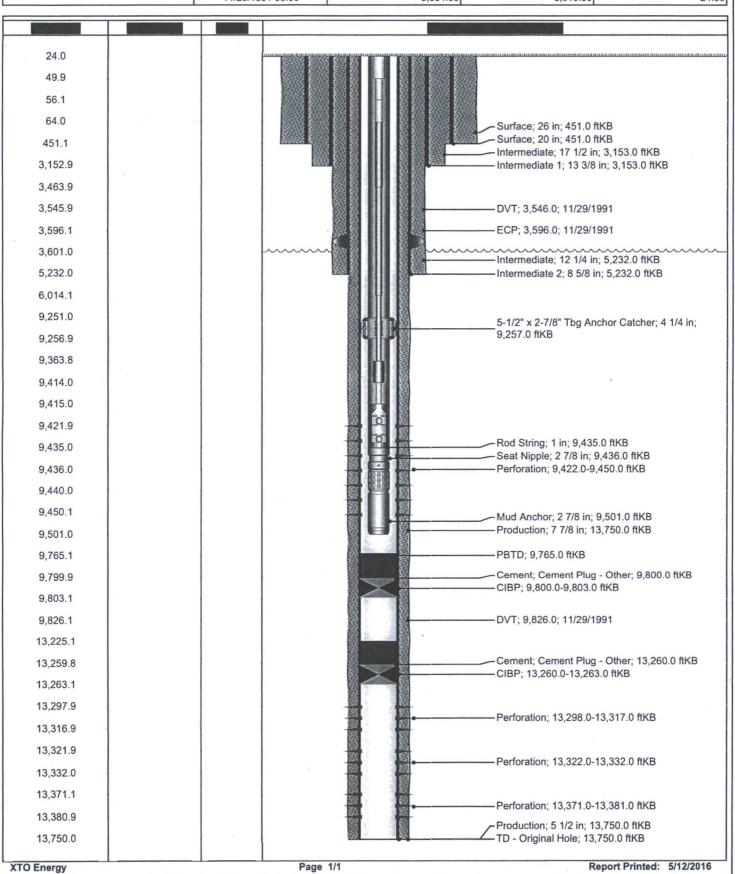

Sharp Nose Fed 1 30-025-31397 XTO Energy Incorporated December 13, 2016 Conditions of Approval

Notify BLM at 575-393-3612 a minimum of 24 hours prior to commencing work.

Work to be completed by March 13, 2017.

- 1. Squeeze approved as written.
- 2. After drilling out to 11,300', operator to tag Morrow plug. Operator must ensure plug is a minimum of 50' above the top of the Morrow Formation located at 13,063'.
- 3. CIBP at 11,300' approved. Place 35' Class H Cement on top. WOC and Tag.
- 4. Must conduct a casing integrity test before perforating and fracturing. Submit results to BLM. The CIT is to be performed on the production casing to max treating pressure. Notify BLM if test fails
- 5. Surface disturbance beyond the originally approved pad must have prior approval.
- 6. Closed loop system required.
- 7. All waste (i.e. drilling fluids, trash, salts, chemicals, sewage, gray water, etc.) created as a result of work over operations shall be safely contained and disposed of properly at a waste disposal facility. No waste material or fluid shall be disposed of on the well location or surrounding area. Porto-johns and trash containers will be on-location during fracturing operations or any other crew-intensive operations.
- 8. Operator to have H2S monitoring equipment on location.
- 9. A minimum of a **5000** (**5M**) BOP to be used. All blowout preventer (BOP) and related equipment (BOPE) shall comply with reasonable well control requirements. A two ram system with a blind ram and a pipe ram designed for the size of the work string shall be adequate. Tapered work strings will require an additional pipe ram. The manifold shall comply with Onshore Oil and Gas Order #2 Attachment I (5M Diagrams of Choke Manifold Equipment). The accumulator system shall have an immediately available power source to close the rams and retain 200 psi above pre-charge. The pre-charge test shall follow requirements in Onshore Order #2.
- 10. Subsequent sundry required detailing work done, C-102 form, and completion report with the new formation. Operator to include well bore schematic of current well condition when work is complete.

11. See attached for general requirements.

JAM 121316

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Production Zone Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from this approval.

If you are unable to plug back the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged back. Failure to do so will result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plug back operations. For wells in Eddy County, call 575-361-2822. For wells in Lea County, call 575-393-3612
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either **Neat Class** "C", for up to 7,500 feet of depth or **Neat Class** "H", for deeper than 7,500 feet plugs.

6. <u>Subsequent Plug back Reporting:</u> Within 30 days after plug back work is completed, file one original and three copies of the Subsequent Report, Form 3160-5 to BLM. The report should give in detail the manner in which the plug back work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date work was completed.</u>

7. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.