+ Form 3160-5 (August 2007)

## **UNITED STATES** DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Hobbs

FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010

6. If Indian, Allottee or Tribe Name

Lease Serial No.	
NMNM14157	

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to re-enter an
shandoned well. Use form 3160-3 (APD) for such proposals


SUBMIT IN TRI	PLICATE - Other instruc	tions on rev		RBS C	CD	A/Agreement, l	Name and/or No.
Type of Well     ☐ Gas Well ☐ Oth	ner		JAN	03 2017	8. Well Name a		
Name of Operator     DEVON ENERGY PRODUCT	Contact: ION COM-Mail: ronnie.slac	RONNIE SLA k@dvn.com				o. 2754-00-C1	-
3a. Address 6488 SEVEN RIVERS HIGHWAY ARTESIA, NM 88211			(include area code) 2-4615		9. API Well N 30-025-32 10. Field and F SAND DU	Pool, or Explora	itory
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)					11. County or	Parish, and Star	te
Sec 30 T23S R32E SENW 23			LEA COU	INTY, NM			
12. CHECK APPI	ROPRIATE BOX(ES) TO	) INDICATE	NATURE OF N	IOTICE, R	EPORT, OR C	OTHER DA	ГА
TYPE OF SUBMISSION	TYPE OF ACTION						
Notice of Intent □ Subsequent Report	☐ Acidize ☐ Alter Casing		ture Treat	☐ Reclam		INT TO P&A NE	PA Amy
	Casing Repair		Construction	Recomp		P&AR	
☐ Final Abandonment Notice	Change Plans	_	and Abandon		rarily Abando		
	Convert to Injection	☐ Plug		□ Water I	1		
13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zone Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)  1. MIRU P&A Unit 2. Retrieve rod pump assembly and 2-7/8" production tubing from 8,686'. 3. Circulate 10# mud between plugs. 4. Set CIBP @ 8,550'. Tag plug. 5. Spot 25 sx (200') CI H cement @ 8,550' - 8,350'. 6. Set CIBP @ 7,190'. Tag plug. 7. Spot 25 sx (250') CI C cement @ 7,190' - 6,940'.					rkers and zones. ithin 30 days ill be filed once operator has		
8. Perf 5-1/2" casing @ 4,725'. Pump 80 sx (340') CI C in/out @ 4,725' - 4,385'. Tag TOC. (T.Delaware @ 4,666'; B.Salt @ 4,629'; shoe @ 4,454') 9. Perf 5-1/2" casing @ 1,400'. Pump 190 sx (800') CI C in/out @ 1,400' - 600'. Tag TOC. (3000' spacer plug @ 1,385'; T.Salt @ 1,349'; Shoe @ 653') 10. Perf 5-1/2" casing @ 150'. Pump 40 sx CI C in/out to surface.							
Below ground level	abandonment	marker	requirec	/			
14. I hereby certify that the foregoing is	For DEVON ENERG	GY PRODUCTI	ION COM LP. sen	t to the Hob	bs		
Committed to AFMSS for processing by PRI Name (Printed/Typed) RONNIE SLACK		Title PRODUCTION TECHNOLOGIST					
			7,1000				
Signature (Electronic Submission)			Date 10/13/20	016		**	
THIS SPACE FOR FEDERAL OR STATE OFFICE USE							
Approved By ( Wa			Title Eng				Date 12/29/16
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.		Office (FC	)				

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

\*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\*

## Additional data for EC transaction #354707 that would not fit on the form

- 32. Additional remarks, continued
- 11. Cut wellhead off. Set dry hole marker.

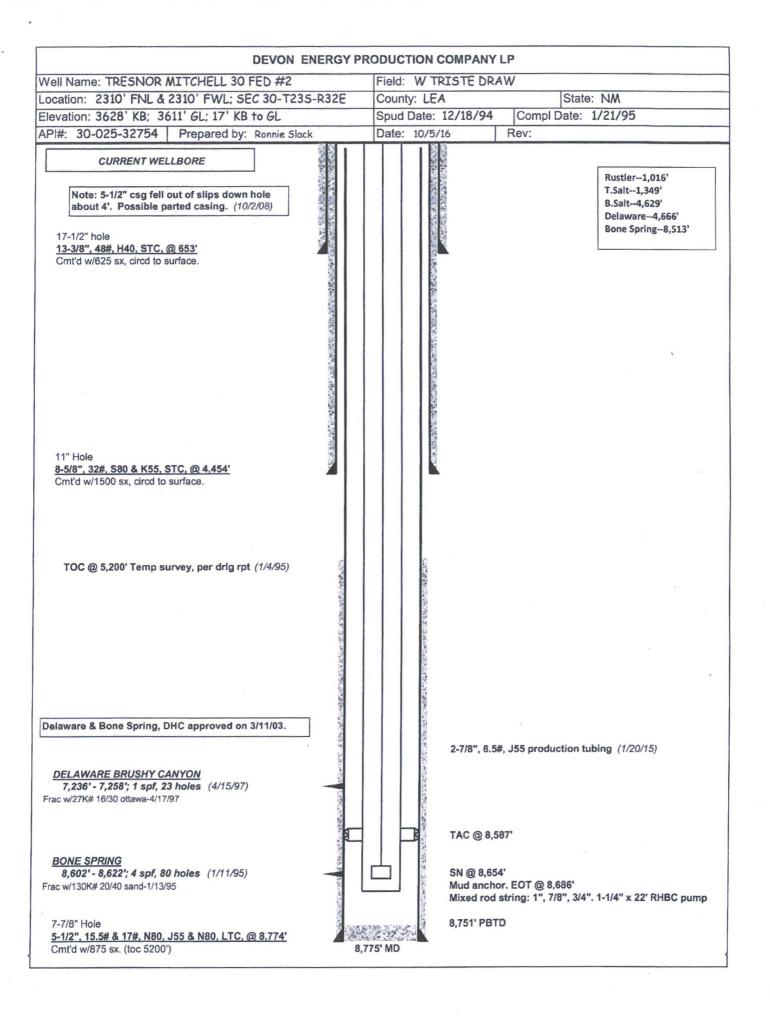

DEVON ENERG	GY PRODUCTION COMPANY LP				
Well Name: TRESNOR MITCHELL 30 FED #2	Field: W TRISTE DRAW				
Location: 2310' FNL & 2310' FWL; SEC 30-T235-R3	The state of the s				
Elevation: 3628' KB; 3611' GL; 17' KB to GL	Spud Date: 12/18/94   Compl Date: 1/21/95				
API#: 30-025-32754   Prepared by: Ronnie Slack	Date: 8/17/16 Rev:				
	MARKET ALZE AND				
PROPOSED PLUG & ABANDONMENT  Note: 5-1/2" csg fell out of slips down hole about 4'. Possible parted casing. (10/2/08)  17-1/2" hole 13-3/8", 48#, H40, STC, @ 653' Cmt'd w/625 sx, circd to surface.	Proposed: 3. Cut wellhead off. Set dry hole marker. 2. Pmp 40 sx Cl C in/out to surface. 1. Perf 5-1/2" csg @ 150'.  Proposed: 3. Tag TOC. 2. Pmp 190 sx (800') Cl C in/out @ 1 400' - 600'				
	2. Pmp 190 sx (800') Cl C in/out @ 1,400' - 600'.  1. Perf 5-1/2" csg @ 1,400'. (3000' Spacer @ 1385'; T.Salt @ 1,349'; Shoe @ 653')				
11" Hole 8-5/8", 32#, S80 & K55, STC, @ 4,454' Cmt'd w/1500 sx, circd to surface.	Proposed: 3. Tag TOC. 2. Pmp 80 sx (340') Cl C in/out @ 4,725' - 4,385'. 1. Perf 5-1/2" csg @ 4,725'. (T.Delaware @ 4,666'; B.Salt @ 4,629'; Shoe @ 4,454')				
TOC @ 5,200' Temp survey, per drig rpt (1/4/95)					
Delaware & Bone Spring, DHC approved on 3/11/03.					
DELAWARE BRUSHY CANYON 7,236' - 7,258'; 1 spf, 23 holes (4/15/97) Frac w/27K# 16/30 ottawa-4/17/97	Proposed: 2. Spot 25 sx (250') Cl C @ 7,190' - 6,940'. 1. Set CIBP @ 7,190'. Tag plug.				
BONE SPRING 8,602' - 8,622'; 4 spf, 80 holes (1/11/95) Frac w/130K# 20/40 sand-1/13/95	Proposed: 2. Spot 25 sx (200') Cl H @ 8,550' - 8,350'. 1. Set CIBP @ 8,550'. Tag plug.				
7-7/8" Hole 5-1/2", 15.5# & 17#, N80, J55 & N80, LTC, @ 8,774' Cmt'd w/875 sx. (toc 5200')	8,751' PBTD 8,775' MD				

SOURCE BELLEVISION OF THE PERSON NAMED IN COLUMN TWO IS NOT THE PERSON NAMED IN COLUMN TO THE PE

## BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

## Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1<sup>st</sup> through June 15<sup>th</sup> annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted