| Submit 1 Copy To Appropriate District<br>Office<br><u>District I</u> – (575) 393-6161<br>1625 N. French Dr., Hobbs, NM 88240<br><u>District II</u> – (575) 748-1283  | State of New Mexico<br>Energy, Minerals and Natural Resources<br>OIL CONSERVATION DIVISION | Form C-103<br>Revised July 18, 2013<br>WELL API NO.<br>30 - 005 - 62824                                       |  |  |  |
|--|--|---|--|--|--|
| 811 S. First St., Artesia, NM 88210<br><u>District III</u> – (505) 334-6178<br>1000 Rio Brazos Rd., Aztec, NM 87410<br><u>District IV</u> – (505) 476-3460<br>1220 S. St. Francis Dr., Santa Fe, NM<br>87505 | 1220 South St. Francis Dr.<br>Santa Fe, NM 87505   | <ul> <li>5. Indicate Type of Lease FEDERAL<br/>STATE FEE</li> <li>6. State Oil &amp; Gas Lease No.</li> </ul> |  |  |  |
| SUNDRY NOTICES<br>(DO NOT USE THIS FORM FOR PROPOSALS<br>DIFFERENT RESERVOIR. USE "APPLICATI<br>PROPOSALS.)  | 7. Lease Name or Unit Agreement Name<br>WEST FORK UNIT                                     |   |  |  |  |
| 1. Type of Well: Oil Well Gas  | 8. Well Number 4   |   |  |  |  |
| <ol> <li>Name of Operator<br/>State of New Mexico formerly Mcl</li> </ol>  | 9. OGRID Number<br>14424   |   |  |  |  |
| 3. Address of Operator   | 10. Pool name or Wildcat   |   |  |  |  |
| 1625 N. French Drive Hobbs, NI   | Pecos Slope; Abo, West (Gas)   |   |  |  |  |
| 4. Well Location<br>Unit Letter K : 1650 feet from the SOUTH line and 1650 feet from the WEST line<br>Section 32 Township 45 Range 22E NMPM County   |  |   |  |  |  |
|  | 1. Elevation (Show whether DR, RKB, RT, GR, etc.)  |   |  |  |  |

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

| NOTICE OF INTENTION TO:   |  |                  | SUBSEQUENT REPORT OF: |                                 |  |
|---|--|------------------|-----------------------|---------------------------------|--|
| PERFORM REMEDIAL WORK [   |  | PLUG AND ABANDON | Ň                     | REMEDIAL WORK                   |  |
| TEMPORARILY ABANDON [   |  | CHANGE PLANS     |                       | COMMENCE DRILLING OPNS. P AND A |  |
| PULL OR ALTER CASING [  |  | MULTIPLE COMPL   |                       | CASING/CEMENT JOB               |  |
| DOWNHOLE COMMINGLE  |  |                  |                       |                                 |  |
| CLOSED-LOOP SYSTEM [  |  |                  |                       |                                 |  |
| OTHER:  |  |                  |                       | OTHER:                          |  |
| 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date |  |                  |                       |                                 |  |

 Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

## SEE ATTACHED PROCEDURE & SCHEMATICS


| Spud Date: Rig Release Date:  |   |
|---|---|
| I hereby certify that the information above is true and complete to the best of m   | ny knowledge and belief.                    |
| SIGNATURE Mach White TITLE Petroleum En   | ngr. Specialist DATE 11/1/17                |
| Type or print name Mark Whitaker E-mail address: mark   | ka.whitaker@state.nm.us PHONE: 575-393-6161 |
| Type or print name       Mark whitaker       E-mail address:       Inark         For State Use Only       Mark whitaker       E-mail address:       Inark         APPROVED BY:       Mark whitaker       ITLE       A         Conditions of Approval (if any):       Ital (if any):       Ital (if any):       Ital (if any): | 0/II DATE 11/1/2017                         |

McKay Oil Corp West Fork Unit No. 4 30-005-62821 UL – K, Sec. 32, T4S, R22E 1650' FSL & 1650' FWL

7" 23# @ 1011' w/ 405 sx cmt 4 1/2" 9.5# @ 3400' w/ 120 sx cmt Top Perforation 3308'

- 1. MIRU. POOH w/ production equipment.
- 2. Set CIBP at 3208'. Circulate hole with mud laden fluid. Pressure test casing to 500 psi. Spot 25 sx cement on CIBP.
- 3. Perf @1061'. Pump sufficient cement to circulate to surface inside/outside 4 ½" casing.
- 4. Cut off wellhead 3' below ground level and verify cement to surface all strings.
- 5. Install below ground P&A marker. Photos should be taken prior to and after welding on plate. Record GPS reading. BLM should be notified prior to cut off so it can be witnessed.

NOTES: Mud laden fluid consists of fresh water with 25 sx salt gel per 100 bbls of fluid. If casing will not hold pressure, contact the OCD for instructions prior to proceeding with P&A.

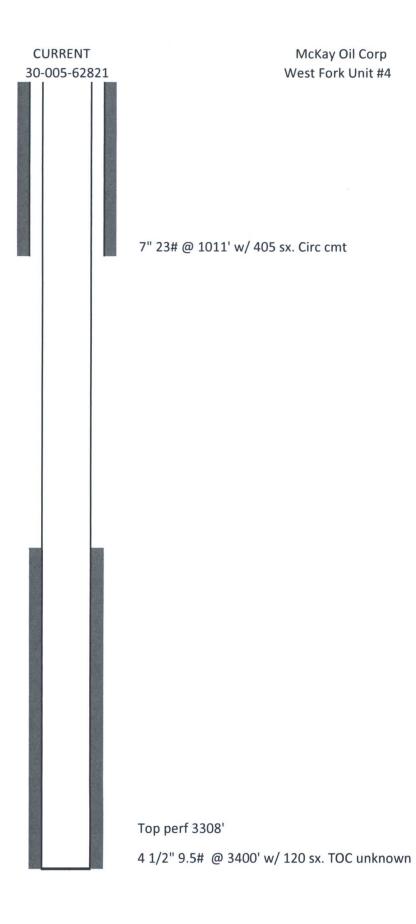

McKay Oil Corp West Fork Unit #4



CUT OFF WELLHEAD 3' BELOW GL, VERIFY CEMENT, & INSTALL BELOW GROUND MARKER. TAKE PHOTO & GPS READINGS

7" 23# @ 1011'

PERF @ 1061'. PUMP SUFFICIENT CEMENT TO CIRCULATE TO SURFACE INSIDE/OUTSIDE 4 1/2" CSG

PRESSURE TEST CASING CIRCULATE MUD LADEN FLUID

SET CIBP AT 3208'. CAP WITH 25 SX

Top Perf 3308' 4 1/2 "9.5# @ 3400'