

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-32766
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil / Gas Lease No.	
7. Lease Name or Unit Agreement Name	WEST DOLLARHIDE DRINKARD UNIT
8. Well No.	109
9. Pool Name or Wildcat	DOLLARHIDE TUBB DRINKARD
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3177'-GR, 3190'-KB

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMI (FORM C-101) FOR SUCH PROPOSALS.	
1. Type of Well:	OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>
2. Name of Operator	CHEVRON USA INC
3. Address of Operator	15 SMITH RD, MIDLAND, TX 79705
4. Well Location	Unit Letter <u>I</u> : <u>1500</u> Feet From The <u>SOUTH</u> Line and <u>525</u> Feet From The <u>EAST</u> Line Section <u>32</u> Township <u>24-S</u> Range <u>38-E</u> NMPM <u>LEA</u> COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☒ RETURN TO PRODUCTION

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

3-13-06: MIRU PU.

3-14-06: POOH W/RODS TO PART. TIH W/OS & SLEEVE. LATCH ONTO FISH & PULL OFF 10 PNTS OVER WEIGHT. TOH W/RODS & FISH TOOL. TIH W/OS W/GRAPPLE. LATCH ONTO FISH. JAR ON PUMP. LD RODS.

3-15-06: CIRC W/200 BCB. JAR ON STUCK TBG. SHEAR TAC.

3-16-06: TIH W/FREE POINT TOOL. TBG 100% STUCK @ 6371. 100% FREE @ 6340. TIH W/CHEMICAL CUTTER. ATTEMPT TO CUT TBG @ 6232. TIH & CUT TBG @ 6233. TIH W/OS W/GRAPPLE. BS, JARS, DC'S & TBG TO 5800.

3-17-06: TIH TO 6233 & LATCH ONTO FISH. JAR ON FISH. TOH W/FISH TO 4800.

3-18-06: RECOVER ALL OF FISH. TIH W/TAPER MILL. BS, JARS, DC'S & TBG TO 6200.

3-20-06: TIH W/MILL TO 6290. MILL CSG TO 6301. TIH & TAG BAD CSG @ 6333. MILL TO 6337. TAG BAD CSG @ 6343. MILL TO 6345.

3-21-06: TIH W/MILL TO 6345. MILL FR 6361-6380. FELL OUT TO 6626.


3-22-06: TIH W/BHA TO 6194. ATTEMPT TO SET TAC. TOH W/TBG.

3-23-06: CHANGE TAC. TIH TO 6194. SET TAC W/20000# TENSION. TIH W/PUMP & PU RODS.

3-24-06: SPACE & HANG ON. LOAD & TEST. RIG DOWN. WAIT ON TEST.

3-30-06: ON 24 HR OPT. PUMPING 0 OIL, 0 GAS, & 324 WATER

- Still Testing -

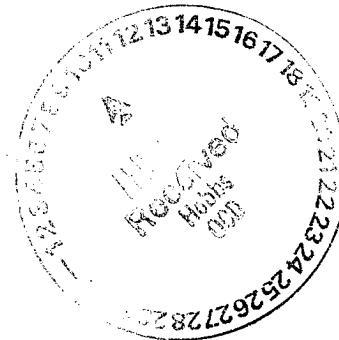

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Denise Pinkerton TITLE Regulatory Specialist

DATE 4/6/2006

TYPE OR PRINT NAME Denise Pinkerton

Telephone No. 432-687-7375

(This space for State Use)

APPROVED [Signature] TITLE PETROLEUM ENGINEER

DATE APR 20 2006