

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 35-025-20010
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator MAYNARD OIL COMPANY		6. State Oil & Gas Lease No. OGRID 005736
3. Address of Operator 8080 N. CENTRAL EXPWY.-STE 660; DALLAS, TX 75206		7. Lease Name or Unit Agreement Name: STATE 35
4. Well Location Unit Letter <u>L</u> : <u>1650</u> feet from the <u>S</u> line and <u>330</u> feet from the <u>W</u> line Section <u>35</u> Township <u>17S</u> Range <u>33E</u> NMPM County <u>LEA</u>		8. Well No. 3
10. Elevation (Show whether DR, RKB, RT, GR, etc.) 4130 DR		9. Pool name or Wildcat CORBIN ABO

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK <input type="checkbox"/> PLUG AND ABANDON <input type="checkbox"/> TEMPORARILY ABANDON <input type="checkbox"/> CHANGE PLANS <input type="checkbox"/> PULL OR ALTER CASING <input type="checkbox"/> MULTIPLE COMPLETION <input type="checkbox"/> OTHER: <input type="checkbox"/>	SUBSEQUENT REPORT OF: REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/> COMMENCE DRILLING OPNS. <input type="checkbox"/> PLUG AND ABANDONMENT <input type="checkbox"/> CASING TEST AND CEMENT JOB <input type="checkbox"/> OTHER: TEMPORARILY ABANDONED <input checked="" type="checkbox"/>


12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.
- 08/06/02 Drilled out fill 4910'-4935'. Milled through rough casing to 5066'.
08/07/02 Set mill down on collapsed casing at 6488'. Unable to work mill past 6488'. Set cement retainer at 6412'. Slips fell, unable to sting into retainer or pump around it.
08/08/02 Set packer at 4780' and tested casing, ok. Found casing leaks 4910' - 5066'. Tagged retainer at 6412' with OCD representative on location.
08/09/02 Set 100 sack cement plug at 5565'-6412'. WOC 3 hrs. and tagged. Set 60 sack cement plug at 4547'-5565'. WOC 12 hrs. and tagged.
08/10/02 OCD Approved Plugs. Loaded casing with corrosion inhibitor and pressure tested to 560 PSI for 30 minutes. OCD witnessed test and signed chart. Original Chart is attached.

This Approval of Temporary
Abandonment Expires 8/23/07

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE R.D. Ragland TITLE Production Foreman DATE 08/21/02
Type or print name R.D. Ragland Telephone No. 524-5814
(This space for State use)

APPROVED BY _____ DATE AUG 26 2002
Conditions of approval, if any: _____
ORIGINAL SIGNED BY GARY W. WINK
OC FIELD REPRESENTATIVE II/STAFF MANAGER

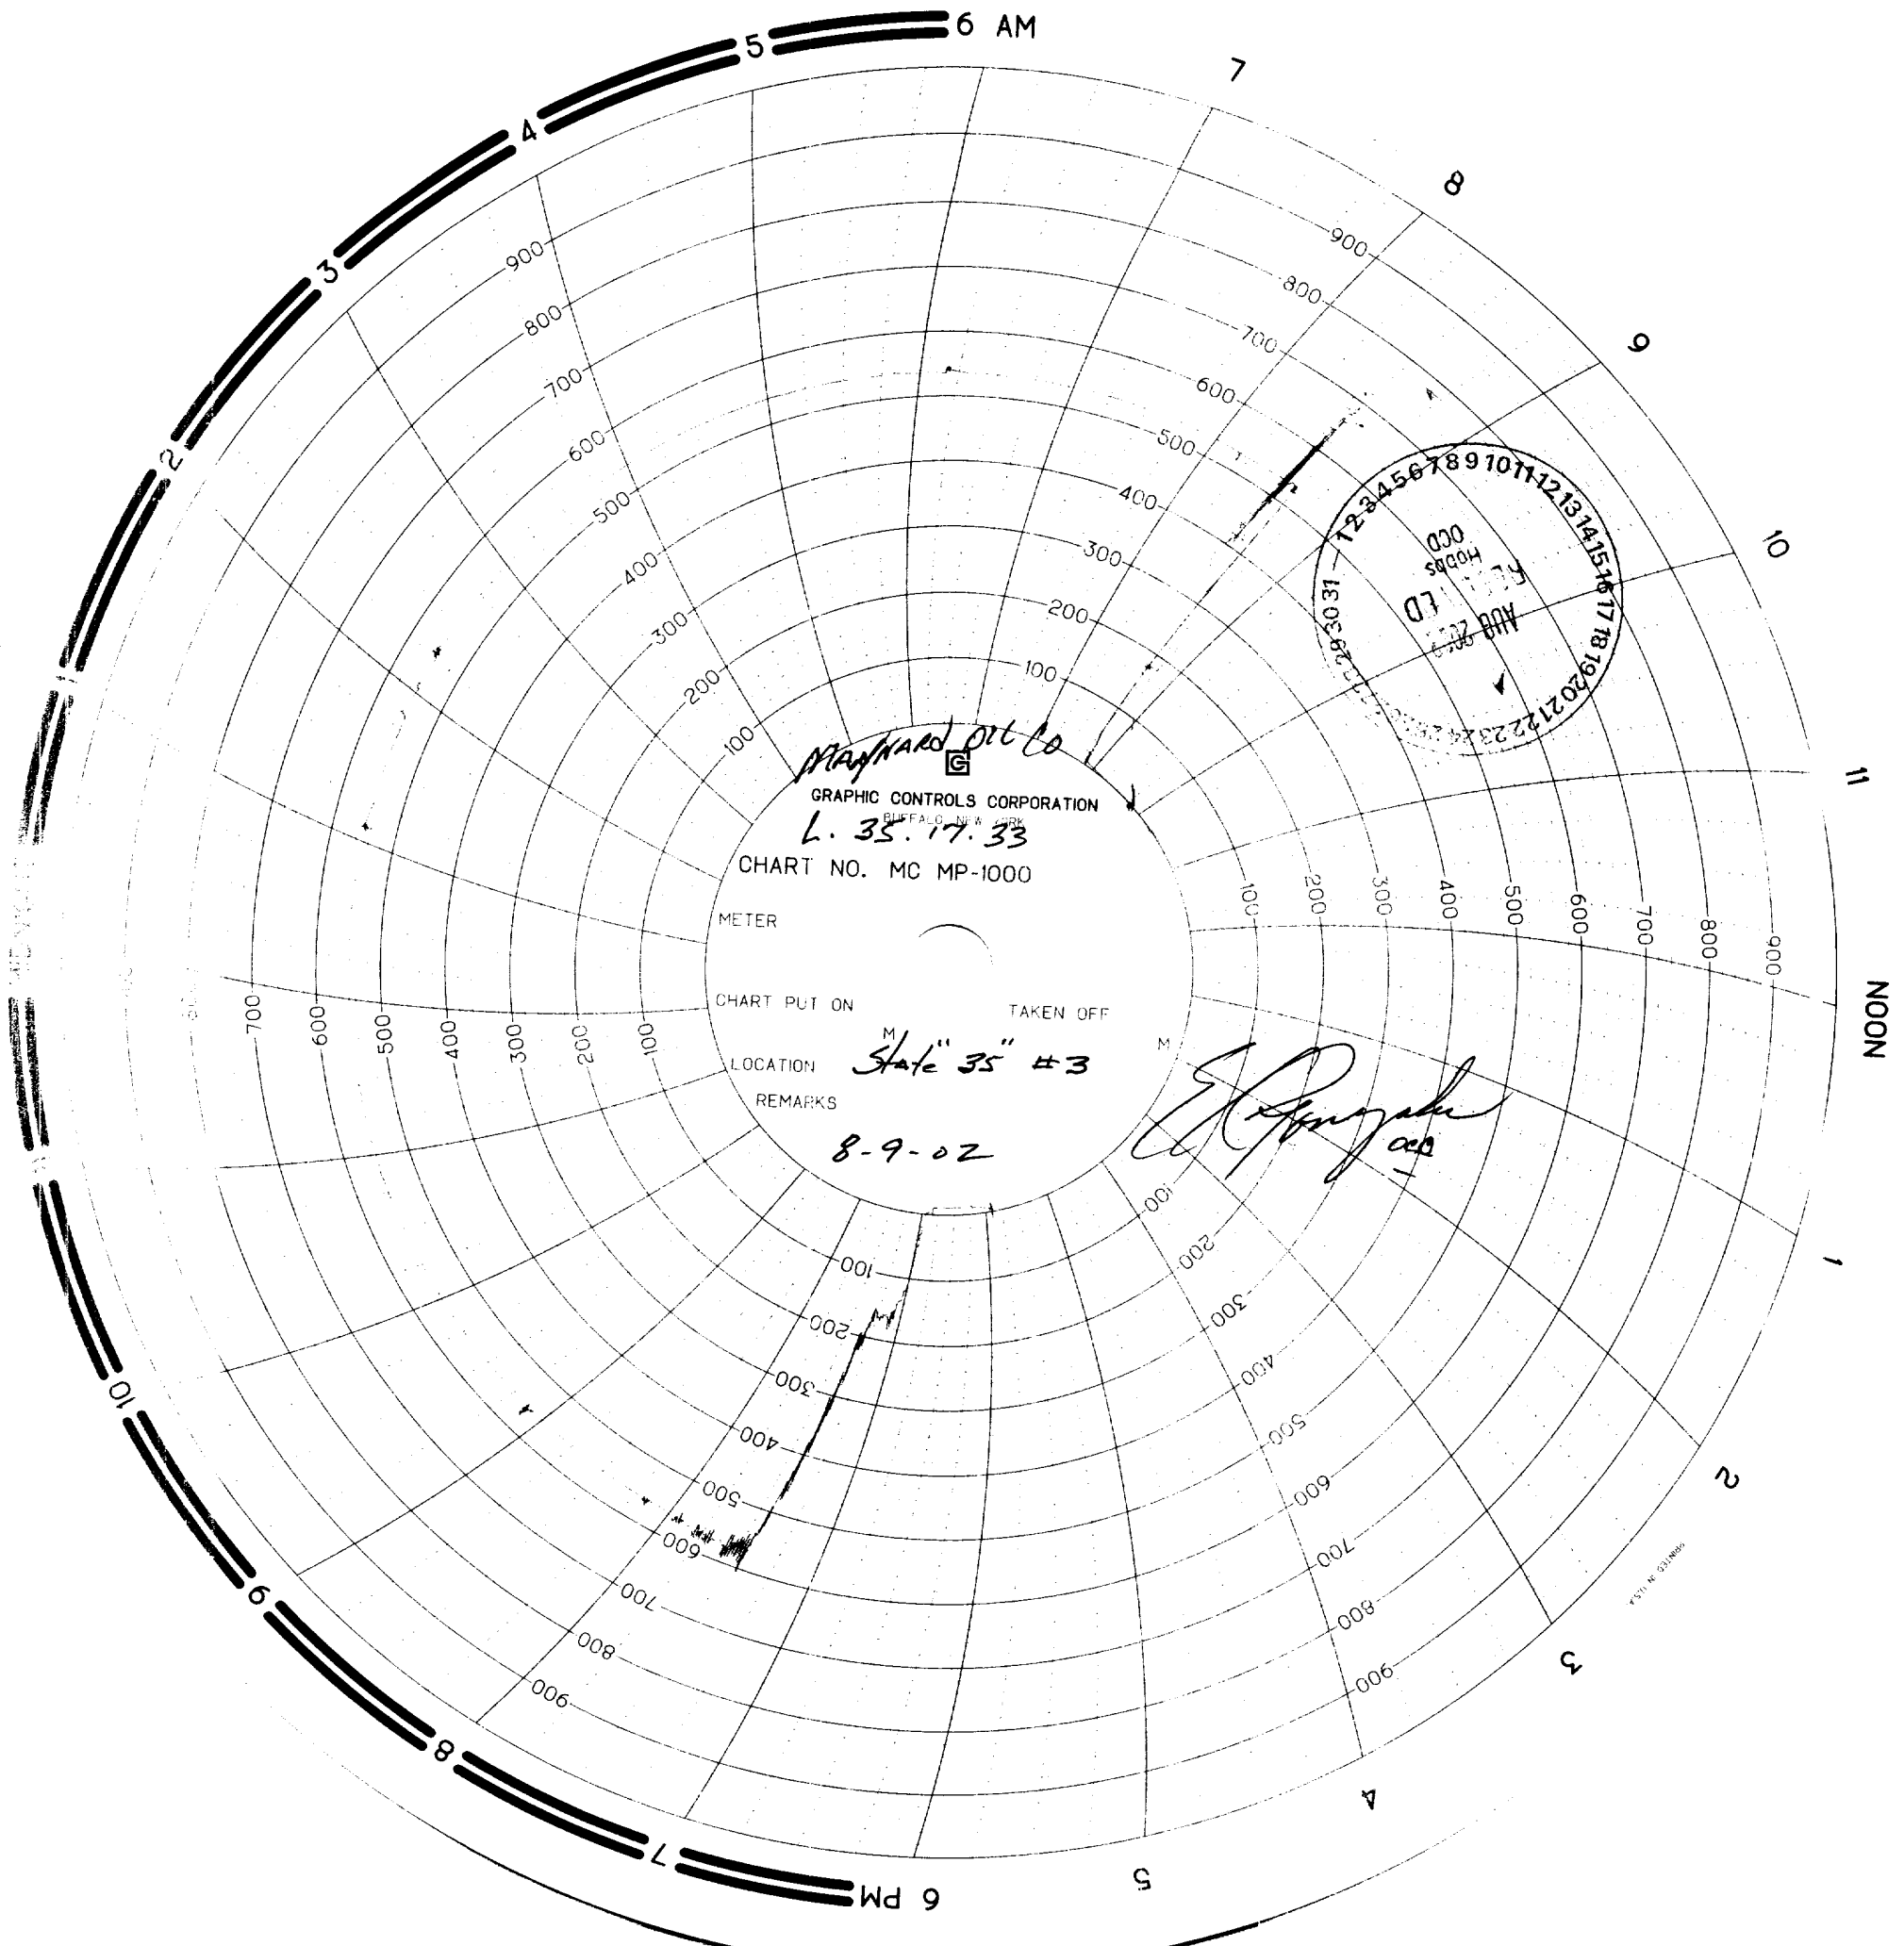

MANHART OIL CO

GRAPHIC CONTROLS CORPORATION

L. 35. 17. 33

CHART NO. MC MP-1000

METER

CHART PUT ON

TAKEN OFF

LOCATION

State 35" #3

REMARKS

8-9-02

12 34 56 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24
000
00004
07
000
000

[Signature]
ao