

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: September 30, 1990

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

5. Lease Designation and Serial No.

NM0349956

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Texaco Producing Inc.

3. Address and Telephone No.

P.O. Box 730, Hobbs, NM 88240 (505) 393-7191

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

Unit Letter E, 1980' FNL & 660' FWL, Sec. 19, T25S, R38E

8. Well Name and No. Fed

C. E. Penny NCT-4 #1

9. API Well No.

30-025-12413

10. Field and Pool, or Exploratory Area

Langlie Mattix Seven R

11. County or Parish, State QN-GA

Lea County, New Mexico

CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☐ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other
☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting and proposed work. If well is directionally drilled give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

Proposed to Plug and Abandon
CIBP set @ 3210', Perforations 3264-3354'

- 1) MIRU. Install BOP.
- 2) TIH w/WS. Tag CIBP. Cir hole full of 9.5 ppg mud.
- 3) Spt 50' cmt plug, Cl C cmt w/2% CaCl on top of CIBP @ 3160-3210'.
- 4) Spt 100' cmt plug @ 2320-2420'. Base of salt @ 2320'. POH.
- 5) Perf 5-1/2" csg 4 SPF @ 1008-1010'. Top of salt @ 1010'.
- 6) P/mud dn 5-1/2" csg to establish circulation. Cir cmt inside & behind 5-1/2" csg from 1010' to surf. Displace cmt to clear WH.
- 7) Cut off csg at base of cellar. Install dry hole marker. Clean locn.

NOTICE: PLEASE NOTIFY BLM PRIOR TO COMMENCING PLUGGING OPERATIONS.

14. I hereby certify that the foregoing is true and correct

Signed

Title Area Manager

Date 07/12/90

(This space for Federal or State office use)

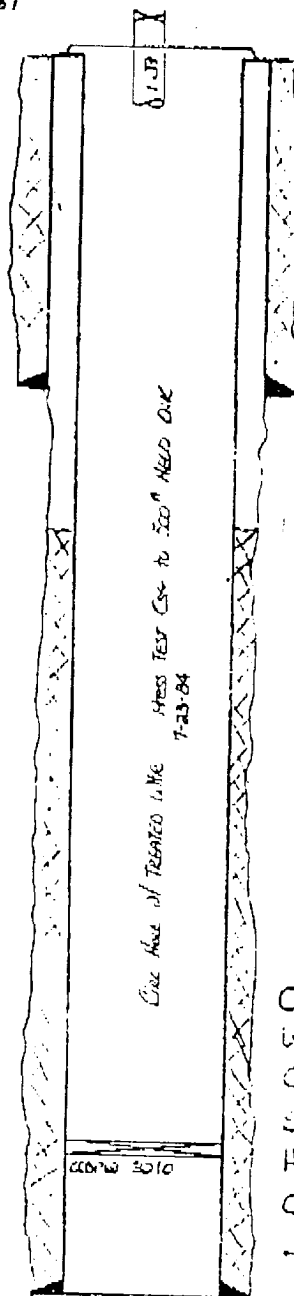
Approved by

Conditions of approval, if any:

Title

Date

8-7-90

WELL NAME AND No. 1C.E. PENNY FED. NCT-4COMPLETION DATE 8-15-55DATE JUNE 1981

CASING SIZE 8 5/8"
 WEIGHT 29 #
 GRADE J-55
 SET AT 851'
 HOLE SIZE 11"
 CEMENT 800 SACKS
CEMENT CIR.

CASING SIZE 5 1/2"
 WEIGHT 19 #
 GRADE J-55
 SET AT 3360'
 HOLE SIZE 7 7/8"
 CEMENT 450 SACKS
T.O.C. 1350' (TEMP. SUR.)

Langlie
 Matrix
 4 Sack 504 - 3600

C.O.W. 3010

T.D. 3360'
 P.B.T.D. _____

SW/4 NW/4
 M 25 S 38 E

L.M. Lefkowitz 7-84