

Well Name: WF FEDERAL 30	Well Location: T30N / R14W / SEC 30 / SESE / 36.780263 / -108.345468	County or Parish/State: SAN JUAN / NM
Well Number: 2	Type of Well: OTHER	Allottee or Tribe Name:
Lease Number: NMNM99003	Unit or CA Name:	Unit or CA Number:
US Well Number: 3004531307	Well Status: Gas Well Shut In	Operator: HILCORP ENERGY COMPANY

Notice of Intent

Sundry ID: 2653684

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 01/21/2022

Time Sundry Submitted: 10:55

Date proposed operation will begin: 02/01/2022

Procedure Description: Hilcorp Energy Company requests permission to P&A the subject well per the attached procedure, current and proposed wellbore schematics. The Pre-Disturbance Site Visit was held on 1/6/2022 with Bob Switzer/BLM. The Re-Vegetation Plan is attached. A closed loop system will be used.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

WF_Federal_30_2_P_A_NOI_20220121105509.pdf

Well Name: WF FEDERAL 30

Well Location: T30N / R14W / SEC 30 / SESE / 36.780263 / -108.345468

County or Parish/State: SAN JUAN / NM

Well Number: 2

Type of Well: OTHER

Allottee or Tribe Name:

Lease Number: NMNM99003

Unit or CA Name:

Unit or CA Number:

US Well Number: 3004531307

Well Status: Gas Well Shut In

Operator: HILCORP ENERGY COMPANY

Conditions of Approval

Additional Reviews

General_Requirement_PxA_20220209102802.pdf

2653684_NOIA_2_3004531307_KR_02092022_20220209102749.pdf

30N14W30PKIs_WF_Federal_30_2_20220208165219.pdf

Operator Certification

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a submission of Form 3160-5 or a Sundry Notice.

Operator Electronic Signature: AMANDA WALKER

Signed on: JAN 21, 2022 10:55 AM

Name: HILCORP ENERGY COMPANY

Title: Operations/Regulatory Technician

Street Address: 1111 TRAVIS ST.

City: HOUSTON

State: TX

Phone: (346) 237-2177

Email address: mwalker@hilcorp.com

Field Representative

Representative Name:

Street Address:

City:

State:

Zip:

Phone:

Email address:

BLM Point of Contact

BLM POC Name: KENNETH G RENNICK

BLM POC Title: Petroleum Engineer

BLM POC Phone: 5055647742

BLM POC Email Address: krennick@blm.gov

Disposition: Approved

Disposition Date: 02/09/2022

Signature: Kenneth Rennick



P&A Procedure

General Information			
Well Name	WF Federal 30 #2	Date:	1-21-22
API:	30-045-31307	AFE #	
Field:	San Juan North	County	San Juan
Status:	Well is ACOI		
Subject:	Permanently P&A wellbore		
By:	J. Picou		

Well Data

Surface Casing: 8-5/8" 24# J-55 at 133'

Production Casing: 5-1/2" 15.5 #; J-55 at 1,121'

Production Tubing: 2-3/8" 4.7#; J-55 at 938'

Rod String: 3/4" Sucker Rods

Current Perforations: 884' - 894'

Current PBTD: 1,100' (cement plug)

KB: 9.5'


Hold PJSM prior to begin all operations. Properly document all operations via the JSA process. Ensure that all personnel onsite abide by HEC safety protocol, including PPE, housekeeping, and standard guidelines. Verify cathodic protection is off and wellhead instrumentation is properly disconnected from the wellhead. Comply with all NMOCD and HEC safety and environmental regulations. Verify there is no H2S present prior to beginning operations. If any H2S is present, take the necessary actions to ensure that the location is safe prior to beginning operations. Observe and record pressures across all strings daily, prior to beginning operations.

Remember to notify NMOCD and BLM 24 hours prior to starting operations on location. This procedure is contingent upon P&A sundry approval by the NMOCD and BLM.


Rig Procedure

1. MIRU P&A rig and equipment. Record pressures on all strings.
2. Unseat rods from ESP and POOH with rod string. NU BOP & test. Release ESP pump and TOOH with production tbg and pump.
3. RIH with 5.5" casing scraper to +/- 860'.
4. MU 5.5" CICR and RIH. Set CICR at 850'.
5. Load wellbore with KCl water and circulate wellbore clean. Pressure test the casing to 500 psi to verify wellbore integrity and plug set.
6. **Plug #1 (Fruitland Coal Perfs 884')** : RU cementers and pump a 200' balanced cmt plug inside the 5-1/2" from 650' – 850', using 13.1 bbls (64 sx) of 15.8+ ppg Class G cmt.
7. TOOH with tbg to 315'.
8. **Plug #2 (Fruitland Top at 263')**: RU cementers and pump a 315' balanced cmt plug from Surface – 315' inside the 5-1/2" using 8.7 bbls (43 sx) of 15.8 ppg Class G cmt.
9. WOC 4 hrs. Verify all pressures on all strings are at 0 psi.
10. ND BOP. Tag cmt and top off wellbore as needed. Cutoff wellhead at surface and weld P&A marker.
11. RDMO P&A rig.

CURRENT WELLBORE SCHEMATIC

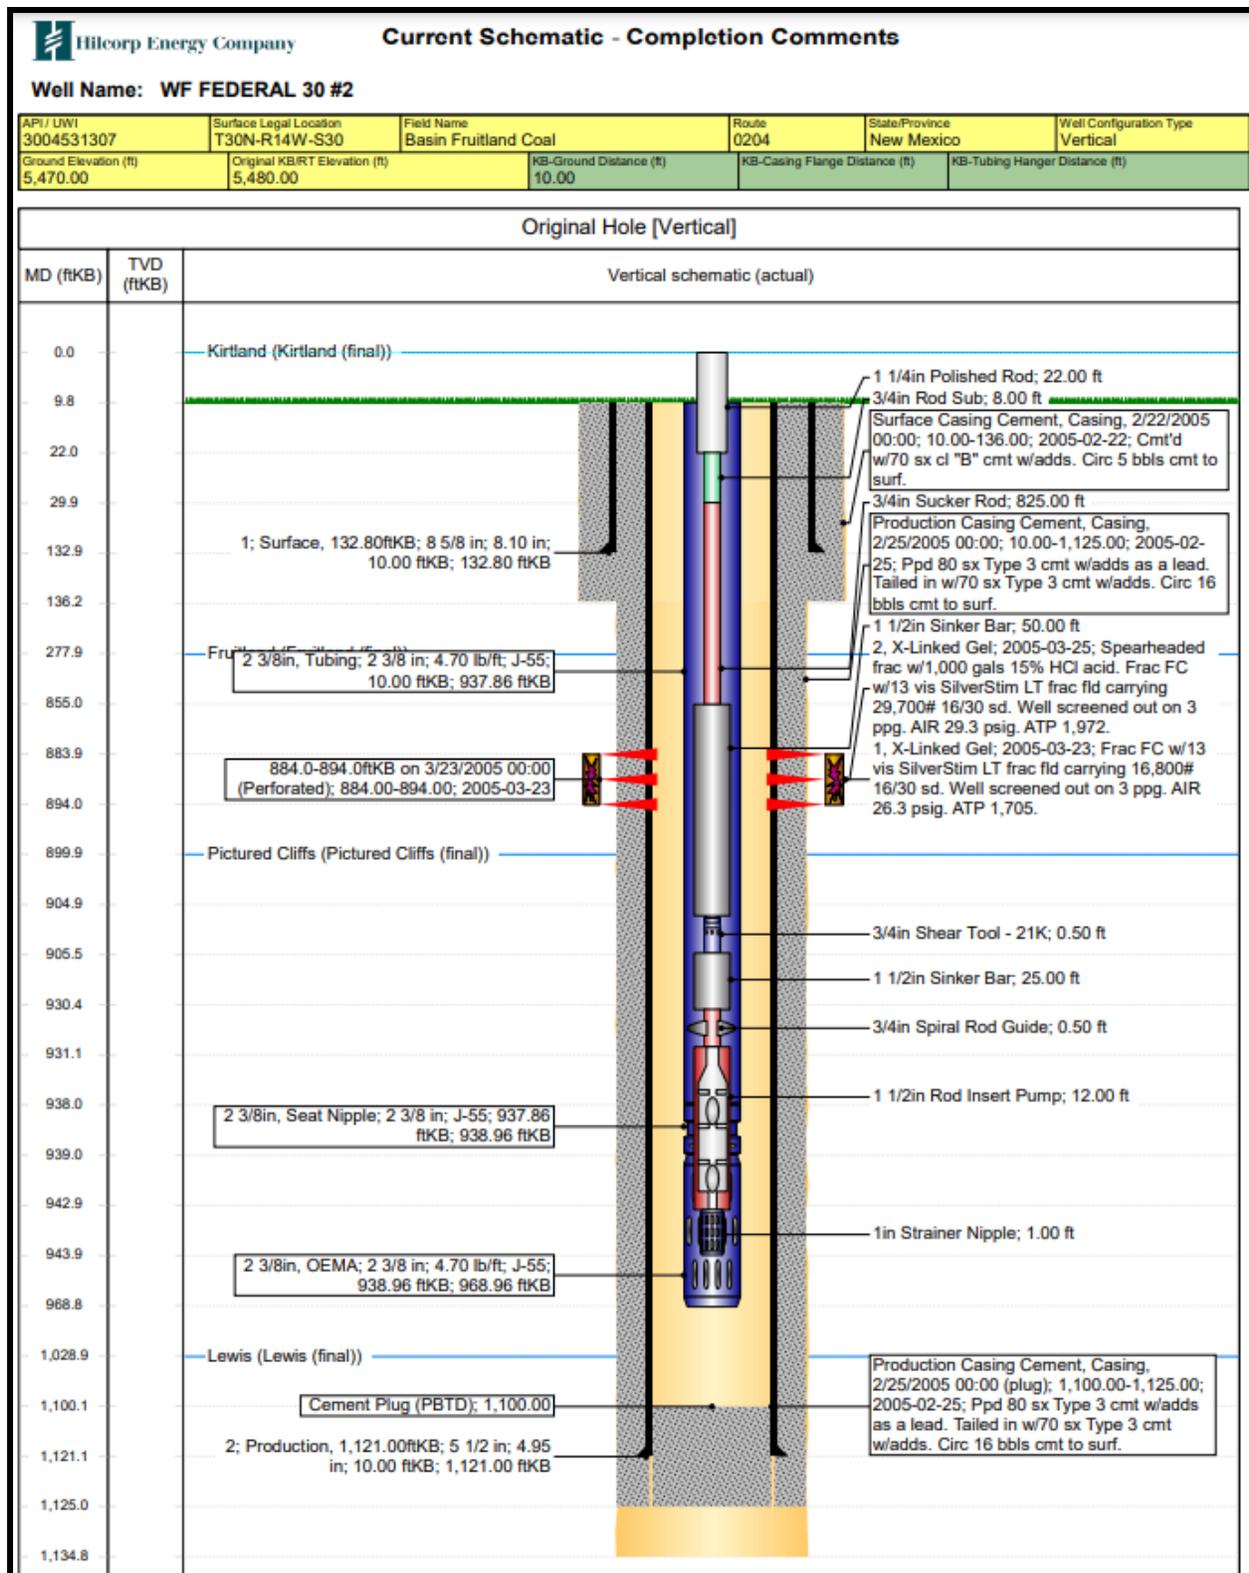

PROPOSED P&A WELLBORE SCHEMATIC

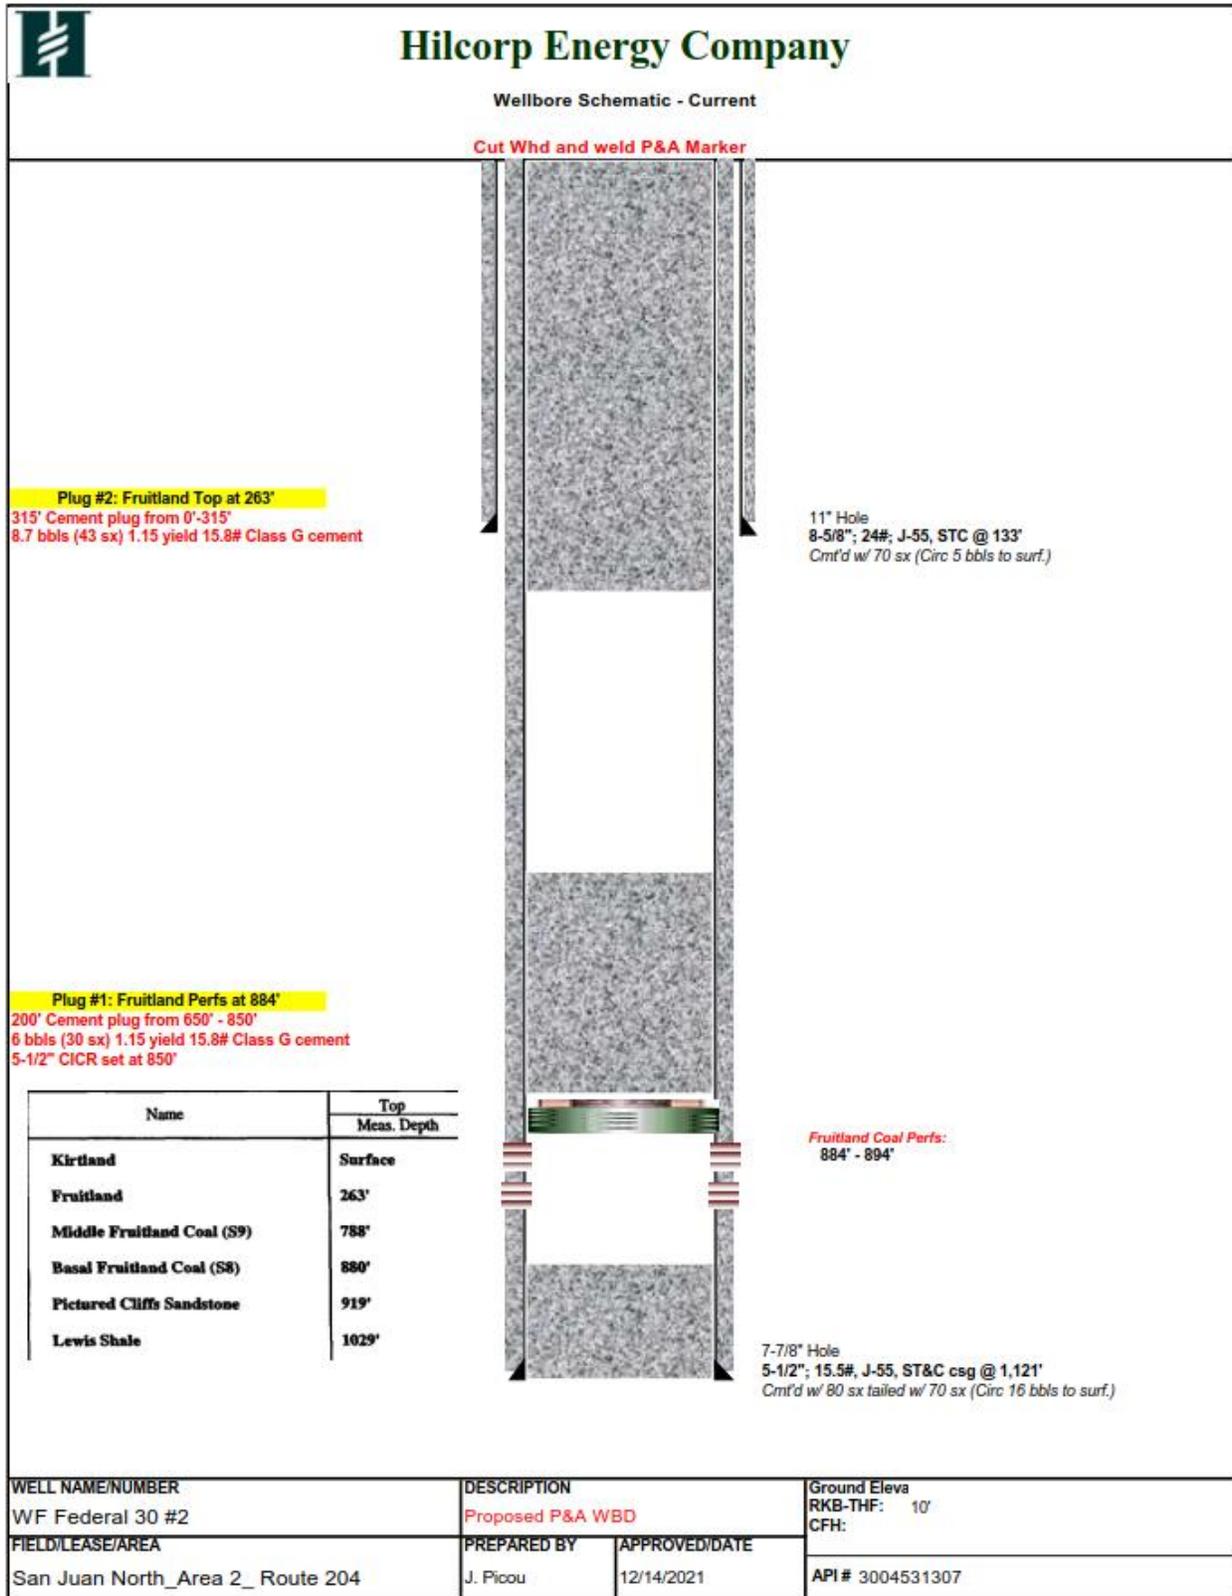

Hilcorp Energy
P&A Final Reclamation Plan
W F Federal 30 2
API: 30-045-31307
T30N- R14W-Sec. 30-Unit P
LAT: 36.780254 LONG: -108.344803 NAD 27
Footage: 830' FSNL & 1130' FEL
San Juan County, NM

1. PRE- RECLAMATION SITE INSPECTION

A pre-reclamation site inspection was completed with Bob Switzer from the BLM and Bobby Spearman, Hilcorp Energy SJ North Construction Foreman on January 6, 2022.

2. LOCATION RECLAMATION PROCEDURE

1. Reclamation work will begin in springtime.
2. Removal of all equipment, anchors, flowlines, cathodic, meter run.
3. All trash and debris will be removed within a 50' buffer outside of the location disturbance during reclamation.
4. Location will be pushed from East to west to grade of existing hillside, recontouring is required
5. Rip compacted soil and walk down disturbed portion of well pad.
6. Remove all gravel from berms, pads, and bury in toe of cut or spread on main access road
7. Hilcorp to remove water and gas lines from location to tie in point or abandon in place.

3. ACCESS ROAD RECLAMATION PROCEDURE

1. The well access road will be blocked at the entrance with a berm.
2. Reclaim approx... 300' of access road by ripping and seeding. Pull in sides as well as possible.

4. SEEDING PROCEDURE

1. A Badlands seed mix mixed with some sage will be used for all reclaimed and disturbed areas of the well pad and lease road.
2. Drill seed will be done where applicable, and all other disturbed areas will be broadcast seeded and harrowed. Broadcast seeding will be applied at a double the rate of seed.
3. Timing of the seeding will be when the ground is not frozen or saturated.

5. WEED MANAGEMENT

1. Canadian thistle was found on location. Location to be treated for noxious weeds

**GENERAL REQUIREMENTS FOR
PERMANENT ABANDONMENT OF WELLS ON FEDERAL AND INDIAN LEASES
FARMINGTON FIELD OFFICE**

- 1.0 The approved plugging plans may contain variances from the following minimum general requirements.
- 1.1 Modification of the approved plugging procedure is allowed only with the prior approval of the Authorized Officer, Farmington Field Office.
 - 1.2 Requirements may be added to address specific well conditions.
- 2.0 Materials used must be accurately measured. (densometer/scales)
- 3.0 A tank or lined pit must be used for containment of any fluids from the wellbore during plugging operations and all pits are to be fenced with woven wire. These pits will be fenced on three sides and once the rig leaves location, the fourth side will be fenced.
- 3.1 Pits are not to be used for disposal of any hydrocarbons. If hydrocarbons are present in the pit, the fluids must be removed prior to filling in.
- 4.0 All cement plugs are to be placed through a work string. Cement may be bull-headed down the casing with prior approval. Cement caps on top of bridge plugs or cement retainers may be placed by dump bailer.
- 4.1 The cement shall be as specified in the approved plugging plan.
 - 4.2 All cement plugs placed inside casing shall have sufficient volume to fill a minimum of 100' of the casing, or annular void(s) between casings, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
 - 4.3 Surface plugs may be no less than 50' in length.
 - 4.4 All cement plugs placed to fill annular void(s) between casing and the formation shall be of sufficient volume to fill a minimum of 100' of the annular space plus 100% excess, calculated using the bit size, or 100' of annular capacity, determined from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
 - 4.5 All cement plugs placed to fill an open hole shall be of sufficient volume to fill a minimum of 100' of hole, as calculated from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug. In the absence of a caliper log, an excess of 100% shall be required.
 - 4.6 **A cement bond log or other accepted cement evaluation tool is required to be run if one had not been previously ran or cement did not circulate to surface during the original casing cementing job or subsequent cementing jobs.**

5.0 All cement plugs spotted across, or above, any exposed zone(s), when; the wellbore is not full of fluid or the fluid level will not remain static, and in the case of lost circulation or partial returns during cement placement, shall be tested by tagging with the work string.

- 5.1 The top of any cement plug verified by tagging must be at or above the depth specified in the approved plan, without regard to any excess.
- 5.2 Testing will not be required for any cement plug that is mechanically contained by use of a bridge plug and/or cement retainer, if casing integrity has been established.
- 5.3 Any cement plug which is the only isolating medium, for a fresh water interval or a zone containing a prospectively valuable deposit of minerals, shall be tested by tagging.
- 5.4 If perforations are required below the surface casing shoe, a 30 minute minimum wait time will be required to determine if gas and/or water flows are present. If flow is present, the well will be shut-in for a minimum of one hour and the pressure recorded. Short or long term venting may be necessary to evacuate trapped gas. **If only a water flow occurs with no associated gas, shut well in and record the pressures. Contact the Engineer as it may be necessary to change the cement weight and additives.**

6.0 Before setting any cement plugs the hole needs to be rolled. All wells are to be controlled by means of a fluid that is to be of a weight and consistency necessary to stabilize the wellbore. This fluid shall be left in place as filler between all plugs.

- 6.1 Drilling mud may be used as the wellbore fluid in open hole plugging operations.
- 6.2 The wellbore fluid used in cased holes shall be of sufficient weight to balance known pore pressures in all exposed formations.

7.0 A blowout preventer and related equipment (BOPE) shall be installed and tested prior to working in a wellbore with any exposed zone(s); (1) that are over pressured, (2) where the pressures are unknown, or (3) known to contain H₂S.

8.0 Within 30 days after plugging work is completed, file a Sundry Notice, Subsequent Report of Abandonment (Form 3160-5), five copies, with the Field Manager, Bureau of Land Management, 6251 College Blvd., Suite A, Farmington, NM 87402. The report should show the manner in which the plugging work was carried out, the extent, by depth(s), of cement plugs placed, and the size and location, by depth(s), of casing left in the well. Show date well was plugged.

9.0 All permanently abandoned wells are to be marked with a permanent monument as specified in 43 CFR 3162.6(d). Unless otherwise approved.

10.0 If this well is located in a Specially Designated Area (SDA), compliance with the appropriate seasonal closure requirements will be necessary.

All of the above are minimum requirements. Failure to comply with the above conditions of approval may result in an assessment for noncompliance and/or a Shut-in Order being issued pursuant to 43 CFR 3163.1. You are further advised that any instructions, orders or decisions issued by the Bureau of Land Management are subject to administrative review pursuant to 43 CFR 3165.3 and appeal pursuant to 43 CFR 3165.4 and 43 CFR 4.700.

(October 2012 Revision)

**UNITED STATES DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
FARMINGTON DISTRICT OFFICE
6251 COLLEGE BLVD.
FARMINGTON, NEW MEXICO 87402**

AFMSS 2 Sundry ID 2653684

Attachment to notice of Intention to Abandon

Well: WF Federal 30 2

CONDITIONS OF APPROVAL

1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
2. The following modifications to your plugging program are to be made:
 - a) Add a plug, or cement below the retainer, to cover the Pictured Cliffs formation top at 919 feet.
 - b) Plug 1 (Fruitland): Bring the top of the plug up to 588 feet to cover BLM pick for the Fruitland formation top.
3. Farmington Office is to be notified at least 24 hours before the plugging operations commence at (505) 564-7750.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.

K. Rennick 2/9/2022

BLM FLUID MINERALS P&A Geologic Report

Date Completed: 2/8/2022

Well No. WF Federal 30 #2 (API# 30-045-31307)	Location	830	FSL	&	1130	FEL
Lease No. NMNM-99003	Sec. 30	T30N			R14W	
Operator Hilcorp Energy Company	County	San Juan		State	New Mexico	
Total Depth 1135'	PBTD 1100'	Formation Fruitland (producing), Lewis (TD)				
Elevation (GL) 5470'		Elevation (KB) 5480'				

Geologic Formations	Est. Top	Est. Bottom	Log Top	Log Bottom	Remarks
San Jose Fm					
Nacimiento Fm					Surface/freshwater sands
Ojo Alamo Ss					Aquifer (possible freshwater)
Kirtland Shale			Surface	638	
Fruitland Fm			638	919	Coal/Gas/Possible water
Pictured Cliffs Ss			919	1029	Gas
Lewis Shale			1029	PBTD	
Chacra					Gas
Cliff House Ss					Water/Possible gas
Menefee Fm					Coal/Ss/Water/Possible O&G
Point Lookout Ss					Probable water/Possible O&G
Mancos Shale					
Gallup					O&G/Water
Greenhorn					
Graneros Shale					
Dakota Ss					O&G/Water

Remarks:

P & A

- BLM pick for the Fruitland formation top varies from Operator's pick.
- Add a plug, or pump cement below the retainer, to cover the Pictured Cliffs formation top at 919'.
- Bring the top of Plug #1 up to 588' to cover BLM pick for the Fruitland formation top.
- The plugs proposed in the P&A procedure, with recommended changes, will adequately protect any freshwater sands in this well bore.
- Fruitland coal perms 884' – 894'.
- Note: H₂S has not been reported in this well but has been reported in nearby wells to the north at concentrations up to 1000 PPM.

Reference Well:

1) **Formation Tops**
Same

Prepared by: Chris Wenman

District I
 1625 N. French Dr., Hobbs, NM 88240
 Phone:(575) 393-6161 Fax:(575) 393-0720
District II
 811 S. First St., Artesia, NM 88210
 Phone:(575) 748-1283 Fax:(575) 748-9720
District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
 1220 S. St Francis Dr., Santa Fe, NM 87505
 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS
 Action 80361

CONDITIONS

Operator: HILCORP ENERGY COMPANY 1111 Travis Street Houston, TX 77002	OGRID: 372171
	Action Number: 80361
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
kpickford	Adhere to BLM approved plugs and COAs. See GEO Report	2/15/2022
kpickford	Notify NMOCD 24 Hours Prior to beginning operations	2/15/2022