

Well Name: BELL FEDERAL 11	Well Location: T30N / R13W / SEC 11 / SWNW / 36.829525 / -108.181247	County or Parish/State: SAN JUAN / NM
Well Number: 2	Type of Well: OTHER	Allottee or Tribe Name:
Lease Number: NMNM0546	Unit or CA Name:	Unit or CA Number: NMNM104939
US Well Number: 3004532454	Well Status: Gas Well Shut In	Operator: HILCORP ENERGY COMPANY

Notice of Intent

Sundry ID: 2653168

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 01/19/2022

Time Sundry Submitted: 06:22

Date proposed operation will begin: 02/01/2022

Procedure Description: Hilcorp Energy Company requests permission to P&A the subject well per the attached procedures, current and proposed wellbore schematics. The Pre-Disturbance Site Visit was held on 1/13/2022 with Bob Switzer/BLM. The Re-Vegetation Plan is attached. A closed loop system will be used.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

Bell_Federal_11_2_Reclamation_Plan_20220119062127.pdf

Bell_Federal_11_2_NOI_procedure_for_PA_20220119062114.pdf

Well Name: BELL FEDERAL 11	Well Location: T30N / R13W / SEC 11 / SWNW / 36.829525 / -108.181247	County or Parish/State: SAN JUAN / NM
Well Number: 2	Type of Well: OTHER	Allottee or Tribe Name:
Lease Number: NMNM0546	Unit or CA Name:	Unit or CA Number: NMNM104939
US Well Number: 3004532454	Well Status: Gas Well Shut In	Operator: HILCORP ENERGY COMPANY

Conditions of Approval

Additional Reviews

General_Requirement_PxA_20220303114027.pdf
 2653168_NOIA_11_2_3004532454_KR_03032022_20220303114010.pdf
 30N13W11EKIs_Bell_Federal_11_2_20220303100831.pdf

Operator Certification

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a submission of Form 3160-5 or a Sundry Notice.

Operator Electronic Signature: KANDIS ROLAND **Signed on:** JAN 19, 2022 06:22 AM
Name: HILCORP ENERGY COMPANY
Title: Operation Regulatory Tech
Street Address: 382 Road 3100
City: Farmington **State:** NM
Phone: (505) 599-3400
Email address: kroland@hilcorp.com

Field Representative

Representative Name:
Street Address:
City: **State:** **Zip:**
Phone:
Email address:

BLM Point of Contact

BLM POC Name: KENNETH G RENNICK	BLM POC Title: Petroleum Engineer
BLM POC Phone: 5055647742	BLM POC Email Address: krennick@blm.gov
Disposition: Approved	Disposition Date: 03/03/2022
Signature: Kenneth Rennick	



P&A Procedure

General Information			
Well Name	Bell Federal 11 #2	Date:	1/18/22
API:	30-045-32454	AFE #	
Field:	San Juan	County	San Juan
Status:	Well is ACOI		
Subject:	Permanently P&A wellbore		
By:	M. Wissing		

Well Data

Surface Casing: 7" 20# J-55 at 205'

Production Casing: 4-1/2" J-55 10.5# at 2,148'

Production Tubing: 2-3/8" J-55 4.7# at 2,032'

Rod String: 3/4" rods w/ 2"x1.5"x12' RWAC insert pump

Current Perforations: 1,864'-1,905'

Current PBTD: 2,102' (cement plug)

SICP = 96 psig

Notes: Historic notes of heavy scale on rods and tbg.


*Hold PJSM prior to begin all operations. Properly document all operations via the JSA process. Ensure that all personnel onsite abide by HEC safety protocol, including PPE, housekeeping, and standard guidelines. Verify cathodic protection is off and wellhead instrumentation is properly disconnected from the wellhead. Comply with all **NMOCD**, **BLM**, and HEC safety and environmental regulations. Verify there is no H2S present prior to beginning operations. If any H2S is present, take the necessary actions to ensure that the location is safe prior to beginning operations. Observe and record pressures across all strings daily, prior to beginning operations.*

Remember to notify NMOCD and BLM 24 hours prior to starting operations on location. This procedure is contingent upon P&A sundry approval by BLM & NMOCD.


P&A Rig Procedure

1. MIRU P&A rig and equipment. Record pressures on all strings.
2. Unseat rod pump and POOH with rod string & rod pump. NU BOP & test. TOOH with production tbg.
3. RIH with 4.5" casing scraper to +/- 1,825'.
4. MU 4.5" CICR and RIH with 2-3/8" work string. Set CICR at 1,814'.
 - a. **Top FRC perf at 1,864'**
5. Load wellbore with KCl water and circulate wellbore clean. Pressure test the casing to 500 psi to verify wellbore integrity and plug set.
6. **Plug #1 (Fruitland Coal Perfs at 1,864')**: RU cementers and pump a 50' balanced cmt plug inside the 4-1/2" csg from 1,764' – 1,814', using 1.6 bbls (8 sx) of 15.8+ ppg Class G cmt.
7. TOOH with tbg to 1,342'.
8. **Plug #2 (Fruitland Formation Top at 1,292')**: RU cementers and pump a 100' balanced cmt plug inside the 4-1/2" csg from 1,242' – 1,342', using 2.5 bbls (12 sx) of 15.8+ ppg Class G cmt.
9. TOOH with tbg to 255'.
10. **Plug #3 (Surface, Surface Csg at 205', Ojo top at 257', Kirtland top at 413')**: RU cementers and pump a 457' balanced cmt plug from Surface – 463' inside the 4-1/2" using 7.4 bbls (36 sx) of 15.8 ppg Class G cmt.
11. WOC 4 hrs. Verify all pressures on all strings.
12. ND BOP. Tag cmt and top off wellbore as needed. Cutoff wellhead at surface and weld P&A marker.
13. RDMO P&A rig.

CURRENT WELLBORE SCHEMATIC

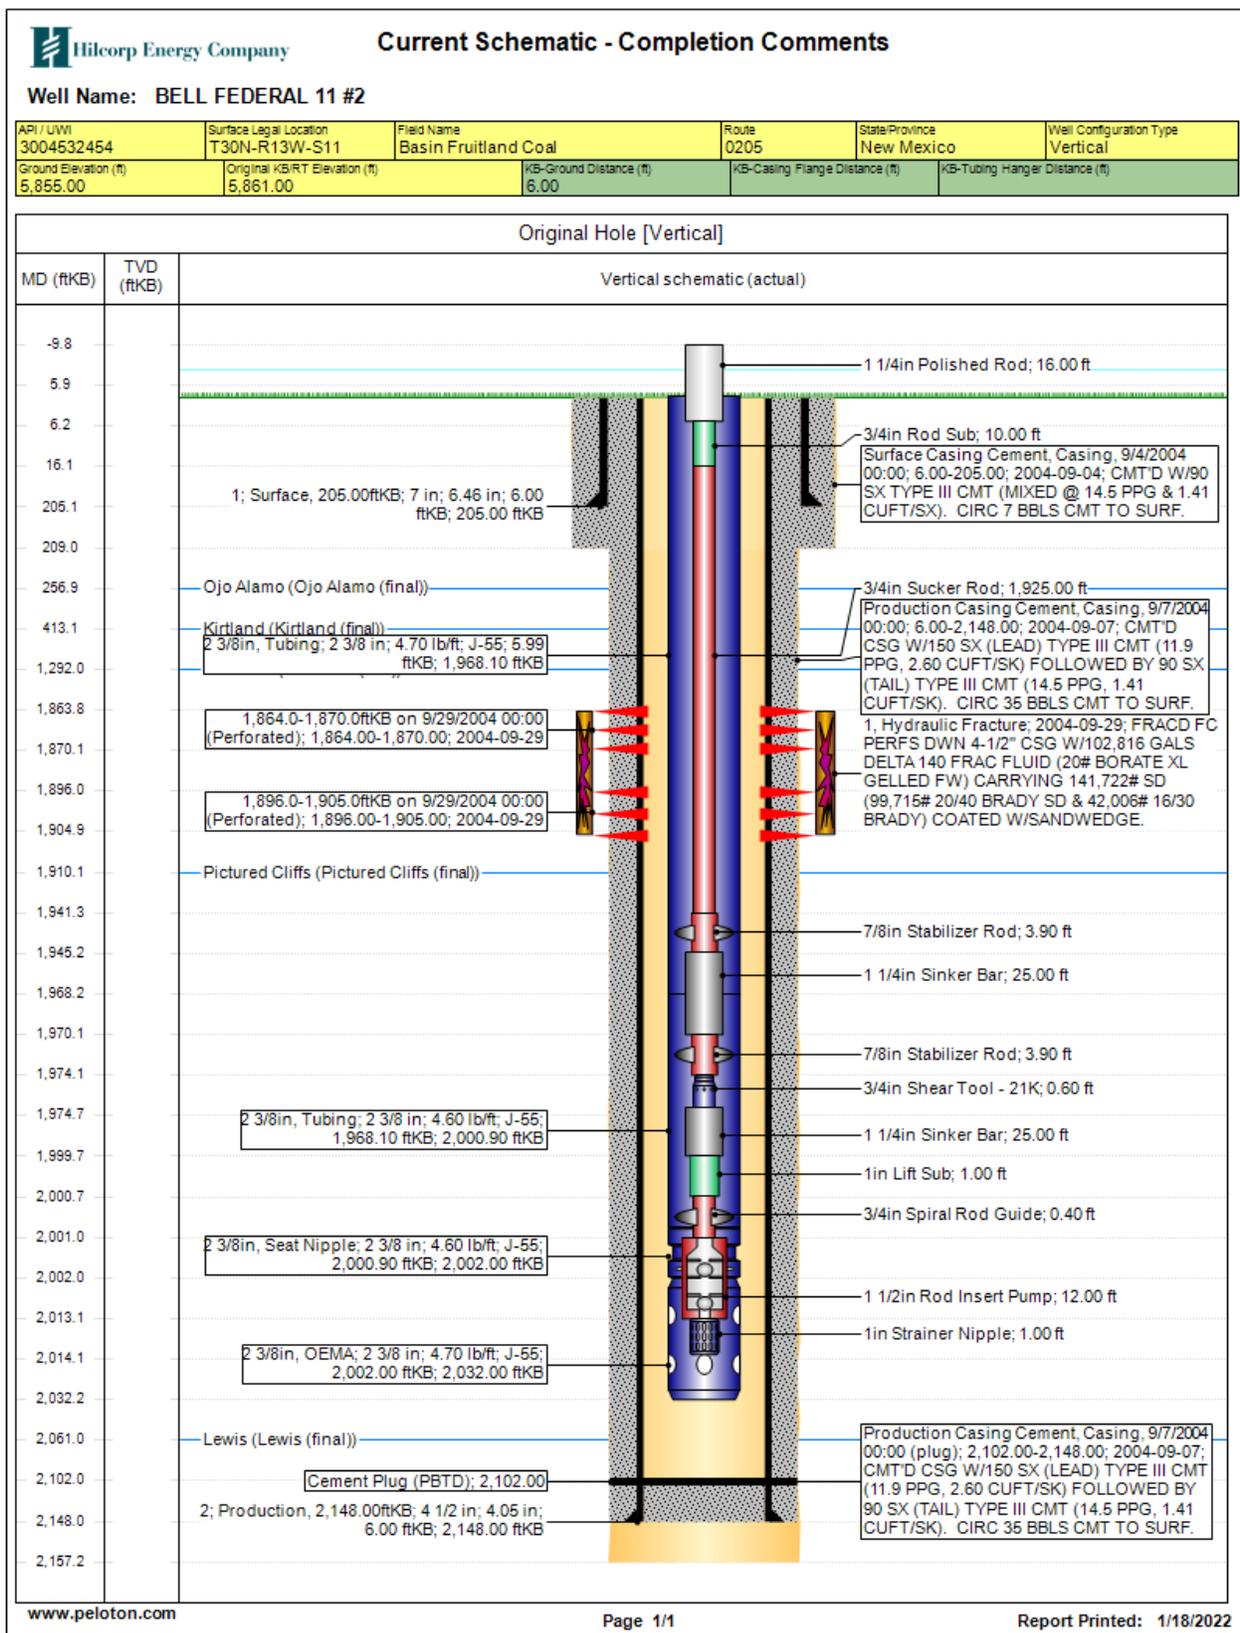

PROPOSED WELLBORE SCHEMATIC

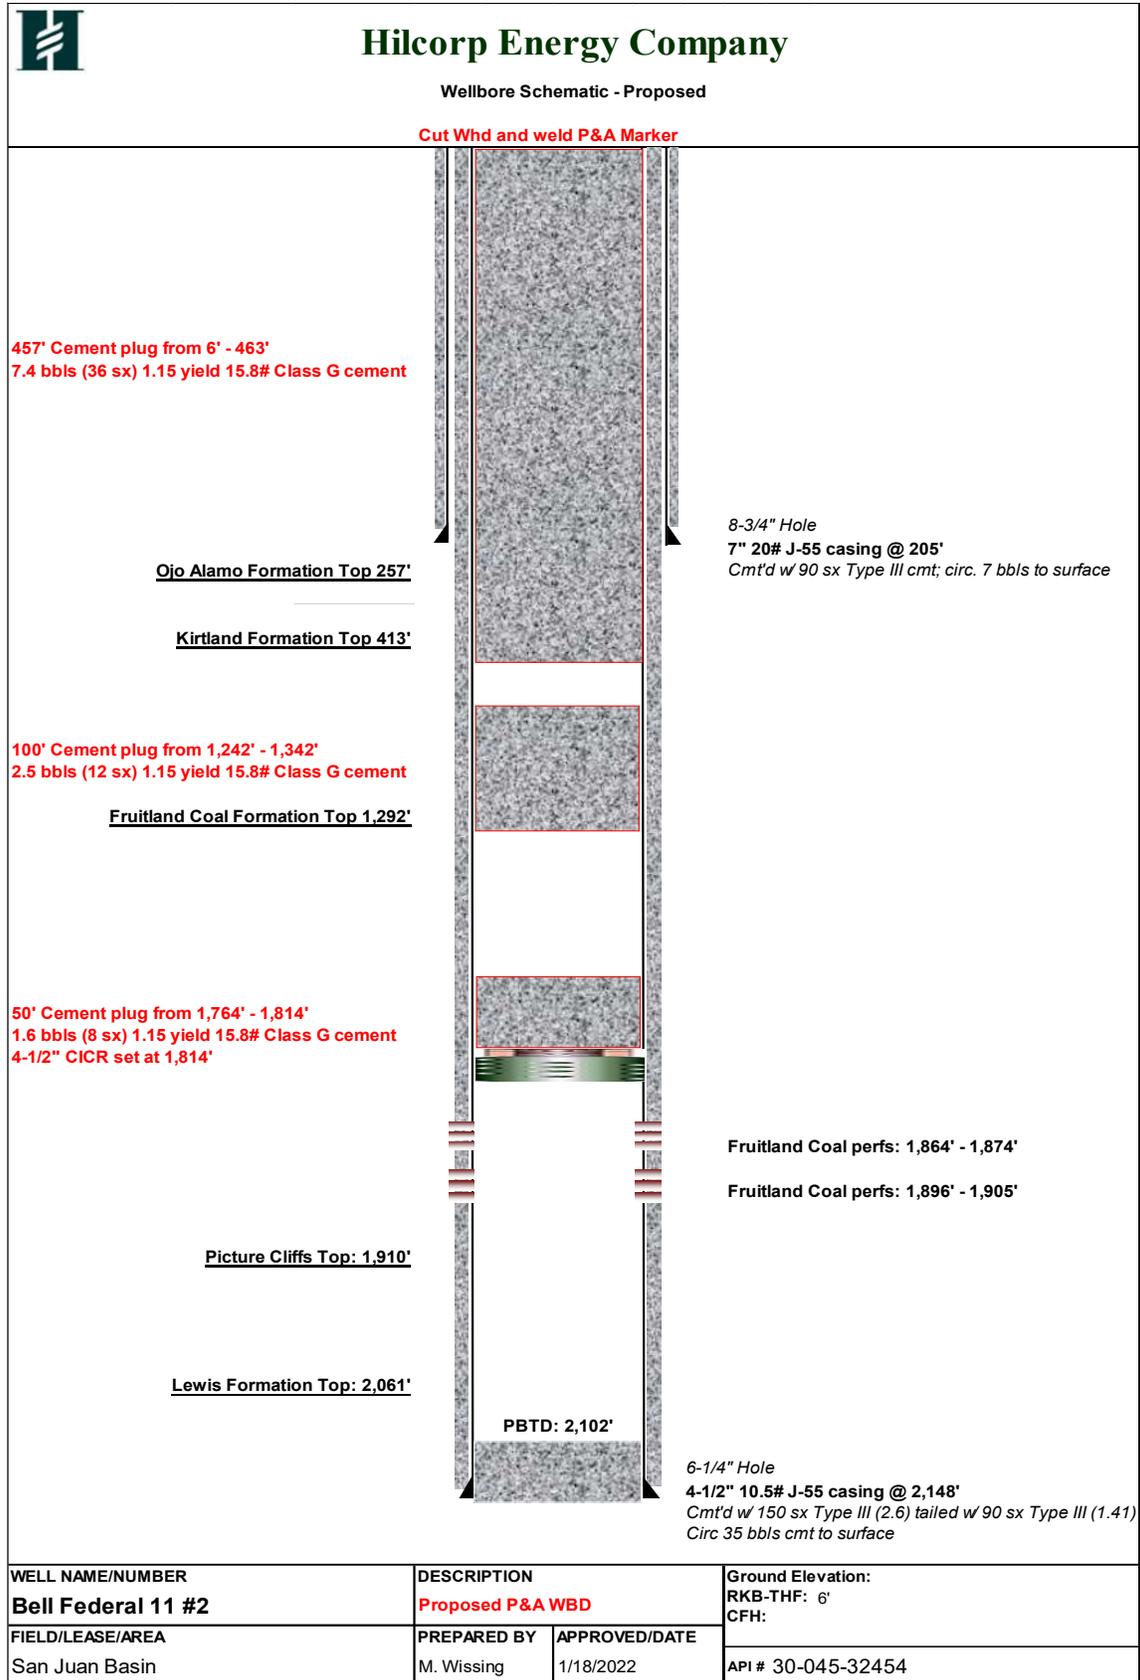

Hilcorp Energy
P&A Final Reclamation Plan
Bell federal 11 2
API: 30-045-32454
T30N-R13 W-Sec. 11-Unit E
LAT: 36.829519 LONG: -108.180633 NAD 27
Footage: 1900' FNL & 660' FWL
San Juan County, NM

1. PRE- RECLAMATION SITE INSPECTION

A pre-reclamation site inspection was completed with Bob Switzer from the BLM and Bobby Spearman, Hilcorp Energy SJ North Construction Foreman on January 13, 2022.

2. LOCATION RECLAMATION PROCEDURE

1. Reclamation work will begin in springtime.
2. Removal of all equipment, anchors, flowlines, cathodic, meter run.
3. All trash and debris will be removed within a 50' buffer outside of the location disturbance during reclamation.
4. Location will be pushed up from the Northwest edge to the South east roadway and tapered back to the west to existing grade of location
5. Rip compacted soil and walk down disturbed portion of well pad.
6. Remove all gravel from berms, pads, and bury in toe of cut or spread on access road
7. EPPCO to remove Meter run and pipeline out of roadway. Blind off at the dog leg and abandon the remaining portion

3. ACCESS ROAD RECLAMATION PROCEDURE

1. Access road to be closed with location.

4. SEEDING PROCEDURE

1. A Pinion/Juniper seed mix mixed with some sage will be used for all reclaimed and disturbed areas of the well pad and lease road.
2. Drill seed will be done where applicable, and all other disturbed areas will be broadcast seeded and harrowed. Broadcast seeding will be applied at a double the rate of seed.
3. Timing of the seeding will be when the ground is not frozen or saturated.

5. WEED MANAGEMENT

1. Halogeton was found on location. Location will be treated for noxious weeds

**GENERAL REQUIREMENTS FOR
PERMANENT ABANDONMENT OF WELLS ON FEDERAL AND INDIAN LEASES
FARMINGTON FIELD OFFICE**

- 1.0 The approved plugging plans may contain variances from the following minimum general requirements.
- 1.1 Modification of the approved plugging procedure is allowed only with the prior approval of the Authorized Officer, Farmington Field Office.
 - 1.2 Requirements may be added to address specific well conditions.
- 2.0 Materials used must be accurately measured. (densometer/scales)
- 3.0 A tank or lined pit must be used for containment of any fluids from the wellbore during plugging operations and all pits are to be fenced with woven wire. These pits will be fenced on three sides and once the rig leaves location, the fourth side will be fenced.
- 3.1 Pits are not to be used for disposal of any hydrocarbons. If hydrocarbons are present in the pit, the fluids must be removed prior to filling in.
- 4.0 All cement plugs are to be placed through a work string. Cement may be bull-headed down the casing with prior approval. Cement caps on top of bridge plugs or cement retainers may be placed by dump bailer.
- 4.1 The cement shall be as specified in the approved plugging plan.
 - 4.2 All cement plugs placed inside casing shall have sufficient volume to fill a minimum of 100' of the casing, or annular void(s) between casings, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
 - 4.3 Surface plugs may be no less than 50' in length.
 - 4.4 All cement plugs placed to fill annular void(s) between casing and the formation shall be of sufficient volume to fill a minimum of 100' of the annular space plus 100% excess, calculated using the bit size, or 100' of annular capacity, determined from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
 - 4.5 All cement plugs placed to fill an open hole shall be of sufficient volume to fill a minimum of 100' of hole, as calculated from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug. In the absence of a caliper log, an excess of 100% shall be required.
 - 4.6 **A cement bond log or other accepted cement evaluation tool is required to be run if one had not been previously ran or cement did not circulate to surface during the original casing cementing job or subsequent cementing jobs.**

5.0 All cement plugs spotted across, or above, any exposed zone(s), when; the wellbore is not full of fluid or the fluid level will not remain static, and in the case of lost circulation or partial returns during cement placement, shall be tested by tagging with the work string.

- 5.1 The top of any cement plug verified by tagging must be at or above the depth specified in the approved plan, without regard to any excess.
- 5.2 Testing will not be required for any cement plug that is mechanically contained by use of a bridge plug and/or cement retainer, if casing integrity has been established.
- 5.3 Any cement plug which is the only isolating medium, for a fresh water interval or a zone containing a prospectively valuable deposit of minerals, shall be tested by tagging.
- 5.4 If perforations are required below the surface casing shoe, a 30 minute minimum wait time will be required to determine if gas and/or water flows are present. If flow is present, the well will be shut-in for a minimum of one hour and the pressure recorded. Short or long term venting may be necessary to evacuate trapped gas. **If only a water flow occurs with no associated gas, shut well in and record the pressures. Contact the Engineer as it may be necessary to change the cement weight and additives.**

6.0 Before setting any cement plugs the hole needs to be rolled. All wells are to be controlled by means of a fluid that is to be of a weight and consistency necessary to stabilize the wellbore. This fluid shall be left in place as filler between all plugs.

- 6.1 Drilling mud may be used as the wellbore fluid in open hole plugging operations.
- 6.2 The wellbore fluid used in cased holes shall be of sufficient weight to balance known pore pressures in all exposed formations.

7.0 A blowout preventer and related equipment (BOPE) shall be installed and tested prior to working in a wellbore with any exposed zone(s); (1) that are over pressured, (2) where the pressures are unknown, or (3) known to contain H₂S.

8.0 Within 30 days after plugging work is completed, file a Sundry Notice, Subsequent Report of Abandonment (Form 3160-5), five copies, with the Field Manager, Bureau of Land Management, 6251 College Blvd., Suite A, Farmington, NM 87402. The report should show the manner in which the plugging work was carried out, the extent, by depth(s), of cement plugs placed, and the size and location, by depth(s), of casing left in the well. Show date well was plugged.

9.0 All permanently abandoned wells are to be marked with a permanent monument as specified in 43 CFR 3162.6(d). Unless otherwise approved.

10.0 If this well is located in a Specially Designated Area (SDA), compliance with the appropriate seasonal closure requirements will be necessary.

All of the above are minimum requirements. Failure to comply with the above conditions of approval may result in an assessment for noncompliance and/or a Shut-in Order being issued pursuant to 43 CFR 3163.1. You are further advised that any instructions, orders or decisions issued by the Bureau of Land Management are subject to administrative review pursuant to 43 CFR 3165.3 and appeal pursuant to 43 CFR 3165.4 and 43 CFR 4.700.

**UNITED STATES DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
FARMINGTON DISTRICT OFFICE
6251 COLLEGE BLVD.
FARMINGTON, NEW MEXICO 87402**

AFMSS 2 Sundry ID 2653168

Attachment to notice of Intention to Abandon

Well: Bell Federal 11 2

CONDITIONS OF APPROVAL

1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
2. The following modifications to your plugging program are to be made:
 - a) Pump a volume of cement below the CICR at 1814' to completely isolate the Fruitland Coal from the Pictured Cliffs. This will satisfy the requirement of adding a plug to cover the Pictured Cliffs formation at 1910' recommended in the BLM Geology Report.
3. Farmington Office is to be notified at least 24 hours before the plugging operations commence at (505) 564-7750.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.

K. Rennick 3/3/2022

**BLM FLUID MINERALS
P&A Geologic Report**

Date Completed: 3/3/2022

Well No. Bell Federal 11 #2 (API# 30-045-32454)	Location	1900	FNL	&	660	FWL
Lease No. NMNM-0546	Sec. 11	T30N			R13W	
Operator Hilcorp Energy Company	County	San Juan		State	New Mexico	
Total Depth 2157'	PBTD 2102'	Formation Fruitland (producing), Lewis (TD)				
Elevation (GL) 5855'		Elevation (KB) 5861'				

Geologic Formations	Est. Top	Est. Bottom	Log Top	Log Bottom	Remarks
San Jose Fm					
Nacimiento Fm			Surface	257	Surface/freshwater sands
Ojo Alamo Ss			257	413	Freshwater aquifer
Kirtland Shale			413	1292	
Fruitland Fm			1292	1910	Coal/Gas/Possible water
Pictured Cliffs Ss			1910	2098	Gas
Lewis Shale			2098	PBTD	
Chacra					
Cliff House Ss					
Menefee Fm					
Point Lookout Ss					
Mancos Shale					
Gallup					
Greenhorn					
Graneros Shale					
Dakota Ss					

Remarks:

P & A

- BLM picks for the Lewis and Fruitland formation tops vary from Operator picks.

- Add a plug to cover the Pictured Cliffs formation top at 1910'.

- The plugs proposed in the P&A procedure, with recommended changes, will adequately protect any freshwater sands in this well bore.

- Fruitland Coal perfs 1864' – 1905'.

- **Note: H₂S has been reported in concentrations up to 15 PPM within 1-mile of this well.**

Reference Well:

1) **Formation Tops**
Same

Prepared by: Chris Wenman

District I
 1625 N. French Dr., Hobbs, NM 88240
 Phone:(575) 393-6161 Fax:(575) 393-0720
District II
 811 S. First St., Artesia, NM 88210
 Phone:(575) 748-1283 Fax:(575) 748-9720
District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
 1220 S. St Francis Dr., Santa Fe, NM 87505
 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS
 Action 89046

CONDITIONS

Operator: HILCORP ENERGY COMPANY 1111 Travis Street Houston, TX 77002	OGRID: 372171 <hr/> Action Number: 89046 <hr/> Action Type: [C-103] NOI Plug & Abandon (C-103F)
--	--

CONDITIONS

Created By	Condition	Condition Date
kpickford	Notify NMOCD 24 Hours Prior to beginning operations	3/10/2022
kpickford	Adhere to BLM approved plugs and COAs. See GEO Repo	3/10/2022