

U.S. Department of the Interior
BUREAU OF LAND MANAGEMENT

Well Name: SAND TANK 13 FEDERAL COM	Well Location: T18S / R30E / SEC 13 / SWNW /	County or Parish/State: EDDY / NM
Well Number: 1	Type of Well: CONVENTIONAL GAS WELL	Allottee or Tribe Name:
Lease Number: NMNM28097	Unit or CA Name: SAND TANK 13 FED COM	Unit or CA Number: NMNM100711
US Well Number: 3001529784	Well Status: Gas Well Shut In	Operator: EOG RESOURCES INCORPORATED

Accepted for record – NMOCD gc 11/1/2022

Notice of Intent

Sundry ID: 2698123

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 10/13/2022

Time Sundry Submitted: 04:43

Date proposed operation will begin: 10/31/2022

Procedure Description: EOG PROPOSES TO PLUG THIS WELL USING THE ATTACHED PROCEDURE, CURRENT AND PROPOSED WELLBORE DIAGRAMS ATTACHED.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

Sand_Tank_13_Federal_COM__1__P_A_PROPOSED_WBD_20221013164326.pdf

Sand_Tank_13_Federal_COM__1__P_A_CURRENT_WBD_20221013164305.pdf

Sand_Tank_13_Federal_COM__1__P_A_Procedure_20221013164246.pdf

Well Name: SAND TANK 13 FEDERAL COM

Well Location: T18S / R30E / SEC 13 / SWNW /

County or Parish/State: EDDY / NM

Well Number: 1

Type of Well: CONVENTIONAL GAS WELL

Allottee or Tribe Name:

Lease Number: NMNM28097

Unit or CA Name: SAND TANK 13 FED COM

Unit or CA Number: NMNM100711

US Well Number: 3001529784

Well Status: Gas Well Shut In

Operator: EOG RESOURCES INCORPORATED

Conditions of Approval

Specialist Review

SAND_TANK_13_FEDERAL_COM_1__2698123__COA_AND_PROCEDURE_20221029094133.pdf

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: KAY MADDOX

Signed on: OCT 13, 2022 04:43 PM

Name: EOG RESOURCES INCORPORATED

Title: Regulatory Specialist

Street Address: 5509 CHAMPIONS DR.

City: MIDLAND

State: TX

Phone: (432) 638-8475

Email address: KAY_MADDOX@EOGRESOURCES.COM

Field

Representative Name:

Street Address:

City:

State:

Zip:

Phone:

Email address:

BLM Point of Contact

BLM POC Name: KEITH P IMMATTY

BLM POC Title: ENGINEER

BLM POC Phone: 5759884722

BLM POC Email Address: KIMMATTY@BLM.GOV

Disposition: Approved

Disposition Date: 10/29/2022

Signature: KEITH IMMATTY



Sand Tank 13 Federal COM #1 – P&A Procedure

E-13-18S-30E

API # 30-015-29784

1. Notify Regulatory Agency 24 hours prior to commencing work. MIRU well service unit and all necessary safety equipment.
2. ND WH, NU BOP.
3. RU, POOH 2.875" TBG and PKR @ 11643.
4. RIH, set 5.5" CIBP at 11650. TAG. Pressure test CIBP to 500psi for 30 minutes.
5. Circulate plugging mud and spot **35** sx class H on top of CIBP (11650 to **11388**) **to cover Morrow**
6. Pick up, perf @ 9439 and squeeze and balance w/ 25sx Class H as part of Wolfcamp Formation Top. 9439 to 9213. WOC & TAG. **Spot OK since there is cement behind production string**
7. Pick up and set a balanced plug of 25sx Class C from 6213 to 5961 to satisfy the 3000 cased hole spacing regulation
8. Pick up, perf @ 5373 and squeeze and balance w/ 25sx Class C as part of Bone Spring Formation Top. 5373 to 5121. WOC & TAG. **Spot OK since there is cement behind production string**
9. Pick up, perf @ 4244 and squeeze and balance w/ 45 sx Class C as part Delaware Formation Top and combined -50' below intermediate shoe. 4244 to 3855. WOC and TAG. **Spot OK since there is cement behind production string**
10. Pick up, perf @ 3750 and squeeze and balance w/ 25sx Class C as part of TOC requirements. 3750 to 3498. WOC & TAG.
11. Pick up, perf @ 2976 and squeeze and balance w/ **30** sx Class C as part Queen Formation Top. 2976 to 2724. WOC and TAG.
12. **Recalculate sacks for below salt + shoe plugs. BLM estimate 300sx total. Perf and sqz**
13. Pick up, perf @ 1940 and squeeze and balance w/ 114 sx Class C as part -50' BOS R-111-P solid plug requirements. 1940 to 723. WOC and TAG.
14. Pick up, perf @ 723 and squeeze and balance w/ 25 sx Class C as part of -50' below surface shoe and continued R-111-P to TOS (677). 723 to 471. WOC and TAG.
15. Pick up, perf @ 250 and squeeze and balance w/ **60** sx of Class C for surface plug. 250 to 0.
16. Cut off WH 3' below surface, verify cement to surface, and weld on below ground P&A marker.
17. Cut off anchors 3' below surface and clean location.



Well Name: Sand Tank 13 Federal COM #1
 Location: 1980 FNL & 990 FWL
 County: Eddy, NM
 Lat/Long: 32.7492943,-103.9308472
 API #: 30-015-29784
 Spud Date: 8/6/97
 Compl. Date: 10/1/97

Proposed Wellbore Diagram:

KB:
 GL: 3523


14.750"
 11.750" 42.00# @ 673
 610 sx = surface

TOC @ 3768

11.000"
 8.625" 32.00# @ 4057
 1350 sx = surface

7.875"
 5.500" 17.00# @ 11926
 920 sx = 3768

PBTD @ 11828
 TD @ 12190

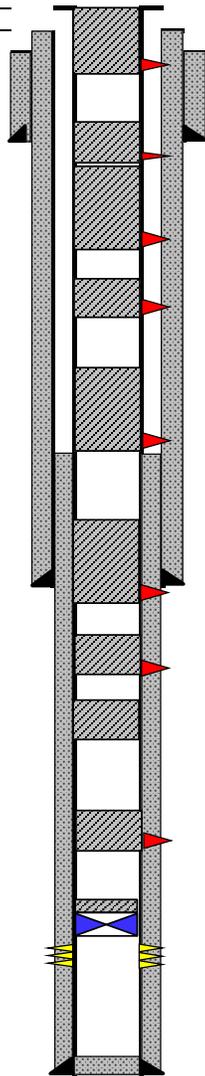

Cut off WH 3' below surface

Perf and Sqz @ 250 for TOC w/ 60sx Class C (Top ~0)

Perf and Sqz @ 723 for R-111-P & surface shoe w/ 25sx Class C, WOC & TAG (Top ~471)

Recalculate sacks for salt + shoe plug. BLM estimate 300sx

Perf and Sqz @ 1940 for R-111-P -50' below BOS to +50' TOS w/ 114sx Class C, WOC & TAG (Top ~723)

Perf and Sqz @ 2976 for -50' Queen Formation w/ 30sx Class C, WOC @ TAG (Top ~2724)

Perf and Sqz @ 3750 for TOC w/ 25sx Class C, WOC & TAG (Top ~3498)

Perf and Sqz @ 4244 for -50' Delaware Formation & Intermediate shoe Spot w/ 45sx Class C, WOC & TAG (Top ~3855)

Perf and Sqz @ 5373 for -50' Bone Spring Formation w/ 25sx Class C, WOC & TAG (Top ~5121) Spot

Balanced Plug @ 6213 for 3000 foot spacing rule w/ 25sx Class C (Top ~5961)

Perf and Sqz @ 9439 for -50' Wolfcamp Formation w/ 25sx Class H, WOC & TAG (Top ~9213) Spot

Top of 35sx Class H Spot (11650 to 11388)
 CIBP @ 11650, TAG, Spot 25 sx Class C
 Open Perfs 11698 - 11710

Formation Tops	
T of Salt	677
B of Salt	1,890
Abo	-
Glorietta (Queen)	2,926
Bell Canyon (DEL)	4,194
Brushy Canyon	-
Leonard	-
Bone Spring	5,323
Wolfcamp	9,389
Cisco	-
Canyon	-
Strawn	10,755
Atoka	10,973
Morrow	11,554

Not to Scale
 By: AEC 10/13/22

Sundry ID		2698123					
Plug Type	Top	Bottom	Length	Tag	Sacks	Notes	
Surface Plug	0.00	250.00	250.00	circulated to surface	60.00	Perf and sqz	
Shoe Plug	616.27	723.00	106.73	WOC and Tag	300.00	Same as below plug	
Top of Salt @ 677	620.23	727.00	106.77	WOC and Tag	300.00	Same as below plug	
Yates @ 1890	1821.10	1940.00	118.90	WOC and Tag	300.00	Same as below plug	
Base of Salt @ 1890	1821.10	1940.00	118.90	WOC and Tag	300.00	Perf and sqz. R111P. Cover salt	
Glorieta @ 2926	2846.74	2976.00	129.26	WOC and Tag	30.00	Perf and sqz	
Shoe Plug	3966.43	4107.00	140.57	WOC and Tag	45.00	Covered by shoe plug	
Delaware @ 4194	4102.06	4244.00	141.94	WOC and Tag	45.00		
Bonesprings @ 5323	5219.77	5373.00	153.23	WOC and Tag	25.00		
Spacer plug	5961.00	6213.00			25.00		
Wolfcamp @ 9389	9245.11	9439.00	193.89	WOC and Tag	25.00		
Morrow @ 11554	11388.46	11604.00	215.54	WOC and Tag	35.00	Covered by below plug	
CIBP Plug	11615.00	11650.00	35.00	WOC and Tag	35.00	Leak test 500psi, 30mins	

No more than 2000' is to be allowed between plugs in open hole, and no more than 3000' between plugs in cased hole.
Class H >7500'
Class C <7500'
Fluid used to mix the cement in R111P shall be saturated with the salts common to the section penetrated, and in suitable proportions, but not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.
Critical, High Cave Karst: Cave Karst depth to surface
R111P: Solid plug in all annuli - 50' from bottom of salt to surface.
Class C: 1.32 ft³/sx
Class H: 1.06 ft³/sx

Onshore Order 2.III.G Drilling Abandonment Requirements: "All formations bearing usable-quality water, oil, gas, or geothermal resources, and/or a prospectively valuable deposit of minerals shall be protected.

Cave Karst/Potash Cement	R111-P	50 Feet from Base of Salt to Surface	500.00
---------------------------------	---------------	---	---------------

Shoe @	673.00
Shoe @	4057.00
Shoe @	11926.00

Perforatons Top @	11698.00	Perforations	11710.00
-------------------	----------	--------------	----------

CIBP @	11650.00
--------	----------

**BUREAU OF LAND MANAGEMENT
Carlsbad Field Office
620 East Greene Street
Carlsbad, New Mexico 88220
575-234-5972**

**Permanent Abandonment of Federal Wells
Conditions of Approval (LPC Habitat)**

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within **ninety (90)** days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. **Notification:** Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-689-5981.

3. **Blowout Preventers:** A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. **Mud Requirement:** Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.

5. **Cement Requirement:** Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.** Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. Subsequent Plugging Reporting: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

8. Trash: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:

From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office
620 E. Greene St.
Carlsbad, New Mexico 88220-6292
www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo “interim” reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo “final” reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its pre-disturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any/all contaminants, scrap/trash, equipment, pipelines and powerlines **(Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure)**. Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip (across the slope and seed as specified in the original APD COA. **This will apply to well pads, facilities, and access roads.** Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos
Supervisory Petroleum Engineering Tech/Environmental Protection Specialist
575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias
Environmental Protection Specialist
575-234-6230

Crisha Morgan
Environmental Protection Specialist
575-234-5987

Jose Martinez-Colon
Environmental Protection Specialist
575-234-5951

Mark Mattozzi
Environmental Protection Specialist
575-234-5713

Robert Duenas
Environmental Protection Specialist
575-234-2229

Trishia Bad Bear, Hobbs Field Station
Natural Resource Specialist
575-393-3612



Well Name: Sand Tank 13 Federal COM #1
 Location: 1980 FNL & 990 FWL
 County: Eddy, NM
 Lat/Long: 32.7492943,-103.9308472
 API #: 30-015-29784
 Spud Date: 8/6/97
 Compl. Date: 10/1/97

Current Wellbore Diagram:

KB:
 GL: 3523

14.750"
 11.750" 42.00# @ 673
 610 sx = surface


TOC @ 3768

11.000"
 8.625" 32.00# @ 4057
 1350 sx = surface

2.875" EOT @ 11643 PKR

7.875"
 5.500" 17.00# @ 11926
 920 sx = 3768

PBTD @ 11828
 TD @ 12190

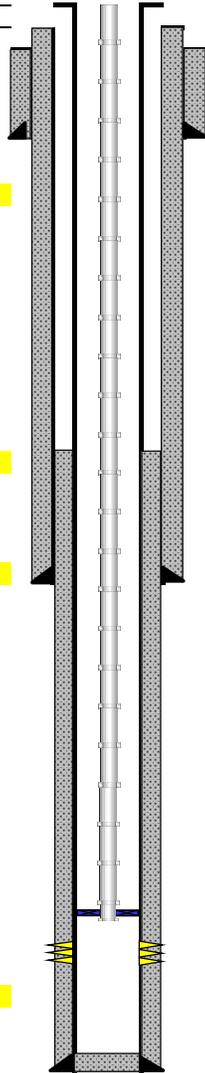

Open Perfs 11698 - 11710

Formation Tops	
T of Salt	677
B of Salt	1,890
Abo	-
Glorietta (Queen)	2,926
Bell Canyon (DEL)	4,194
Brushy Canyon	-
Leonard	-
Bone Spring	5,323
Wolfcamp	9,389
Cisco	-
Canyon	-
Strawn	10,755
Atoka	10,973
Morrow	11,554

Not to Scale
 By: AEC 10/13/22



District I
 1625 N. French Dr., Hobbs, NM 88240
 Phone:(575) 393-6161 Fax:(575) 393-0720

District II
 811 S. First St., Artesia, NM 88210
 Phone:(575) 748-1283 Fax:(575) 748-9720

District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV
 1220 S. St Francis Dr., Santa Fe, NM 87505
 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 155121

CONDITIONS

Operator: EOG RESOURCES INC P.O. Box 2267 Midland, TX 79702	OGRID: 7377
	Action Number: 155121
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
gcordero	None	11/1/2022