U.S. Department of the Interior		Sundry Print Report 01/19/2023
BUREAU OF LAND MANAGEMENT		
Well Name: TITANS FEDERAL COM	Well Location: T16S / R29E / SEC 17 / SWNW / 32.924415 / -104.105534	County or Parish/State: EDDY / NM
Well Number: 1	Type of Well: OIL WELL	Allottee or Tribe Name:
Lease Number: NMLC062996B	Unit or CA Name: 1-TITANS FED COM	Unit or CA Number: NMNM123771
US Well Number: 300153644900S1	Well Status: Oil Well Shut In	Operator: MACK ENERGY CORPORATION
<u></u>	Accepted for record – NMOCD $gc 1/30/2023$	

LONG VO

Digitally signed by LONG VO Date: 2023.01.28 10:48:45 -06'00'

Notice of Intent

Sundry ID: 2706709

Type of Submission: Notice of Intent

Date Sundry Submitted: 12/09/2022

Date proposed operation will begin: 12/15/2022

Procedure Description: 1. Set 5 1/2" CIBP @ 6400'. Circ hole w/ MLF. Pressure test csg. Spot 25 sx cmt @ 6400-6200'. 2. Spot 25 sx cmt @ 5800-5600' (Abo) 3. Spot 25 sx cmt @ 2345-2145'. (San Andres) 4. Spot 50 Sx cmt @ 795-332'. WOC & Tag (Yates & 9 5/8" Shoe) 5. Spot 25 sx cmt @ 200' to surface. 6. Cut off well head, verify cmt @ surface, weld on Dry Hole Marker.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

Titans_Fed_Com_1___Current__WBD_20221209143545.pdf

Titans_Fed_Com_1___Proposed_NOI_20221209143545.pdf

Titans_Fed_Com_1___Proposed_WBD_20221209143545.pdf

Approval Subject to General Requirements and Special Stipulations Attached

Type of Action: Plug and Abandonment

Time Sundry Submitted: 02:37

Receive	ed by OCD: 1/30/2023 10:57:29 AM SII Name: TITANS FEDERAL COM	Well Location: T16S / R29E / SEC 17 / SWNW / 32.924415 / -104.105534	County or Parish/State: EDDY?		
We	ell Number: 1	Type of Well: OIL WELL	Allottee or Tribe Name:		
Le	ase Number: NMLC062996B	Unit or CA Name: 1-TITANS FED COM	Unit or CA Number: NMNM123771		
US	6 Well Number: 300153644900S1	Well Status: Oil Well Shut In	Operator: MACK ENERGY CORPORATION		

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: DELILAH FLORES

Signed on: DEC 09, 2022 02:37 PM

Name: MACK ENERGY CORPORATION

Title: Regulatory Technician 1

Street Address: 11344 LOVINGTON HWY

City: ARTESIA

State: NM

State:

Phone: (575) 748-1288

Email address: DELILAH@MEC.COM

Field

Representative Name: Street Address: City: Phone: Email address:

Zip:

Plug Abandonment NOI Proposed

OPERATOR NAME:	MACK ENERGY CORPORATION
LEASE NO.:	NMLC062996B
WELL NAME & NO.:	Titans Fed Com #1
US WELL NUMBER:	30-015-36449
LOCATION:	Sec 17 T16S R29E SWNW
COUNTY:	Eddy, NM

1. Set 5 1/2" CIBP @ 6400'. Circ hole w/ MLF. Pressure test csg. Spot 25 sx cmt @ 6400-6200'.

2. Spot 25 sx cmt @ 5800-5600' (Abo)

3. Spot 25 sx cmt @ 3800-3662'. (Glorieta)


4. Spot 79 Sx cmt @ 795' to surface. Verify at surface (Yates & 9 5/8"

Shoe, Base of Salt, Top of Salt, Fresh water, surface plug)

5. Cut off well head, verify cmt @ surface, weld on Dry Hole Marker.

Corporation	PROPSED		
Abby BCM			
Titans Fed Com	Well No.	#1	
COUNTY LINE		20.045.26440	
TANK-ABO	API #:	30-015-36449	
Eddy	Location:	Sec 17 T16S R29E	
NM		1675FNL 30FWL	
4/28/2009	GL:	3644	
	Abby BCM Titans Fed Com COUNTY LINE TANK-ABO Eddy NM	Abby BCMTitans Fed ComWell No.COUNTY LINEAPI #:TANK-ABOAPI #:EddyLocation:NM	

Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx	TOC
Surface Csg	8 5/8	J55	24#	382	12 1/4	455	0
Inter Csg	5 1/2	P110	17#	7,240	6 1/8	910	0
Prod Csg	4 1/2	HCP- 110	11.6#	7240- 11550	6 1/8	750	0

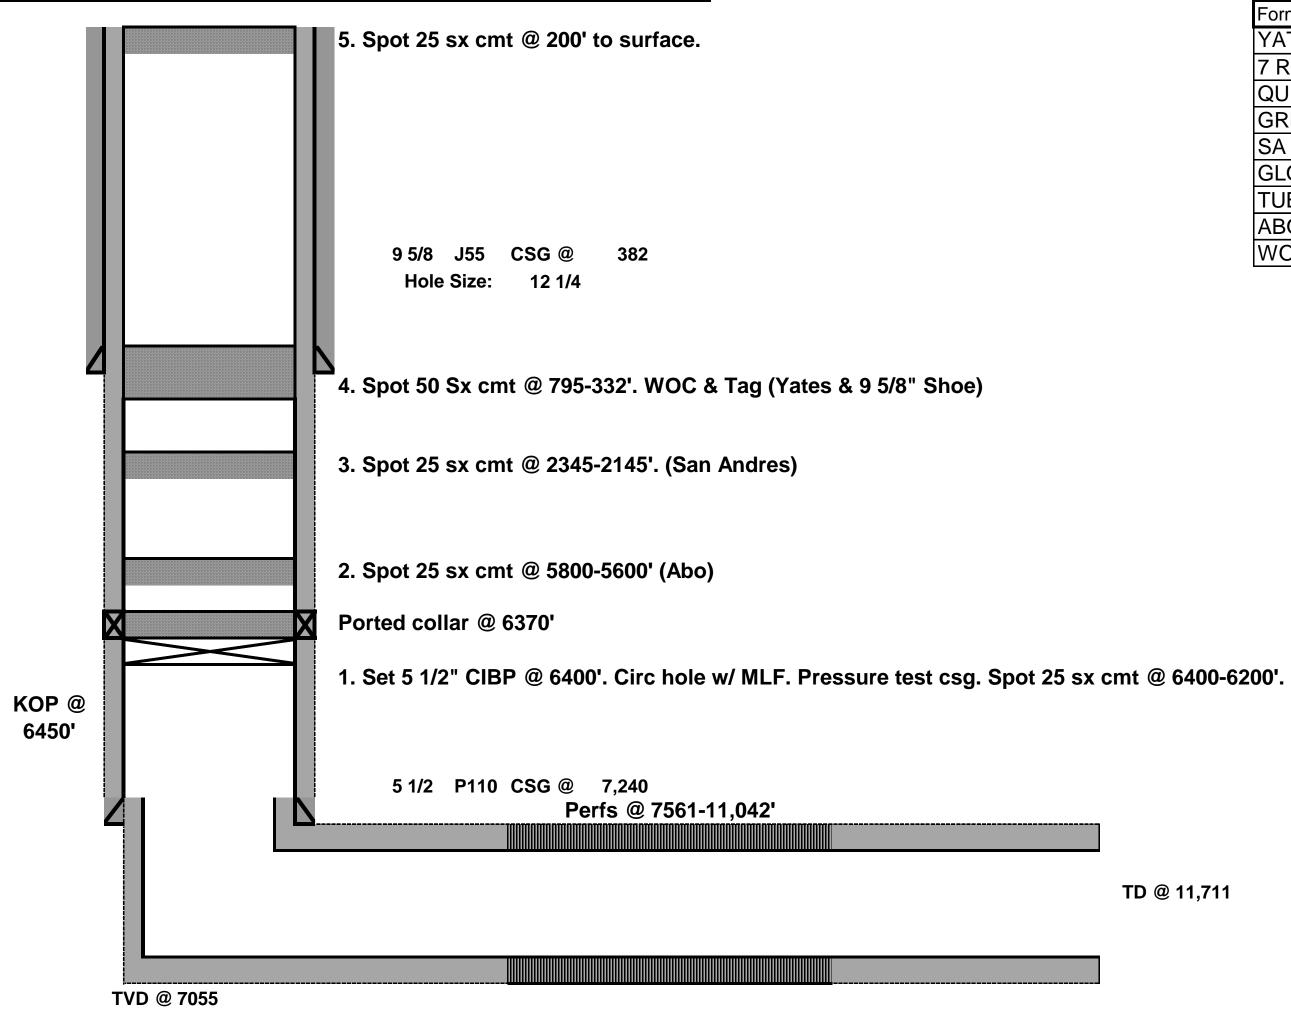


4 1/2" P110 Liner @ 7240-11550 Hole Size:

Formation	Тор
YATES	745
7 RVS	971
QUEEN	1490
GRBG	1900
SA	2294
GLORIETA	3750
TUBB	4688
ABO	5750
WOLFCAMP	7056

Approval Subject to General Requirements and **Special Stipulations** Attached

TD @ 11,711

6 1/8

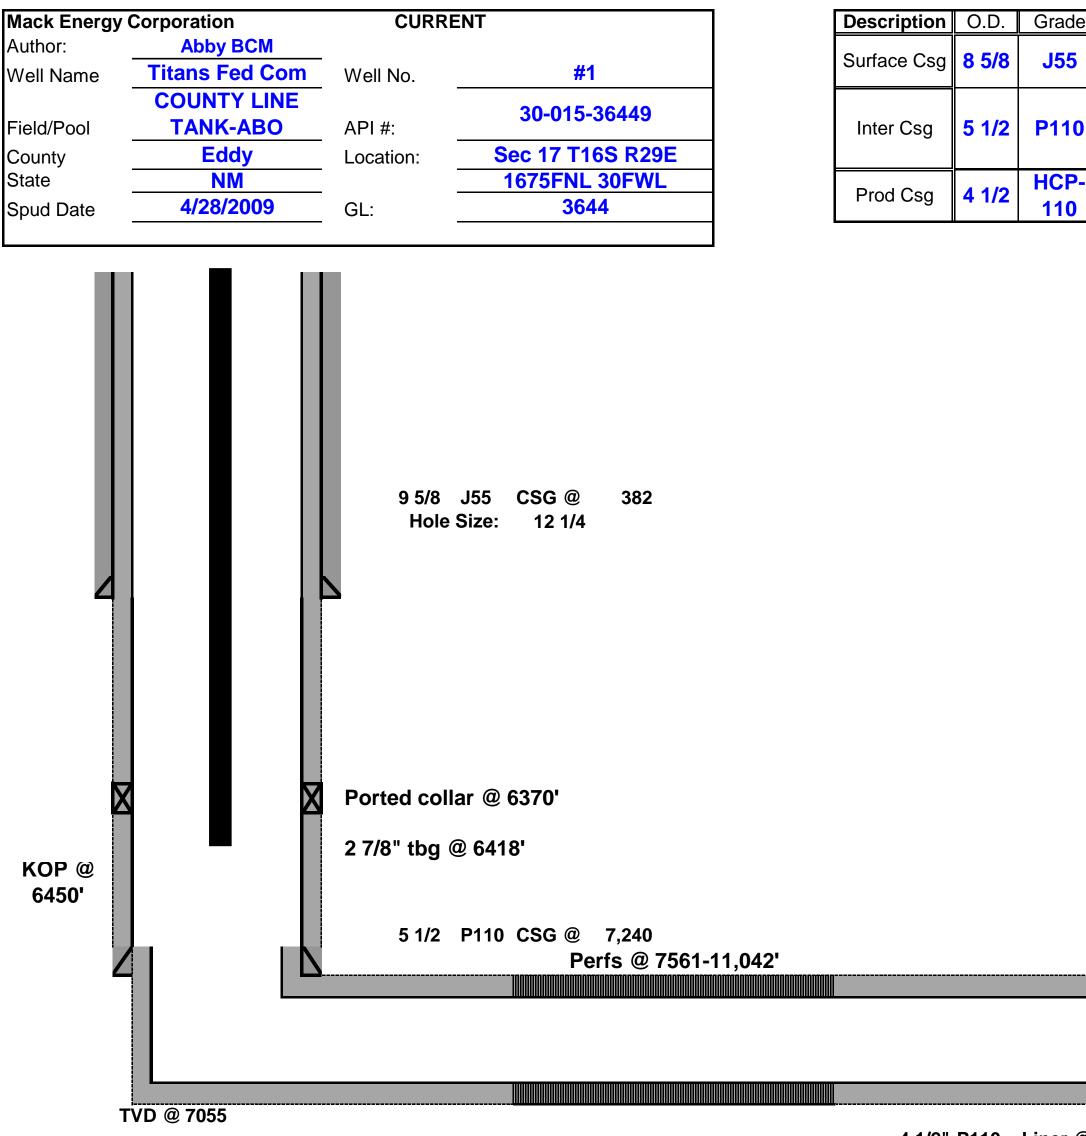

4 1/2" P110 Liner @ 7240-11550 Hole Size: 6 1/8

-

е	Weight	Depth	Hole	Cmt Sx	TOC
	24#	382	12 1/4	455	0
)	17#	7,240	6 1/8	910	0
-	11.6#	7240- 11550	6 1/8	750	0

Тор
745
971
1490
1900
2294
3750
4688
5750
7056

TD @ 11,711

•

Sundry ID	2706709						
						Cement	
Plug Type	Тор	Bottom	Length	Tag	Sacks	Class	Notes
Surface Plug	0.00	100.00		Tag/Verify			
Fresh Water @ 180	128.20	230.00		base no			
Top of Salt @ 345	291.55	395.00		Tag/Verify			
Shoe Plug	328.18			Tag/Verify			
Base of Salt @ 640	583.60	690.00	106.40	Tag/Verify			
				If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio			Spot cement from 795' to surface.
Yates @ 745	687.55	795.00	107.45		79.00	С	Verify at surface.
		750.50	101.40	If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open			
Glorieta @ 3750	3662.50	3800.00	137.50	Perforatio ns	25.00	С	Spot cement from 3800' to 3662'.

•

				If solid			
				base no need to			
				Tag			
				(CIBP			
				present and/or			
				Mechanic			
				al Integrity			
				Test), If			
				Perf & Sqz then			
				Tag, Leak			
				Test all			
				CIBP if no Open			
				Perforatio			Spot cement from
ABO in Plateform Shelf @ 5750	5642.50	5800.00	157.50		25.00	С	5800' to 5642'.
KOP @ 6450	6335.50	6500.00	164.50	base no			
				If solid			
				base no			
				need to Tag			
				(CIBP			
				present			
				and/or Mechanic			
				al Integrity			
				Test), If			
				Perf &			
				Sqz then Tag, Leak			
				Test all			
				CIBP if no			
				Open Perforatio			Set CIBP at 6400'. Leak test CIBP.
CIBP Plug	6365.00	6400.00	35.00		25.00	С	Spot 25 sxs on top.
Wolfcamp @ 7056	6935.44	7106.00		base no			
Shoe Plug	7117.60	7290.00	172 /0	Tag/Verify			
Silve Flug	/11/.00	1290.00	172.40	ray/veilly			

No more than 2000' is to be allowed between plugs in open hole, and no more than 3000' between plugs in cased hole.

Class H >7500'

Class C<7500'

Fluid used to mix the cement in R111P shall be saturated with the salts common to the section penetrated, and in suitable proportions, but not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

Medium, Secretary: Top of salt to surface If no salt take the deepest fresh water or Karst Depth

High, Critical: Bottom of Karst to surface or Deepest fresh water, whichever is greater R111P: 50 Feet from Base of Salt to surface.

Class C: 1.32 ft³/sx Class H: 1.06 ft³/sx

Onshore Order 2.III.G Drilling Abandonment Requirements: "All formations bearing usable-quality water, oil, gas, or geothermal resources, and/or a prospectively valuable deposit of minerals shall be protected.

Cave Karst/Potash Cement	High	Bottom of Karst/take deepest fresh water/top of salt whichever is greater to surface
Shoe @	382.00	
Shoe @	7240.00	

CIBP @ 6400.00

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-689-5981.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds). A weep hole shall be left if a metal plate is welded in place.

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any/all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip (across the slope and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech/Environmental Protection Specialist 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan Environmental Protection Specialist 575-234-5987

Jose Martinez-Colon Environmental Protection Specialist 575-234-5951

Mark Mattozzi Environmental Protection Specialist 575-234-5713

Robert Duenas Environmental Protection Specialist 575-234-2229

Trishia Bad Bear, Hobbs Field Station Natural Resource Specialist 575-393-3612 Received by OCD: 1/30/2023 10:57:29 AM

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3470 Fax: (505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Operator:	OGRID:
MACK ENERGY CORP	13837
P.O. Box 960	Action Number:
Artesia, NM 882110960	180624
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By		Condition Date
gcordero	None	1/30/2023

Page 14 of 14

Action 180624