Received by UCD.Sy24/2023 1:49:23 PM U.S. Department of the Interior BUREAU OF LAND MANAGEMENT		Sundry Print Report 07/24/2023
Well Name: ALLIED 7 FED	Well Location: T18S / R31E / SEC 7 / NENE /	County or Parish/State: EDDY / NM
Well Number: 2	Type of Well: OIL WELL	Allottee or Tribe Name:
Lease Number: NMNM68039	Unit or CA Name:	Unit or CA Number:
<b>US Well Number:</b> 3001525902	Well Status: Producing Oil Well	<b>Operator:</b> DEVON ENERGY PRODUCTION COMPANY LP

# **Notice of Intent**

Sundry ID: 2737287 Type of Submission: Notice of Intent Date Sundry Submitted: 06/21/2023 Date proposed operation will begin: 09/15/2023

Type of Action: Plug and Abandonment Time Sundry Submitted: 03:47

> Approval Subject to General Requirements and

**Special Stipulations** 

Attached

15

Procedure Description:

**Surface Disturbance** 

Is any additional surface disturbance proposed?: No

# **NOI Attachments**

### **Procedure Description**

ALLIED\_7\_FED\_2\_NOI\_P\_A\_SIGNED\_CURRENT\_PROPOSED\_WBD\_20230621154705.pdf

I	eceived by OCD: 7/24/2023 1:49:23 PM Well Name: ALLIED 7 FED	Well Location: T18S / R31E / SEC 7 / NENE /	County or Parish/State: EDBY 7 of 15 NM
	Well Number: 2	Type of Well: OIL WELL	Allottee or Tribe Name:
	Lease Number: NMNM68039	Unit or CA Name:	Unit or CA Number:
	US Well Number: 3001525902	Well Status: Producing Oil Well	<b>Operator:</b> DEVON ENERGY PRODUCTION COMPANY LP

## Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

**Operator Electronic Signature: JEFF YOUNG** 

Signed on: JUN 21, 2023 03:47 PM

Name: DEVON ENERGY PRODUCTION COMPANY LP

State: OK

State:

Title: Production Data Analyst

Street Address: 333 W SHERIDAN AVE

City: OKLAHOMA CITY

Phone: (405) 228-2480

Email address: JEFF.YOUNG@DVN.COM

**Field** 

Representative Name: Street Address: City: Phone: Email address:

Zip:

Farm 21/0 5								Page 3 of	
Form 3160-5 (June 2015) D	S NTERIOR				FORM APPROVED OMB No. 1004-0137 Expires: January 31, 2018				
BL	REAU OF LAND MANA	AGEMENT			5. Lease Seria	5. Lease Serial No. NMNM68039			
SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.						llottee or T	ribe Name		
SUBMIT	N TRIPLICATE - Other instru	ctions on page	2		7. If Unit of C	CA/Agreem	ent, Name and/or No.		
I. Type of Well	_				8 Well Name	and No			
Oil Well 🖌 Ga						Al	LIED 7 FEDERAL 2		
2. Name of Operator DEVON ENE					9. API Well N				
3a. Address 333 West Sheridan Avenue, Oklahoma City, OK 3b. Phone No. (include area code)   73102-5015 (405) 228-2480						, N. BONE			
Location of Well <i>(Footage, Sec., 1</i> Sec 7 T18S R31E; 660FNL 760					11. Country o EDDY, NM	-	ate		
12. CI	IECK THE APPROPRIATE BO	X(ES) TO IND	ICATE NATUR	E OF N	OTICE, REPORT	OR OTHER	R DATA		
TYPE OF SUBMISSION			TY	PE OF	ACTION				
✓ Notice of Intent	Acidize	Deepe	n		Production (Start/R	esume)	Water Shut-Off		
	Alter Casing	Hydra	ulic Fracturing		Reclamation		Well Integrity		
Subsequent Report	Casing Repair		Construction		Recomplete		Other		
Final Abandonment Notice	Change Plans	✓ Plug a	nd Abandon		Temporarily Aband Water Disposal	on			
the Bond under which the work v completion of the involved opera completed. Final Abandonment N ready for final inspection.)	vill be perfonned or provide the tions. If the operation results in lotices must be filed only after a	Bond No. on file a multiple comp Il requirements,	e with BLM/BIA letion or recomp	A. Required A. Req	in a new interval, a	Form 3160	e filed within 30 days f -4 must be filed once te	ollowing sting has bee	
the Bond under which the work v completion of the involved opera completed. Final Abandonment N ready for final inspection.) 1. MIRU P&A unit. POOH roo 2. Set CIBP @ 7988'. Tag. C 3. Spot 25 sx CI C from 5438' 4. Spot 25 sx CI C from 5282' 5. SpOt cement f rOm 3690' t 6. Spot 25 sx CI C from 2550 7. SpOt cement f rOm 1905' t	vill be perfonned or provide the tions. If the operation results in Jotices must be filed only after a d string and tubing from 8363' irc 10# salt gel. Leak Test 500 tO 5284'. (T. Bone Spring @ tO 4139'. (T. Delaware @ 42: 0 3553'. 25 sx Class C (Capitar '-2425'. WOC & tag. (Shoe @ 0 1702'. WOC and Tag. 25 sx ( to surf ace. (T. Salt @ 743') V	Bond No. on file a multiple comp Il requirements, () () psi 30 min. () () () psi 30 min. () () () psi 30 min. () () psi	e with BLM/BIA letion or recomp including reclar Spot 25 sx Cl F @ 1855', B. S	A. Requisition	ired subsequent rep in a new interval, a have been complet 7988'-7825'. (Per	Form 3160 ed and the	e filed within 30 days f 4 must be filed once to operator has detennined	ollowing sting has been	
the Bond under which the work v completion of the involved opera completed. Final Abandonment N ready for final inspection.) 1. MIRU P&A unit. POOH rod 2. Set CIBP @ 7988'. Tag. C 3. Spot 25 sx CI C from 5438' 4. Spot 25 sx CI C from 5282' 5. Sp Ot cement f rOm 3690' tr 6. Spot 25 sx CI C from 735' 7. Sp Ot cement f rOm 1905' t 8. Spot 79 sx CI C from 733' 9. Cut wellhead off 3' BGL, s	vill be perfonned or provide the tions. If the operation results in a lotices must be filed only after a d string and tubing from 8363' irc 10# salt gel. Leak Test 50 to 5284'. (T. Bone Spring @ tO 4139'. (T. Delaware @ 42: 0 3553'. 25 sx Class C (Capitar '-2425'. WOC & tag. (Shoe @ 0 1702'. WOC and Tag. 25 sx ( to surf ace. (T. Salt @ 743') V set dry hole marker.	Bond No. on file a multiple comp Il requirements, 0 psi 30 min. 3 5388') 32') 1 @ 3640') 2500';) Class C (Yates erif y at surf ac	e with BLM/BIA letion or recomp including reclar Spot 25 sx Cl H @ 1855', B. S e.	A. Required at a constraint and the constraint and	ired subsequent rep in a new interval, a have been complet 7988'-7825'. (Per	Form 3160 ed and the	e filed within 30 days f 4 must be filed once to operator has detennined	ollowing sting has bee	
the Bond under which the work v completion of the involved opera completed. Final Abandonment N ready for final inspection.) 1. MIRU P&A unit. POOH rod 2. Set CIBP @ 7988'. Tag. C 3. Spot 25 sx CI C from 5438' 4. Spot 25 sx CI C from 5282' 5. Sp Ot cement f rOm 3690' tr 6. Spot 25 sx CI C from 735' 7. Sp Ot cement f rOm 1905' t 8. Spot 79 sx CI C from 733' 9. Cut wellhead off 3' BGL, s	vill be perfonned or provide the tions. If the operation results in a lotices must be filed only after a d string and tubing from 8363' irc 10# salt gel. Leak Test 50 to 5284'. (T. Bone Spring @ tO 4139'. (T. Delaware @ 42: 0 3553'. 25 sx Class C (Capitar '-2425'. WOC & tag. (Shoe @ 0 1702'. WOC and Tag. 25 sx ( to surf ace. (T. Salt @ 743') V set dry hole marker.	Bond No. on file a multiple comp Il requirements, 0 psi 30 min. 5 5388') 32') 1 @ 3640') 2500';) Class C (Yates erif y at surf ac	e with BLM/BIA letion or recomp including reclar Spot 25 sx Cl F @ 1855', B. S	A. Required at a constraint and the constraint and	ired subsequent rep in a new interval, a have been complet 7988'-7825'. (Per	Form 3160 ed and the	e filed within 30 days f 4 must be filed once to operator has detennined	ollowing sting has been	
the Bond under which the work v completion of the involved opera completed. Final Abandonment N ready for final inspection.) 1. MIRU P&A unit. POOH rod 2. Set CIBP @ 7988'. Tag. C 3. Spot 25 sx CI C from 5438' 4. Spot 25 sx CI C from 5282' 5. SpOt cement f rOm 3690' tr 6. Spot 25 sx CI C from 793' 9. Cut wellhead off 3' BGL, st 1. hereby certify that the foregoing	vill be perfonned or provide the tions. If the operation results in a lotices must be filed only after a d string and tubing from 8363' irc 10# salt gel. Leak Test 50 to 5284'. (T. Bone Spring @ tO 4139'. (T. Delaware @ 42: 0 3553'. 25 sx Class C (Capitar '-2425'. WOC & tag. (Shoe @ 0 1702'. WOC and Tag. 25 sx ( to surf ace. (T. Salt @ 743') V set dry hole marker.	Bond No. on file a multiple comp Il requirements, 0 psi 30 min. 5 5388') 32') 1 @ 3640') 2500';) Class C (Yates erif y at surf ac	e with BLM/BIA letion or recomp including reclar Spot 25 sx Cl H @ 1855', B. S e. Productio	A. Required at a constraint and the constraint and	iired subsequent rep in a new interval, a have been complet 7988'-7825'. (Per 1770')	Form 3160 ed and the	e filed within 30 days f -4 must be filed once to operator has detennined ')	ollowing sting has been	
the Bond under which the work v completion of the involved opera completed. Final Abandonment N ready for final inspection.) 1. MIRU P&A unit. POOH rod 2. Set CIBP @ 7988'. Tag. C 3. Spot 25 sx CI C from 5438' 4. Spot 25 sx CI C from 5282' 5. Sp Ot cement f rOm 3690' tr 6. Spot 25 sx CI C from 783' 9. Cut wellhead off 3' BGL, s 1. hereby certify that the foregoing eff Young	vill be perfonned or provide the tions. If the operation results in Jotices must be filed only after a d string and tubing from 8363' irc 10# salt gel. Leak Test 500 tO 5284'. (T. Bone Spring @ tO 4139'. (T. Delaware @ 42: 0 3553'. 25 sx Class C (Capitar '-2425'. WOC & tag. (Shoe @ 0 1702'. WOC and Tag. 25 sx ( to surf ace. (T. Salt @ 743') V set dry hole marker.	Bond No. on file a multiple comp Il requirements, 	e with BLM/BIA letion or recomp including reclar Spot 25 sx Cl H @ 1855', B. S e. Title Production Date	A. Required for the second sec	ired subsequent rep in a new interval, a have been complet 7988'-7825'. (Per 1770')	fs @ 8038	e filed within 30 days f -4 must be filed once to operator has detennined ')	ollowing sting has been	
the Bond under which the work v completion of the involved opera completed. Final Abandonment N ready for final inspection.) 1. MIRU P&A unit. POOH row 2. Set CIBP @ 7988', Tag. C 3. Spot 25 sx Cl C from 5438' 4. Spot 25 sx Cl C from 5282' 5. SpOt cement f rOm 3690' tr 6. Spot 25 sx Cl C from 2550 7. SpOt cement f rOm 1905' t 8. Spot 79 sx Cl C from 793' 9. Cut wellhead off 3' BGL, s 1. I hereby certify that the foregoing eff Young Signature	vill be perfonned or provide the tions. If the operation results in a lotices must be filed only after a d string and tubing from 8363' irc 10# salt gel. Leak Test 500 to 5284'. (T. Bone Spring @ to 4139'. (T. Delaware @ 42: 0 3553'. 25 sx Class C (Capitar '-2425'. WOC & tag. (Shoe @ 0 1702'. WOC and Tag. 25 sx ( to surf ace. (T. Salt @ 743') V set dry hole marker.	Bond No. on file a multiple comp Il requirements, 	e with BLM/BIA letion or recomp including reclar Spot 25 sx Cl H @ 1855', B. S e. Title Production Date	A. Required for the second sec	ired subsequent rep in a new interval, a have been complet 7988'-7825'. (Per 1770')	fs @ 8038	e filed within 30 days f -4 must be filed once to operator has detennined ')	ollowing sting has been	
the Bond under which the work v completion of the involved opera completed. Final Abandonment N ready for final inspection.) 1. MIRU P&A unit. POOH rod 2. Set CIBP @ 7988'. Tag. C 3. Spot 25 sx CI C from 5438' 4. Spot 25 sx CI C from 5282' 5. SpOt cement f rOm 3690' tr 6. Spot 25 sx CI C from 2550' 7. SpOt cement f rOm 1905' t 8. Spot 79 sx CI C from 783' 9. Cut wellhead off 3' BGL, s 4. I hereby certify that the foregoing eff Young	vill be perfonned or provide the tions. If the operation results in a lotices must be filed only after a d string and tubing from 8363' irc 10# salt gel. Leak Test 500 to 5284'. (T. Bone Spring @ to 4139'. (T. Delaware @ 42: 0 3553'. 25 sx Class C (Capitar '-2425'. WOC & tag. (Shoe @ 0 1702'. WOC and Tag. 25 sx ( to surf ace. (T. Salt @ 743') V set dry hole marker.	Bond No. on file a multiple comp Il requirements, 	e with BLM/BIA letion or recomp including reclar Spot 25 sx Cl H @ 1855', B. S e. Title Production Date	A. Required for the second sec	ired subsequent rep in a new interval, a have been complet 7988'-7825'. (Per 1770')	fs @ 8038	e filed within 30 days f -4 must be filed once to operator has detennined ')	ollowing sting has been	

.

(Instructions on	page 2)
------------------	---------

#### **GENERAL INSTRUCTIONS**

This form is designed for submitting proposals to perform certain well operations and reports of such operations when completed as indicated on Federal and Indian lands pursuant to applicable Federal law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local area or regional procedures and practices, are either shown below, will be issued by or may be obtained from the local Federal office.

#### SPECIFIC INSTRUCTIONS

*Item 4* - Locations on Federal or Indian land should be described in accordance with Federal requirements. Consult the local Federal office for specific instructions.

*Item 13:* Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by the local Federal office. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to the top of any tubing left in the hole; method of closing top of well and date well site conditioned for final inspection looking for approval of the abandonment. If the proposal will involve hydraulic fracturing operations, you must comply with 43 CFR 3162.3-3, including providing information about the protection of usable water. Operators should provide the best available information about all formations containing water and their depths. This information could include data and interpretation of resistivity logs run on nearby wells. Information may also be obtained from state or tribal regulatory agencies and from local BLM offices.

#### NOTICES

The privacy Act of 1974 and the regulation in 43 CFR 2.48(d) provide that you be furnished the following information in connection with information required by this application.

AUTHORITY: 30 U.S.C. 181 et seq., 351 et seq., 25 U.S.C. 396; 43 CFR 3160.

PRINCIPAL PURPOSE: The information is used to: (1) Evaluate, when appropriate, approve applications, and report completion of subsequent well operations, on a Federal or Indian lease; and (2) document for administrative use, information for the management, disposal and use of National Resource lands and resources, such as: (a) evaluating the equipment and procedures to be used during a proposed subsequent well operation and reviewing the completed well operations for compliance with the approved plan; (b) requesting and granting approval to perform those actions covered by 43 CFR 3162.3-2, 3162.3-3, and 3162.3-4; (c) reporting the beginning or resumption of production, as required by 43 CFR 3162.4-1(c)and (d) analyzing future applications to drill or modify operations in light of data obtained and methods used.

ROUTINE USES: Information from the record and/or the record will be transferred to appropriate Federal, State, local or foreign agencies, when relevant to civil, criminal or regulatory investigations or prosecutions in connection with congressional inquiries or to consumer reporting agencies to facilitate collection of debts owed the Government.

EFFECT OF NOT PROVIDING THE INFORMATION: Filing of this notice and report and disclosure of the information is mandatory for those subsequent well operations specified in 43 CFR 3162.3-2, 3162.3-3, 3162.3-4.

The Paperwork Reduction Act of 1995 requires us to inform you that:


The BLM collects this information to evaluate proposed and/or completed subsequent well operations on Federal or Indian oil and gas leases.

Response to this request is mandatory.

The BLM would like you to know that you do not have to respond to this or any other Federal agency-sponsored information collection unless it displays a currently valid OMB control number.

**BURDEN HOURS STATEMENT:** Public reporting burden for this form is estimated to average 8 hours per response, including the time for reviewing instructions, gathering and maintaining data, and completing and reviewing the form. Direct comments regarding the burden estimate or any other aspect of this form to U.S. Department of the Interior, Bureau of Land Management (1004-0137), Bureau Information Collection Clearance Officer (WO-630), 1849 C St., N.W., Mail Stop 401 LS, Washington, D.C. 20240

WP)	X ENERG	Y PERM		LLC					
Well Name: ALLIED 7 FED 2		Field:	Hack	berry	Nortl	1			
Location: 660 FNL 760 FEL SEC 7-T18S-R31E	3	County	: Edd	у		S	tate: Nev	v Mexico	
Elevation: 3659' GL		Spud D	Date: <mark>!</mark>	5/22/:	1988	Compl Dat	:e: <mark>7/23</mark>	/1988	
API#: 30-015-25902 Prepared by: Jeff Young		Date:	6/21/2	23		Rev:			
CURRENT WELLBORE     15 1/4" Hole     11-3/4", 42# @ 660'     Cmt'd w/950 sx to surface									
10-5/8" Hole <u>8-5/8", 24# K-55 @ 2500'</u> Cmt'd w/550 sx to surface									
						Tubing De	tail		
	<b>F</b>			Tubing Compo	onents	Tubing De 2 7/8 6.5# TAC @ 81	N-80 @ 83 37'		Top (TV  8tm (ttx8)
<u>Perforations: (Bone Springs)</u> 8038-8340'	305.50%		CALCULAR ST	TBG tem Description TAC W/45K SH tem Description TBG tem Description	EAR	Equipment Type 0 5 Equipment Type 0 2	17/8   6.50   N-80     D (In)   WI (Ibit)   Grade     1/2   D (In)   WI (Ibit)   Grade     D (In)   WI (Ibit)   Grade   Grade     D (In)   WI (Ibit)   Grade   Grade     VII (Ibit)   Grade   N-80   N-80	Largh (ft) Jonts Top (ft/G) 8,136,8 267 0.0 5 Largh (ft) Jonts Top (ft/G) 3,00 1 8,136,9 Largh (ft) Jonts Top (ft/G) 183,09 6 8,139,9 Largh (ft) Jonts Top (ft/G)	Top (TV Btm (ttK5) 8,139.9 Top (TV Btm (ttK5) 8,322.9 Top (TV Btm (ttK5)
7 7/8" HOLE <u>5 1/2" 17# K-55 @ 8615'</u> Cmt'd w/1570 sx to surface	861	5' TVD	100 - 2015 - 2015 - 2015 - 2015 - 2015 - 2015 - 2015 - 2015 - 2015 - 2015 - 2015 - 2015 - 2015 - 2015 - 2015 - 2015	PUP JNT(S) Item Description SN (CUP TYPE Item Description PERF SUB Item Description MUD ANCHOR	)	Equipment Type 0 2 Equipment Type 0 2 Equipment Type 0	D (in) Wt (lbtt) Grade 778 Vt (lbtt) Grade 778 O (in) Wt (lbtt) Grade 778 O (in) Wt (lbtt) Grade 778 Grade 778 Grade 778 Grade	4.00 1 8,322.9 Length (th) Joint Top (th/dis) 1.10 1 8,326.9 Length (th) Joint Top (th/dis) 4.00 1 8,328.0 Length (th) Joints Top (th/dis) 31.00 1 8,332.0	8,326.9 Top (TV Btm (tKB) 8,328.0 Top (TV Btm (tKB) 8,332.0 Top (TV Btm (tKB)

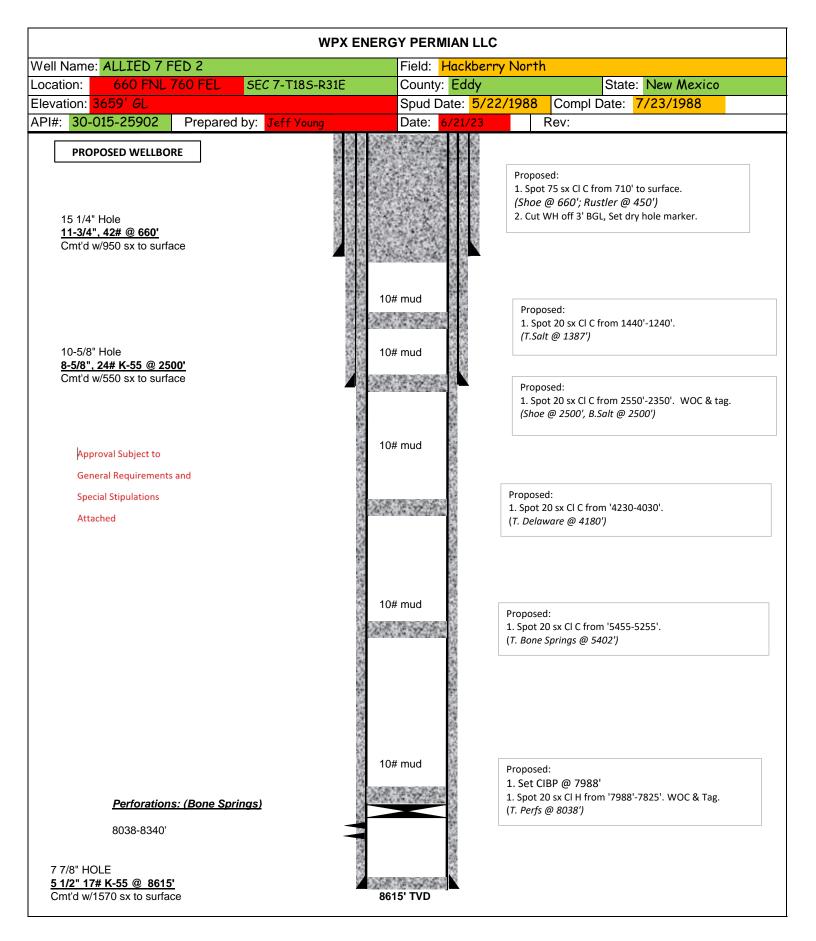

## BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

## Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-689-5981.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.** 

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Below Ground Level Cap (Lesser Prairie-Chicken Habitat)</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the <b>BLM is to be contacted with justification to receive an extension for completing the cut off.** Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least <sup>1</sup>/<sub>4</sub> inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>**Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u></u> From March 1<sup>st</sup> through June 15<sup>th</sup> annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted</u>** 



# **United States Department of the Interior**

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

#### **Reclamation Objectives and Procedures**

**Reclamation Objective:** Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any/all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip (across the slope and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech/Environmental Protection Specialist 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan Environmental Protection Specialist 575-234-5987

Jose Martinez-Colon Environmental Protection Specialist 575-234-5951

Mark Mattozzi Environmental Protection Specialist 575-234-5713

Robert Duenas Environmental Protection Specialist 575-234-2229

•

Sundry ID	2737287			1			
Plug Type	Тор	Bottom	Length	Tag	Sacks	Cement Class	Notes
Surface Plug	0.00	100.00	100.00	Tag/Verify			
Shoe Plug	603.40			Tag/Verify			
Top of Salt @ 743 Base of Salt @ 1770	685.57 1702.30	793.00	107.43	Tag/Verify Tag/Verify	79.00	с	Spot cement from 793' to surface. Verify at surface
				If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio			Spot cement from 1905' to 1702'.
Yates @ 1855	1786.45	1905.00	118.55	ns	25.00	С	WOC and Tag Spot cement from
Shoe Plug	2425.00	2550.00	125.00	Tag/Verify	25.00	с	2550' to 2425'. WOC and Tag.
				If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio			Spot cement from
Capitan Reef @ 3640	3553.60	3690.00	136.40		25.00	С	3690' to 3553'.

•

				If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio			Spot cement from
Delaware @ 4232	4139.68	4282.00	142.32	ns	25.00	С	4282' to 4139'.
Bonesprings @ 5388	5284.12	5438.00		If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio ns	25.00	C	Spot cement from 5438' to 5284'.
CIBP Plug	7953.00	7988.00		If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio ns	25.00	Н	Set CIBP at 7988'. Leak Test CIBP. Spot 25 sacks on top.
Perforations Plug (If No CIBP)		8390.00	402.00	ns Tag/Verify	25.00	11	ιυμ.
Perforations Plug (If No CIBP)	7988.00	8390.00	402.00	Tag/Verify			

•

Shoe Plug	8478.85	8665.00	186.15	Tag/Verify		

No more than 2000' is to be allowed between plugs in open hole, and no more than 3000' between plugs in cased hole.

Class H >7500'

Class C<7500'

Fluid used to mix the cement in R111P shall be saturated with the salts common to the section penetrated, and in suitable proportions, but not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

Medium, Secretary: Top of salt to surface If no salt take the deepest fresh water or Karst Depth

High, Critical: Bottom of Karst to surface or Deepest fresh water, whichever is greater R111P: 50 Feet from Base of Salt to surface.

Class C: 1.32 ft<sup>3</sup>/sx Class H: 1.06 ft<sup>3</sup>/sx

Onshore Order 2.III.G Drilling Abandonment Requirements: "All formations bearing usable-quality water, oil, gas, or geothermal resources, and/or a prospectively valuable deposit of minerals shall be protected.

Cave Karst/Potash Cement	Low		
Shoe @ Shoe @	660.00 2500.00		
Shoe @	8615.00		
Perforatons Top @	8038.00	Perforations	8340.00

CIBP @ 7988.00

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3470 Fax: (505) 476-3462

# **State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. Santa Fe, NM 87505

#### CONDITIONS

Operator:	OGRID:
DEVON ENERGY PRODUCTION COMPANY, LP	6137
333 West Sheridan Ave.	Action Number:
Oklahoma City, OK 73102	243765
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

#### CONDITIONS

Created By	Condition	Condition Date
john.harrison	Accepted for record - NMOCD JRH 7/25/23. BLM approved P&A 7/24/23	7/25/2023

Page 15 of 15