
Received by Coppe Applicate Bistoid 3 PM Office District 1 - (575) 393-6161 State of New Mexico Energy, Minerals and Natural Resources	Form Page 3 of 19 Revised July 18, 2013
1625 N. French Dr., Hobbs, NM 88240	WELL API NO.
District II - (575) 748-1283 811 S. First St., Artesia, NM 88210 OIL CONSERVATION DIVISION	30-025-42283 5. Indicate Type of Lease
District III - (505) 334-6178 1220 South St. Francis Dr. 1000 Rio Brazos Rd., Aztec, NM 87410	STATE FEE
District IV - (505) 476-3460 Santa Fe, NM 8/505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505	
SUNDRY NOTICES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH	CEA CNAKE 35 CTATE
PROPOSALS.)	SEA SNAKE 35 STATE 8. Well Number
1. Type of Well: Oil Well Gas Well Other	3H
2. Name of Operator	9. OGRID Number
Devon Energy Production Company, LP	6137
3. Address of Operator 333 W. Sheridan Avenue, Oklahoma City, OK 73102	10. Pool name or Wildcat 2nd Bone Springs Sand
	Zild Bolle Springs Sand
4. Well Location Unit Letter Co. 200 feet from the South Line and 2122 feet from the South Line and 2122	om the East line
Unit Letter O :200 feet from the South line and 2132 feet from Section 35 Township 23S Range 33E	om theEastline NMPM Lea County, NM
11. Elevation (Show whether DR, RKB, RT, GR, etc.,	
3647' GL	
12. Check Appropriate Box to Indicate Nature of Notice, NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRI PULL OR ALTER CASING MULTIPLE COMPL CASING/CEMENT DOWNHOLE COMMINGLE OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Corproposed completion or recompletion.	SEQUENT REPORT OF: ALTERING CASING LLING OPNS. P AND A JOB digive pertinent dates, including estimated date
1. See Attached	
S. J. D. L.	
Spud Date: Rig Release Date:	
I hereby certify that the information above is true and complete to the best of my knowledge SIGNATURE TITLE Production	
Type or print nameJeff_Young E-mail address:Jeff.Young@dvn.com	PHONE: 405-228-2480
For State Use Only	1110112
	- 4/40/04
APPROVED BY: TITLE Compliance Officer A Conditions of Approval (if any):	DATE 1/16/24

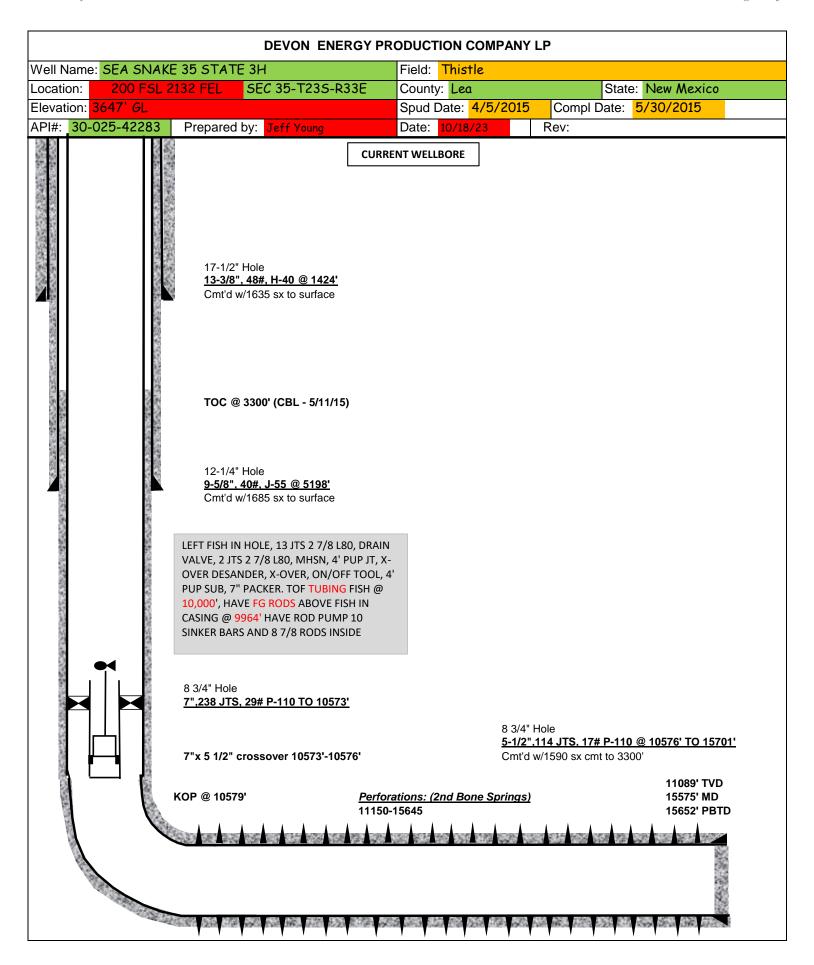

Page 3 of 19 DELAWARE BASIN UNRESTRICTED

Report Printed: 1/4/2024

Operation Summary (Ascending)

OH - Property #: 38212

Well Name: SEA SNAKE 35 STATE 3H

		SEA	SNAKE 35							
Sub-Divis	sion VARE B	ASIN	Reg DF	ion LAWARE BASIN	FAST	Field Name THISTLE		County LEA	State/Provinc	ce
Surface L	egal Local			API/UWI	L/101	Latitude (°)	Longitude (°)	Orig KB Elevatio	n (ft) Ground Elevation (ft)	KB - GL (ft)
35-235		/FD D	FOTODE DDG	3002542283	0/0/0000	32° 15' 15.941" N	103° 32' 29.404" W	3,672.00	3,647.00	25.00
Job: V Job Cate		VER - R	ESTORE PRO	Primary Job Typ		05:00	Secondary Job Type		Status 1	
	OVER			RESTORE		OD PUMP	TUBING REPAIR		ABANDON JOB	
WBS Nu	mber 55247.01	I \\\\\\			Job Start	t Date 23 05:00		Job End Date 5/18/2023 05	5:00	
Objective		1.0000			2/0/20	23 03.00		3/16/2023 03	5.00	
		HOLE II	N TUBING							
Summary ABANI		FISHIN	G JOB. FISH L	EFT IN HOLE.						
	or, Rig Nan					Rig Number	Rig Type			
AXL E	NERGY	INC DB	A 55 WELL SE	ERVICE		57	WO/CC	MP/PU-ONSHO	RE	
Rpt# 1	, 2/6/20	23 05:0	0 - 2/7/2023 05	5:00						
	Summary		/RODS PUMP							
Start	End	T T	KODS POWE							
Time	Time 10:00	Dur (hr)	Ops Status ACTIVE	Operation SHUTDOWN	SI		Description			NPT
05:00 10:00	10:30		ACTIVE	SAFETY	PJSM					
10:30	12:30		ACTIVE	RIGU		SU AND REV UNIT	•			
12:30	13:30		ACTIVE	PCHECK			PIT OFF 1" CHOKE OPE	N @100% PSI D	OWN TO 0 IN 5 MIN.	
							OF 2% KCL/BIO, PSI UP 5			
13:30	16:30	3.00	ACTIVE	PULCOM		,	D HH, LD PR, NU ROD ST	,		
							RIED PARTING SHEAR T WELL SD. TRY AGAIN W		INSTALL PRAIND	
16:30	05:00	12.50	ACTIVE	SHUTDOWN	SI	,				
Davis o	012100	00.05.0	0.000000							
	2, 2/7/20: Summary	∠3 05:0	0 - 2/8/2023 05	5:00						
SI FOR	R DEVÓ	N MEET	TING							
Start Time	End Time	Dur (hr)	Ops Status	Operation			Description			NPT
05:00	06:30	. ,	ACTIVE	SHUTDOWN	SI		2 2 2 2 3 7 4 2 1			
06:30	14:30		ACTIVE	SAFETY	STAND	BY				
14:30	05:00	14.50	ACTIVE	SHUTDOWN	SI					
Rpt# 3	. 2/8/20	23 05:0	0 - 2/9/2023 05	5:00						
24 Hour	Summary									
Start	OFF RO	DDS NU	ROb							
Time	Time	Dur (hr)	Ops Status	Operation			Description			NPT
05:00	06:30		ACTIVE	SHUTDOWN	SI					
06:30 07:00	07:00 07:30		ACTIVE ACTIVE	SAFETY	PJSM	CSID 100 BI ED DO	WN TO PIT OFF 1" CHO	∕E ODEN ⊜100		
07.00	07.30	0.50	ACTIVE	PUREUK	10 MIN.		WIN TO PIT OFF T CHOI	NE OPEN @100	% PSI DOWN TO 0 IN	
07:30	10:30	3.00	ACTIVE	PULCOM	LD PR, I	NU ROD STRIPPE	R, WORKED STUCK PUM	P AND TRIED TO	O PART SHEAR TOOL,	
					NO LUC	CK, TRIED BACK O	F RODS, BACKED OFF 1	10 -1 1/4 FG ROI	DS.	
10:30	12:30		ACTIVE	BOPS		,	WH, NU BOP, RU WORK			
12:30	16:30	4.00	ACTIVE	TRIP OUT			ELT LIKE PACKER WAS JT, PU ON TUBING AGAIN			
							R, TRIED TO LATCH BACK	,		
						8 L80 UP TO ROD E	BREAK, LD 10 MORE 1 1/	4 FG RODS, SE	CURE WELL SDON.	
16:30	05:00	12.50	ACTIVE	SHUTDOWN	SI					
Rpt# 4	, 2/9/20	23 05:0	0 - 2/10/2023 (05:00						
24 Hour	Summary									
STRIP	WELL (001								
Time	Time	Dur (hr)	Ops Status	Operation			Description			NPT
05:00	06:30		ACTIVE	SHUTDOWN	SI					
06:30 07:00	07:00 07:30		ACTIVE ACTIVE	SAFETY	PJSM TSIP 0,	CSIP 0				
07:30	14:30		ACTIVE	TRIP OUT	· '		OH WITH 10 JTS UP TO F	ROD BREAK ID	18 -1 1/4 FG RODS	
		55			PULL 20	MORE JTS, TO R	OD BREAK, PULLED ON	ROD STRING FI	NALLY UNSIT PUMP	
						,	NG UP, FELT LIKE PARAF OT OIL TRUCK, COULDN'	*	•	
						CURE WELL SDFN		I GET ONE TIL	- MORNING. INSTALL	
14:30	05:00	14.50	ACTIVE	SHUTDOWN	SI					
David -	014010	000.0-	00 0/44/0000	05.00						
•	5, 2/10/2	∪∠3 U5:	00 - 2/11/2023	U5:UU						
HOT V	VATEŔ '	TBG AN	D RODS, STR	RIP OUT						
Start Time	End Time	Dur (hr)	Ops Status	Operation			Description			NPT
05:00	06:30		ACTIVE	SHUTDOWN	SI		Doscription			
06:30	07:00		ACTIVE	SAFETY	PJSM					
07:00	07:30		ACTIVE	PCHECK	TSIP 0,					
07:30	16:00	8.50	ACTIVE	TRIP OUT			ASING, HOT WATER 120			
							BARREL OF XYLENE DO 2% KCL/BIO, RD TRUCK,			
					PUMP H	HUNG UP, TRIED TO	O WORK IT FREE, RODS	PARTED AT SUI	RFACE, FELL TO	
							6, RODS WAS STILL INSII E WELL SDON. WILL RUN			
					FG ROD		THE TOTAL TRUIT		JOE II TAIN. TO FIGHT	
16:00	05:00	13.00	ACTIVE	SHUTDOWN	SI					
Dot# 0	2/44/2	022.05.	00 - 2/42/2022	05:00						
24 Hour	Summary		00 - 2/12/2023	00.00						
TIH W	/FISHIN	G TOOL	-							
Start Time	End Time	Dur (hr)	Ops Status	Operation			Description			NPT
05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI					
06:30			ACTIVE	SAFETY	PJSM	0010.0				
07:00	07:30	0.50	ACTIVE	PCHECK	TSIP 0,					
						Pac	ne 1/16		Report Prin	ted: 1/4/2024

Page 1/16

devon

Operation Summary (Ascending)

OH - Property #: 38212

W/AII	Nama	C = V	GNIVKE	35 6	STATE 3H

		SEA	SNAKE 35 S		Field Name		I Court	Iour io	
	VARE B		Regio DEL	AWARE BASIN	Field Name THISTLE		County LEA	State/Provir NM	
Surface L 35-23S	egal Locat	ion		API/UWI 3002542283	Latitude (°) Longitud 32° 15' 15.941" N 103° 3	de (°) 32' 29.404" W	Orig KB Elevation (ft) 3,672.00	Ground Elevation (ft) 3,647.00	KB - GL (ft) 25.00
Start Time	End Time	Dur (hr)	Ops Status	Operation	152 10 10.011 11 1100 0	Description	1-,	1-,	NPT
07:30	11:30		ACTIVE ACTIVE	RUNCOM	SUPER ROD BROUGHT OUT A FISHIN		H FG RODS, BUT	COULDN'T USE	NPI
					IT CAUSE THE PARTED ROD WAS A G TOOLS, PEAK WAS GOING TO GATHE SECURE WELL SDFW.				
11:30	05:00	17.50	ACTIVE	SHUTDOWN	SI				
Rpt# 7	, 2/13/2	023 05:0	00 - 2/14/2023	05:00					
24 Hour S		G TOOL							
Start	End					5			LIDT
Time 05:00	Time 06:30	Dur (hr) 1.50	Ops Status ACTIVE	Operation SHUTDOWN	SI	Description			NPT
06:30	07:00		ACTIVE	SAFETY	PJSM				
07:00 07:30	07:30 15:30		ACTIVE ACTIVE	PCHECK RUNCOM	TSIP 0	NC TOOL WAS	MISSING A V OVE	ED TO DUN	
07.30	15.50	8.00	ACTIVE	RUNCUM	ABOUT TO TIH WITH BANNING FISHIN WAITED ON PEAK TO BRING OUT RIG PU RODS AND TAG TOP OF FG RODS AS TOP OF THE RODS AS INSIDE THE TUBING, GOING TO PULL WL RUN LEAD BLOCK TO TAG THE TOSDON.	GHT X-OVER, ST 5, PU 120 -1" RO AND TUBING PA . RODS AND TUI	TILL DIDN'T WORI DS 3000' DIDN'T 1 RTED, WE DON'T BING OUT IN MOF	K, DECIDED TO FAG, HAD LD 39 HAVE RODS RNING AND RU	
15:30	05:00	13.50	ACTIVE	SHUTDOWN	SI				
24 Hour S	Summary		00 - 2/15/2023	05:00					
POOH Start	W/ROD End	S AND	TBG						
Time	Time	Dur (hr)	Ops Status ACTIVE	Operation SHUTDOWN	QI .	Description			NPT
	06:30 07:00		ACTIVE	SAFETY	SI PJSM				
07:00	07:30	0.50	ACTIVE	PCHECK	TSIP 0, CSIP 0				
07:30 10:30	10:30 14:00		ACTIVE ACTIVE	PULCOM TRIP OUT	POOH WITH 120 -1" RODS, CHANGE F FUNCTION TEST BOP, POOH WITH A			ET DICK LID	
	05:00		ACTIVE	SHUTDOWN	SECURE WELL SDON. SI	COUPLE OF STA	ANDS, WIND GUS	ST PICK UP,	
			00 - 2/16/2023	05:00					
24 Hour S	Summary			W/FISHING TO	OL				
Start	End Time				<u></u>	Description			NPT
Time 05:00	06:30	1.50	Ops Status ACTIVE	Operation SHUTDOWN	SI	Description			INFI
	07:00		ACTIVE	SAFETY	PJSM				
	07:30 10:30		ACTIVE ACTIVE	PCHECK TRIP OUT	TSIP 0, CSIP 0 FUNCTION TEST BOP, POOH WITH 13 THE BOTTOM OF STRING.	37 JTS 2 7/8 L80	, CAME OUT WITI	H COLLAR ON	
10:30	12:00	1.50	ACTIVE	WIRELINE	RU WL, TIH WITH 6" LEAD BLOCK, TA BLOCK HAD A SMALL PRINT IN THE C	ENTER, LOOKS	TO BE A ROD.		
12:00	14:00	2.00	ACTIVE	TRIP IN	TIH WITH 5 3/4 MOUSE TRAP, TAG RC OF TUBING FISH @4522', PICKED UP TIMES, POOH WITH 20 STANDS, WINI	COULDN'T FEE	L IT BITE, WORKE	ED IT A FEW	
14:00	05:00	15.00	ACTIVE	SHUTDOWN	SI				
_ •	•	2023 05	:00 - 2/17/2023	3 05:00					
24 Hour S POOH	Summary W/FISH	IING TO	OL, LD PROD	TBG					
Start Time	End Time	Dur (hr)	Ops Status	Operation		Description			NPT
05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI	Doodiption			INI I
	07:00		ACTIVE	SAFETY	PJSM				
07:00 07:30	07:30 09:30		ACTIVE ACTIVE	PCHECK TRIP OUT	TSIP 0, CSIP 0 FUNCTION TEST BOP, CONTINUE PO	OH WITH TBG 9	8 JTS, TOTAL OF	138 JTS AND LD	
					MOUSE TRAP.		•		
09:30 11:30	11:30 15:30		ACTIVE ACTIVE	TRIP IN TRIP OUT	TIH WITH 138 JTS PRODUCTION STR POOH LD TUBING 138 JTS., MOVED C AND 2 7/8 PH6 WS ON RACKS AND TA	OFF PRODUCTION			
15:30	05:00	13.50	ACTIVE	SHUTDOWN	SI				
Rpt# 1	1, 2/17/:	2023 05	:00 - 2/18/2023	3 05:00					
24 Hour S TIH W/	Summary SHOE,		DLLAR, FISH J						
Start Time	End Time	Dur (hr)	Ops Status	Operation		Description			NPT
	06:30		ACTIVE	SHUTDOWN	SI				
	07:00 07:30		ACTIVE ACTIVE	SAFETY PCHECK	PJSM TSIP 0, CSIP 0				
07:30	15:00		ACTIVE	TRIP IN	FUNCTION TEST BOP, TIH WITH 6" SH PU 143 JTS OF 2 7/8 PH6 WS OF RAC WASH OVER DOWN TAG COLLAR @4	KS, TAG TOF TU	JBÍNG @4506' RU	POWER SWIVEL	
	17:00		ACTIVE	TRIP OUT	RD SWIVEL, POOH WITH 143 JTS OF WITH 6" SHOE, SECURE WELL SDON	2 7/8 PH6 WS, 1			
17:00	05:00	12.00	ACTIVE	SHUTDOWN	SI				
		2023 05	:00 - 2/19/2023	05:00					
24 Hour S TIH W/		H TBG	JT, POOH, TIH	W/MOUSE TRA					
Start Time	End Time	Dur (hr)	Ops Status	Operation		Description			NPT
05:00	06:30	1.50	ACTIVE	SHUTDOWN					
06:30	07:00	0.50	ACTIVE	SAFETY	PJSM				

Page 2/16

Operation Summary (Ascending)

OH - Property #: 38212

Well Name: SEA SNAKE 35 STATE 3H

Sub-Divis		ASIN	Regio DEI	on _AWARE BASIN	EAST	Field Name THISTLE		County LEA	State/ NM	Provinc	ce
Surface L 35-23S	egal Locat 3-33E	tion		API/UWI 3002542283		atitude (°) 2° 15' 15.941" N		Orig KB Elevation (ft) 3,672.00	Ground Elevation (3,647.00		KB - GL (ft) 25.00
Start End Time Time Dur (hr) Ops Status Operation						Description					NPT
07:00	07:30	0.50	ACTIVE	PCHECK	CSIP 0						
07:30	09:30	2.00	ACTIVE			1 JT 2 7/8 L80, X-OV	OVER SIZED GUIDE, 4 ER, 143 JTS OF 2 7/8 P			6',	
09:30	12:30	3.00	ACTIVE	TRIP OUT	POOH WIT	H 2 7/8 WS AND OS,	LD FISH 1 JT 2 7/8 L80				
12:30	16:30	4.00	ACTIVE		RAN TOOL	DOWN 4538' PUMPE	2 JTS 2 7/8 L80, X -OVE ED DOWN TUBING 30 E 7 TIMES, ,LD 2 JTS, SEC	BLS, PU ON TUBI	NG DIDN'T FE	EL	
16:30	05:00	12.50	ACTIVE	SHUTDOWN	SI						

Rpt# 13, 2/20/2023 05:00 - 2/21/2023 05:00

WL, POOH W/MOUSE TRAP, TIH W/OS

Start Time	End Time	Dur (hr)	Ops Status	Operation	Description	NPT
05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI	
06:30	07:00	0.50	ACTIVE	SAFETY	PJSM	
07:00	07:30	0.50	ACTIVE	PCHECK	TSIP 0, CSIP 0	
07:30	09:00	1.50	ACTIVE	WIRELINE	FUNCTION TEST BOP, RAN MOUSE TRAP BACK DOWN TO TOP OF TUBING FISH @4538', RU WL, TIH WITH 2 1/8 GAUGE RING, WENT DOWN TO TOP OF MOUSE TRAP FISHING TOOL, TAG 4537', NO RODS INSIDE TUBING, RD WL.	
09:00	11:30	2.50	ACTIVE	TRIP OUT	POOH 143 JTS 2 7/8 PH6 WS, X-OVER, 2 JTS L80, 5 3/4 MOUSE TRAP.	
11:30	14:00	2.50	ACTIVE	TRIP IN	TIH WITH 4 11/16 OS W/2 7/8 GRAPPLE, 2 JTS 2 7/8 L80, 2 7/8 HILLSIDE SUB, X-OVER, 143 JTS OF 2 7/8 PH6 WS, TAG TOF TUBING FISH @4538', LATCH ON TO FISH, PU ON STRING TUBING WAS PARTED GAIN 6 PTS.	
14:00	16:30	2.50	ACTIVE	TRIP OUT	POOH WITH 143 JTS 2 7/8 PH6 WS, X-OVER, HILLSIDE SUB, 2 JTS 2 7/8 L80, 4 11/16 OS WITH 2 7/8 GRAPPLE, FISH OUT 23 JTS OF 2 7/8 L80, CAME OUT WITH PIN, COLLARS WORE DOWN, HAVE MARKS LAST JT, LOOKS LIKE HAD TUBING BESIDE EACH OTHER., SECURE WELL SDON.	
16:30	05:00	12.50	ACTIVE	SHUTDOWN	SI	

Rpt# 14, 2/21/2023 05:00 - 2/22/2023 05:00

WL TAG, TIH W/SHOE

Start Time	End Time	Dur (hr)	Ops Status	Operation	Description	NPT
05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI	
06:30	07:00	0.50	ACTIVE	SAFETY	PJSM	
07:00	07:30	0.50	ACTIVE	PCHECK	TSIP 0, CSIP 0	
07:30	14:30	7.00	ACTIVE	WIRELINE	FUNCTION TEST BOP, RU WL TIH WITH 6" LEAD BLOCK, TAG @5233', TOP OF TUBING FISH @5294' POOH W/LEAD BLOCK,DIDN'T HAVE A GOOD PIC ON WHAT IT TAGGED, HAVE ALOT OF DEBRI ON TOF, COLD CALL TO GET A SHOE BUILT 6" OD WITH WIRES AND DIAMOND INSIDE, WAITED FOR SHOE ABOUT 2. WAS TOLD SHOE WONT BE ON LOC TILL AFTERNOON, SECURE WELL SDON.	
14:30	05:00	14 50	ACTIVE	SHUTDOWN	lsi	

Rpt# 15, 2/22/2023 05:00 - 2/23/2023 05:00

TIH W/SHOE

	_					
Start	End					
Time	Time	Dur (hr)	Ops Status	Operation	Description	NPT
05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI	
06:30	07:00	0.50	ACTIVE	SAFETY	PJSM	
07:00	07:30	0.50	ACTIVE	PCHECK	TSIP 0, CSIP 0	
07:30	08:30	1.00	ACTIVE	TRIP IN	FUNCTION TEST BOP, ATTEMPT TO TIH W/SHOE AND WP, WINDS STARTED GUSTING	
					HARD, SECURE WELL SDON.	
08:30	05:00	20.50	ACTIVE	SHUTDOWN	si	

Rpt# 16, 2/23/2023 05:00 - 2/24/2023 05:00

24 Hour Summary

WASH	OVER	FISH, P	ООН			
Start	End	_ "				
Time	Time	Dur (hr)	Ops Status	Operation	Description	NPT
05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI	
06:30	07:00	0.50	ACTIVE	SAFETY	PJSM	
07:00	07:30	0.50	ACTIVE	PCHECK	TSIP 0, CSIP 0	
07:30	15:00	7.50	ACTIVE	TRIP IN	FUNCTION TEST BOP, TIH WITH 5 3/4 SHOE W/6" CROWN, HAVE WIRES AND DIAMOND IN SHOE, 2 JTS 5 3/4 WP, 5 3/4 X 2 7/8 IF TOP BUSHING, 4 1/4 JARS, 2 7/8 PH6 WS TAG @5250' W/15' OUT ON THE 164 JT, RU SWIVEL AND TUBING STRIPPER, WASH DOWN	
					OVER TOP TUBING FISH @5294', DOWN TO 5328' W/166 JTS, BOTTOM OUT ON WP TOP BUSHING, DIDN'T REALLY TAG ANYTHING SOLID WASHING OVER.	
15:00	17:00	2.00	ACTIVE	TRIP OUT	RD POWER SWIVEL, POOH WITH 60 JTS, SECURE WELL SDON.	
17:00	05:00	12.00	ACTIVE	SHUTDOWN	SI	

Rpt# 17, 2/24/2023 05:00 - 2/25/2023 05:00

POOH W/SHOE, TIH OS, POOH OS

Start Time	End Time	Dur (hr)	Ops Status	Operation	Description	NPT
05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI	
06:30	07:00	0.50	ACTIVE	SAFETY	PJSM	
07:00	07:30	0.50	ACTIVE	PCHECK	TSIP 0, CSIP 0	
07:30	09:30	2.00	ACTIVE	TRIP OUT	FUNCTION TEST BOP, CONTINUE POOH WITH 106 JTS 2 7/8 PH6 WS, TOP BUSHING, 2 JTS 5 3/4 WP AND SHOE, WIRES WERE GONE FROM INSIDE SHOE HAD NOTHING INSIDE WP.	
09:30	14:00	4.50	ACTIVE		TIH WITH 4 11/16 OS W/3 21/32 GRAPPLE, 2 JTS 2 7/8 L80, HILLSIDE SUB, X-OVER, 165 JTS PH6 WS, TAG TOF @5260', LATCH ON TO FISH, RU WL FOR OUTSIDE BACK OFF, WENT THRU MOTION MAKING SURE TUBING STRING CONNECTION WAS TIGHT, ROTATED TO RIGHT, FELT TUBING STRING COME FREE, GAIN 2 PTS ON WEIGHT SCALE, RD WL.	

Operation Summary (Ascending)

OH - Property #: 38212

Mall Manas	C .	CNIAICE	OF OTATE	211
Well Name:	SEA	SNAKE	35 SIAIE	ЗĦ

Well I	Name:	SEA	SNAKE 35	STATE 3H							
Sub-Divis		ASIN	Reg DE	ion LAWARE BASIN	EAST	Field Name THISTLE		County LEA	State/Provi	nce	
	Surface Legal Location API/UWI 35-23S-33E 300254228					_atitude (°) 32° 15' 15.941" N	Longitude (°) 103° 32' 29.404" W	Orig KB Elevation (ft) 3,672.00	Ground Elevation (ft) 3,647.00	KB - GL (ft) 25.00	
Start Time	End Time	Dur (hr)	Ops Status	Operation			Description			NPT	
14:00											
17:00	05:00	12.00	ACTIVE	SHUTDOWN	SI						
Rpt# 1	8, 2/25/	2023 05	:00 - 2/26/202	3 05:00							
24 Hour Summary FISHING											
Start Time	End Time	Dur (hr)	Ops Status	Operation			Description			NPT	

1.50 ACTIVE SHUTDOWN 05:00 06:30 06:30 07:00 0.50 ACTIVE SAFETY PJSM 07:00 07:30 0.50 ACTIVE PCHECK TSIP 0, CSIP 0 FUNCTION TEST BOP, RU WL, TIH WITH 6" LEAD BLOCK, TAG @5250', POOH W/LEAD BLOCK, MARKING ON LEAD BLOCK DIDN'T REALLY TELL UP MUCH, RD WL. 07:30 1.50 ACTIVE WIRELINE 09:00 5.00 ACTIVE TRIP IN 09:00 14:00

TIH WITH 5 3/4 MOUSE TRAP, 3 JTS 2 7/8 L80, X-OVER, 166 JTS 2 7/8 PH6 WS, TAG 5338' LATCHED ON TO RODS, WORKED STUCK RODS, FINALLY RODS PARTED, GAIN 4 PTS OF SCALE, ABOUT TO POOH WITH TUBING, CREW INSPECTED TUBING LINE FOUND A FEW SPOTS WITH BROKEN WIRES ON LINE, DECIDED TO SECURE WELL SDON, WILL REPLACE TUBING LINE IN MORNING. 14:00 05:00 15.00 ACTIVE SHUTDOWN SI

Rpt# 19, 2/26/2023 05:00 - 2/27/2023 05:00

FISHING

Start	End					
Time	Time	Dur (hr)	Ops Status	Operation	Description	NPT
05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI	
06:30	07:00	0.50	ACTIVE	SAFETY	PJSM	
07:00	07:30	0.50	ACTIVE	PCHECK	TSIP 0, CSIP 0	
07:30	13:30	6.00	ACTIVE	TRIP OUT	POOH 166 JTS 2 7/8 PH6, X-OVER, 3 JTS 2 7/8 L80, 5 3/4 MOUSE TRAP, FISHED OUT 2 -	
					1 1/4 FG RODS., SECURE WELL SDON.	
13:30	05:00	15.50	ACTIVE	SHUTDOWN	SI	

Rpt# 20, 2/27/2023 05:00 - 2/28/2023 05:00

FISHING

Start	End	5 ")	0 011		5	
Time	Time	Dur (hr)	Ops Status	Operation	Description	NPT
05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI	
06:30	07:00	0.50	ACTIVE	SAFETY	PJSM	
07:00	07:30	0.50	ACTIVE	PCHECK	CSIP 0	
07:30	09:30	2.00	ACTIVE	TRIP IN	FUNCTION TEST BOP, TIH WITH 4 11/16 OS W/3 21/32 GRAPPLE, 2 JTS 2 7/8 L80, HILLSIDE SUB, X-OVER, 166 JTS OF2 7/8 PH6 WS, TAG TOF @5338' COULDN'T GET OVER FISH.	
09:30	11:30	2.00	ACTIVE	TRIP OUT	POOH WITH TUBING HILSIDE SUB AND OS.	
11:30	13:30	2.00	ACTIVE	WIRELINE	RU WL RAN LEAD BLOCK TAG AT 5282' WL DEPTH, POOH W/LEAD BLOCK, HAD MARKING SHOWING RODS., RD WL	
13:30	15:30	2.00	ACTIVE	TRIP IN	TIH WITH 5 3/4 MOUSE TRAP, 3 JTS 2 7/8 L80, X-OVER, 166 JTS 2 7/8 PH6 WS, TAG RODS @5272' RAN TRAP DOWN TO 5304', PU ON TUBING HAD A 4PT OVER PULL AND CAME FREE	
15:30	17:00	1.50	ACTIVE	TRIP OUT	POOH 60 JTS, SECURE WELL SDON.	
17:00	05:00	12.00	ACTIVE	SHUTDOWN	SI	

Rpt# 21, 2/28/2023 05:00 - 3/1/2023 05:00

24 Hour Sumr FISHING

Ī	Start Time	End Time	Dur (hr)	Ops Status	Operation	Description	NPT
ŀ			. ,			'	INF I
	05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI	
	06:30	07:00	0.50	ACTIVE	SAFETY	PJSM	
	07:00	07:30	0.50	ACTIVE	PCHECK	TSIP 0, CSIP 0	
	07:30	09:30	2.00	ACTIVE	TRIP OUT	FUNCTION TEST BOP, CONTINUE TO POOH WITH TUBING AND MOUSE TRAP, HAD NO FISH, HAD SOME FG DEBRI IN TOOL.	
	09:30	11:00	1.50	ACTIVE	BOPS	RD TONGS AND WORK FLOOR, FUNCTION TEST NEW BOP, ND OLD BOP AND NU NEW BOP, CHANGE OUT DUE TO 21 DAYS ON WELL HEAD.	
	11:00	16:30	5.50	ACTIVE	TRIP IN	TIH WITH 5 3/4 SHOE,W/6" CROWN,2 7/8 OD, 2 JTS 5 3/4 WP, TOP BUSHING 167 JTS OF 2 7/8 PH6, RU POWER SWIVEL, TAG @5304' WASH DOWN TO 5336' CUT OUT COLLAR RAN SHOE DOWN TO 5351', RD SWIVEL, LD 2 JTS, SECURE WELL SD.	
	16:30	05:00	12.50	ACTIVE	SHUTDOWN	SI	

Rpt# 22, 3/1/2023 05:00 - 3/2/2023 05:00

24 Hour Summary

OD III	(D IVILL	1110				
Start	End					
Time	Time	Dur (hr)	Ops Status	Operation	Description	NPT
05:00	05:00	24.00	ACTIVE	SHUTDOWN	SI HAD MEETING IN CARLSBAD	

Rpt# 23, 3/2/2023 05:00 - 3/3/2023 05:00

24 Hour Sum FISHING

1 10111	10					
Start	End					
Time	Time	Dur (hr)	Ops Status	Operation	Description	NPT
05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI	
06:30	07:00	0.50	ACTIVE	SAFETY	PJSM	
07:00	07:30	0.50	ACTIVE	PCHECK	TSIP 0, CSIP 0	
07:30	09:30	2.00	ACTIVE	TRIP OUT	FUNCTION TEST BOP, POOH WITH 166 JTS 2 7/8 PH6, TOP BUSHING, 2 JTS -5 34/ WP, AND SHOE 5 3/4 WITH 2 7/8 ID. SHOE HAD SOME WEAR.	
09:30	11:30	2.00	ACTIVE	TRIP IN	TIH WITH 4 11/16 W/5 3/4 GUIDE WITH 2 7/8 GRAPPLE, 152 JTS 2 7/8 PH6 WS, SECURE WELL SDON, DUE TO STRONG WIND.	
11:30	05:00	17.50	ACTIVE	SHUTDOWN	SI	

Page 7 of 19 DELAWARE BASIN UNRESTRICTED

Operation Summary (Ascending)

OH - Property #: 38212

	, OI.	•			On - Property #. 36212	
		SEAS	SNAKE 35 S			
Sub-Divis	ion VARE B	ASIN	Regio DFI	on AWARE BASIN	Field Name County State/Provin EAST THISTLE LEA NM	ice
Surface L	egal Locat			API/UWI	Latitude (°) Longitude (°) Orig KB Elevation (ft) Ground Elevation (ft)	KB - GL (ft)
35-23S		022 0E.	00 - 3/4/2023 0	3002542283	32° 15' 15.941" N 103° 32' 29.404" W 3,672.00 3,647.00	25.00
24 Hour S	•	023 03.0	JU - 3/4/2023 U	5.00		
FISHIN Start	G End					T
Time	Time	Dur (hr)	Ops Status	Operation	Description	NPT
05:00	06:30		ACTIVE	SHUTDOWN	SI	
06:30 07:00	07:00 07:30		ACTIVE ACTIVE	SAFETY	PJSM TSIP 0, CSIP 0	
07:30	12:00		ACTIVE	TRIP IN	FUNCTION TEST BOP, CONTINUE TIH WITH OS, LATCH ON TO FISH @5338', PULL 60	
					OVER ON TUBING STRING WASHED OVER JT WAS STILL ATTACHED, WORK STUCK	
					TUBING ROTATED TO RIGHT, WOULDN'T COME FREE, RU WL RAN GR DOWN TUBING TAG TOP OF RODS @5333, RD WL	
12:00	16:00	4.00	ACTIVE	TRIP OUT	GOT OFF FISH, POOH WITH TUBING AND OS, TIH WITH 4 11/16 OS W/2 7/8 GRAPPLE, 2	
					JTS 2 7/8 L80, HILLSIDE SUB, RAN 100 JTS, SECURE WELL SDON.	
16:00	05:00	13.00	ACTIVE	SHUTDOWN	SI	
Rpt# 2	5, 3/4/2	023 05:0	00 - 3/5/2023 0	5:00		
24 Hour S						
Start	End					
Time 05:00	Time 06:30	Dur (hr)	Ops Status ACTIVE	Operation SHUTDOWN	Description SI	NPT
06:30	07:00		ACTIVE	SAFETY	PJSM	
07:00	07:30		ACTIVE	PCHECK	TSIP 0, CSIP 0	
07:30	09:30	2.00	ACTIVE	TRIP IN	FUNCTION TEST BOP, CONTINUE TIH WITH OS WITH HILLSIDE SUB, LATCH ON TO	
09:30	12:00	2.50	ACTIVE	WIRELINE	TUBING FISH @5338'. RU WL, RAN IN WITH STRING SHOT, DOWN TO 5600 TO 5655', DID A OUTSIDE SHOT	
09.30	12.00	2.30	ACTIVE	VVIIVELIIVE	BACK OFF, RD WL	
12:00	15:00	3.00	ACTIVE	TRIP OUT	POOH WITH TUBING 166 JTS 2 7/8 PH6 WS, HILLSIDE SUB, 2 JTS 2 7/8 L80, 4 11/16 OS	
					W/2 7/8 GRAPPLE, RECOVERED 9 JTS OF 2 7/8 L80 AND 1 EXTRA JT THAT ATTACHED IT SELF TO ONE OF THE OTHER JT, TOF TBG FISH @5632', TOP OF RODS @5333',	
					SECURE WELL SD.	
15:00	05:00	14.00	ACTIVE	SHUTDOWN	SI	
Rnt# 2	6 3/6/20	023 05:0	00 - 3/7/2023 0	5:00		
24 Hour S	Summary					
FISHIN Start	End					
Time	Time 06:30	Dur (hr)	Ops Status ACTIVE	Operation SHUTDOWN	Description SI	NPT
05:00 06:30	07:00		ACTIVE	SAFETY	PJSM	
07:00			ACTIVE	PCHECK	TSIP 0, CSIP 0	
07:30	11:30	4.00	ACTIVE	TRIP IN	FUNCTION TEST BOP, TIH WITH 5 3/4 W/6" GUIDE MOUSE TRAP, 10 JTS 2 7/8 L80, X-	
					OVER, RAN 2 7/8 PH6 WS, TAG TOP OF RODS @5333' WENT OVER RODS DOWN TO TOP OF TUBING FISH @5600', PU ON ROD STRING AND BACK OFF.	
11:30	16:30	5.00	ACTIVE	TRIP OUT	POOH WITH 2 7/8 PH6 WS, TO ROD FISH, CHANGE EQUIP OVER FOR RODS,	
					RECOVERED AND LD 5 -1 1/4 FG RODS GUIDED, 82 -1" STEEL RODS AND 12 -7/8	
					STEEL RODS, CHANGE EQUIP OVER TO TUBING LD 10 JTS OF 2 7/8 L80 AND MOUSE TRAP FISHING TOOL. TOP OF TUBING FISH @5600', TOP OF RODS APPROX @7900'	
					SECURE WELL SDON.	
16:30	05:00	12.50	ACTIVE	SHUTDOWN	SI	
	•	023 05:0	00 - 3/8/2023 0	5:00		
24 Hour S FISHIN						
Start Time	End	Dur (ba)	Ops Status	Operation	Donatistian	NPT
05:00	Time 06:30	Dur (hr) 1.50	ACTIVE	Operation SHUTDOWN	Description SI	NPT
06:30	07:00		ACTIVE	SAFETY	PJSM	
	07:30		ACTIVE	PCHECK	TSIP 0, CSIP 0	
07:30	11:30	4.00	ACTIVE	TRIP IN	FUNCTION TEST BOP, TIH WITH 4 11/16 OS W/6" GUIDE, 3 21/32 GRAPPLE, RAN 179 JTS OF PH6 WS, LATCH ON TO FISH @5600' PU ON TUBING 30 OVER HAVE A GOOD	
					BITE. CHANGE EQUIP OVER FROM TUBING TO RODS.	
11:30	16:00	4.50	ACTIVE	RUNCOM	RU ROD STRIPPER, TIH W/2' 7/8 SUB, 120 -1" STEEL RODS FROM DERRICK, WAITED	
16:00	05:00	13.00	ACTIVE	SHUTDOWN	ON NEW RODS, UNLOADED, SECURE WELL SDON.	
Rpt# 2		U23 05:0	00 - 3/9/2023 0	5:00		
FISHIN	G BAC	K-OFF 8	RETRIEVE R	ODS		
Start Time	End Time	Dur (hr)		Operation	Description	NPT
05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI	
	07:00 11:00		ACTIVE ACTIVE	SAFETY	PJSM	
07:00	11:00	4.00	ACTIVE	KUNCUM	SITP: 0 PSI, SICP: O PSI - UNPACK NEW 1.0" KD RODS - PU & CONTINUE TO TIH WITH 1.0" RODS - RAN 201- 1.0" RODS FOR TOTAL OF 321- 1.0" RODS & 1- 7/8" X 2.0' PONY IN	
					HOLE (BOX DOWN).	
11:00	11:30	0.50	ACTIVE	FISH	TAG TOP OF FISH (7/8" RODS) WITH 12' STICK-UP ON ROD 321 @ 7,900' - WEIGHT CHECK 22.500# - ENGAGE 7/8" RODS WITH RH ROTATION BY HAND - PU ON STRING	
					AND PULL 28,000# - DROP TO 2,000# USW - RH ROTATE RODS WITH TONGS TO 1500	
					FT/LBS - PU 4,000# OSW CONFIRM GOOD LATCH - DROP TO NEUTRAL - BACKOFF (LH) WITH TONGS - HANGING WEIGHT AFTER BACK-OFF = 28,000#.	
11:30	15:30	4.00	ACTIVE	PULCOM	POOH WITH 321- 1.0" RODS RODS TO DERRICK - LD (RECOVER) 22- 7/8" KD RODS -	
. 1.50	13.00	4.00	, to rive	, OZOOIVI	LEAVING 72- 7/8" RODS AND 10- 1- 5/8" SINKER IN HOLE TO RECOVER.	
15:30	17:00	1.50	ACTIVE	RUNCOM	RURIH WITH 7/8" X 2.0' PONY (PIN DOWN) ON 1.0" KD RODS FROM DERRICK - RAN 253	
17:00	17:30	0.50	ACTIVE	SHUTDOWN	RODS. SECURE WELL - SDFN.	
		l		1-11-1-1	SESSILE HELE SDITE.	
Dot# 2	2/0/2		00 - 3/40/2023 (

Rpt# 29, 3/9/2023 05:00 - 3/10/2023 05:00

FISHING - BACK-OFF RODS

DELAWARE BASIN UNRESTRICTED

Operation Summary (Ascending)

OH - Property #: 38212

Well Name: SEA SNAKE 35 STATE 3H

Sub-Divis DELAV	ion VARE B	ASIN	Regio DEL	n AWARE BASIN		ield Name ΓHISTLE		County LEA	State/Prov NM	ince
Surface L 35-23S	egal Locat 3-33E	ion		API/UWI 3002542283		ude (°) ' 15' 15.941" N	Longitude (°) 103° 32' 29.404" W	Orig KB Elevation (ft) 3,672.00	Ground Elevation (ft) 3,647.00	KB - GL (ft) 25.00
Start Time	End Time	Dur (hr)	Ops Status	Operation			Description			NPT
05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI					
06:30	07:00	0.50	ACTIVE	SAFETY	PJSM					
07:00	08:30	1.50	ACTIVE	RUNCOM			ITINUE TO TIH WITH 1. · 7/8" X 2.0' PONY IN HO		- 1.0" RODS FOR	
08:30	09:00	0.50	ACTIVE	FISH	CHECK 18,00 AND PULL 29 FT/LBS - PU WITH TONG	00# - ENGAGE 7/8 5,000# - DROP TO 4,000# OSW CON S - HANGING WEI	WITH 8' STICK-UP ON " RODS WITH RH ROTA 2,000# USW - RH ROTA FIRM GOOD LATCH - D GHT AFTER BACK-OFF RQUE TO 1500 FT/LBS.	ATION BY HAND - F ATE RODS WITH T PROP TO NEUTRAL	PU ON STRING ONGS TO 1500 BACKOFF (LH)	
09:00	11:30	2.50	ACTIVE	FISH) - NEUTRAL WEIGHT : INDICTOR - MADE 50'		IG 58K OS ON	
11:30	14:00	2.50	ACTIVE	FISH	& CATCH) - N	NEUTRAL WEIGHT NICTOR - GAINED	ODS TO 1500 FT/LBS I = 25,000# - PULLING 7 ADDITIONAL 20' FOR 7	75K OS ON EACH I	HIT FOR TOTAL	
14:00	14:30	0.50	ACTIVE	FISH			RING AND PULL 29,000# GHT AFTER BACK-OFF	,	- BACKOFF (LH)	
14:30	17:30	3.00	ACTIVE	PULCOM			ODS TO DERRICK - LD 1- 5/8" SINKER BAR IN		/8" RODS -	
17:30	18:00	0.50	ACTIVE	SHUTDOWN	SECURE WE	LL - SDFN.				

Rpt# 30, 3/10/2023 05:00 - 3/11/2023 05:00

devon

FISHING - BACK-OFF RODS

Start Time	End Time	Dur (hr)	Ops Status	Operation	Description	NPT
05:00	06:30		ACTIVE	SHUTDOWN	SI	
06:30	07:00	0.50	ACTIVE	SAFETY	PJSM	
07:00	08:30	1.50	ACTIVE	LOCATN	LD FROM DERRICK 61- 7/8" RODS.	
08:30	13:30	5.00	ACTIVE	RUNCOM	SITP: 0 PSI, SICP: O PSI - TIH WITH 1.0" RODS - RAN 90- 1.0" RODS FOR TOTAL OF 404- 1.0" RODS & 1- 7/8" X 2.0' PONY IN HOLE (BOX DOWN).	
13:30	14:00	0.50	ACTIVE	FISH	TAG TOP OF FISH (7/8" RODS) WITH 12' STICK-UP ON ROD 404 @ 10,100' - WEIGHT CHECK 29,000# - ENGAGE 7/8" RODS WITH RH ROTATION BY HAND - PU ON STRING AND PULL 31,500# - DROP TO 2,000# USW - RH ROTATE RODS WITH TONGS TO 1500 FT/LBS.	
14:00	15:00	1.00	ACTIVE	FISH	WORK RODS (DROP & CATCH) - NEUTRAL WEIGHT = 31,500# - PULLING 68K OS ON EACH HIT FOR TOTAL 100K ON INDICTOR - MADE 10' AFTER 45 MNS - 1.0" ROD PARTED AT SURFACE 1.0' BELOW UPSET AT ROD ELEVATOR - 6.0' OF BROKEN ROD STICK-UP - RI AND LATCH 1.0" ROD WITH TAPERED ROD SOCKET - PU & LD BROKEN ROD - PU & MU NEW ROD.	
15:00	15:30	0.50	ACTIVE	FISH	WEIGHT CHECK 31,500# (NEUTRAL) - RH SCREW INTO RODS WITH TONGS TO 1500 FT/LBS - PU 1,000# (32,500#) OSW - BACKOFF (LH) WITH TONGS - HANGING WEIGHT AFTER BACK-OFF = 24,000# - LOST 7,500#.	
15:30	16:00	0.50	ACTIVE	FISH	WEIGHT CHECK 24,000# (SHOULD BE 31,500#) - RH SCREW INTO RODS WITH TONGS TO 1500 FT/LBS - PU 2,000# (33,500#) OSW - BACKOFF (LH) WITH TONGS - HANGING WEIGHT AFTER BACK-OFF = 24,000# - LOST 7500#.	
16:00	16:30	0.50	ACTIVE	PULCOM	WEIGHT CHECK 24,000# (SHOULD BE 31,500#) - RH SCREW INTO RODS WITH TONGS TO 1500 FT/LBS - PU 4,000# (35,500#) OSW - BACKOFF (LH) WITH TONGS - HANGING WEIGHT AFTER BACK-OFF = 24,000# - LOST 7,500# - RODS BREAK IN SAME PLACE AT 7,900' - RH SCREW INTO RODS WITH TONGS TO 1500 FT/LBS - PULLED UP TO 34,000# TO CONFIRM SCREWED BACK IN.	
16:30	17:00	0.50	ACTIVE	SHUTDOWN	SECURE WELL - SDFN.	

Rpt# 31, 3/12/2023 05:00 - 3/13/2023 05:00

FISHING - BACK-OFF RODS - POOH

1 101 111		311 01 1				
Start Time	End Time	Dur (hr)	Ops Status	Operation	Description	NPT
05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI	
06:30	07:00	0.50	ACTIVE	SAFETY	PJSM	
07:00	07:30	0.50	ACTIVE	FISH	SITP: 0 PSI, SICP: 0 PSI - WEIGHT CHECK 31,500# (NEUTRAL) - SET DOWN 3,000# RH TORQUE RODS WITH TONGS TO 1500 FT/LBS - PU TO 32,000# - BACKOFF (LH) WITH TONGS - HANGING WEIGHT AFTER BACK-OFF = 20,000# - LOST 12,000#.	
07:30	08:00	0.50	ACTIVE	FISH	WEIGHT CHECK 20,000# (SHOULD BE 31,500#) - RH SCREW INTO RODS WITH TONGS TO 1500 FT/LBS - PU 8,000# OSW (40,000#) - BACKOFF (LH) WITH TONGS - HANGING WEIGHT AFTER BACK-OFF = 6,000# - LOST 25,500#.	
08:00	08:30	0.50	ACTIVE	FISH	SCREW BACK IN TO RODS - RETORQUE RODS IN 2000# INCREMENTS FROM NEUTRAL TO 10,000# OSW - RELEASING TORQUE BEWTEEN STAGES.	
08:30	09:00	0.50	ACTIVE	FISH	PU STRING TO 32,000# - BACKOFF (LH) WITH TONGS - HANGING WEIGHT AFTER BACK-OFF = 36,000# - GAINED 4,000#.	
09:00	11:30	2.50	ACTIVE	PULCOM	PREPARE TO TRIP RODS - POOH TO DERRICK WITH 156- 1.0" RODS - SHUT DOWN OPERATIONS DUE TO HIGH WIND GUSTS.	
11:30	12:00	0.50	ACTIVE	SHUTDOWN	SECURE WELL - SDEN	

Rpt# 32, 3/13/2023 05:00 - 3/14/2023 05:00

POOH RODS - JET CUT TUBING

	Start Time	End Time	Dur (hr)	Ops Status	Operation	Description	NPT
_ L			Dui (III)			'	141 1
	05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI	
	06:30	07:00	0.50	ACTIVE	SAFETY	PJSM	
	07:00	10:00	3.00	ACTIVE		SITP: 0 PSI, SICP: 0 PSI - CONTINUE TO POOH WITH 1.0" RODS - PULLED 234 1.0" RODS TO DERRICK - LD 14 RODS - (404 TOTAL) - LD RECOVERED 2- 7/8" RODS - LEAVING 9- 7/8" RODS & 10- 1-5/8" SINKER BAR DOWN HOLE.	
	10:00	11:30	1.50	ACTIVE		RU WIRELINE WITH 1- 11/16" WIEGHT BAR & 2.18" JET CUTTER - RIH & HARD TAG @ 8,023' - PULL TBG 30K OS - RETAG WITH NO CHANGE - POOH & LD WL.	
l	11:30	12:00	0.50	ACTIVE	KILLOP	FLUSH TBG WITH 60 BBLS 2.0% KCL.	

Page 9 of 19 DELAWARE BASIN UNRESTRICTED

Operation Summary (Ascending)

OH - Property #: 38212

Well I	Name:	SEA S	SNAKE 35	STATE 3H						
Sub-Divis	sion VARE B	ASIN	Regi DF	on LAWARE BASIN	FAST	Field Name THISTLE		County LEA	State/Prov	rince
Surface L	egal Locat			API/UWI	LAGI	Latitude (°)	Longitude (°)	Orig KB Elevation	(ft) Ground Elevation (ft)	KB - GL (ft)
35-23S Start	3-33E End			3002542283		32° 15' 15.941" N	103° 32' 29.404" W	3,672.00	3,647.00	25.00
Time 12:00	Time 13:00	Dur (hr) 1.00	Ops Status ACTIVE	Operation WIRELINE	- JAR DO\	WN AND MADE 60' FER 20 MINS JARRI	Description AR, SPANG JARS & 1/2" IN 2 HITS - CONTINUE TO NG - POOH & LD WL - M	O TAG HARD W	/ITH NO CHANGE @	NPT
13:00	17:00		ACTIVE	RUNCOM	RODS TO	9,750' - (LEAVING	QUIP - TIH WITH 1.0" RC 14 TO PU IN AM).	DDS FROM DEF	RRICK - RAN 390	
7:00	17:30	0.50	ACTIVE	SHUTDOWN	SECURE	WELL - SDFN.				
Rpt# 3	3, 3/14/2	2023 05	:00 - 3/15/202	3 05:00						
	Summary ISH WIT	H ROD	S - POOH WIT	TH RODS						
Start	End									
Time 05:00	Time 06:30	Dur (hr) 1.50	Ops Status ACTIVE	Operation SHUTDOWN	SI		Description			NPT
06:30	07:30		ACTIVE	SAFETY	HOLD SA OVERLEN POSITION HAND TR SPEEDS I	IGTH TUBING, WAS IS OF CREW IN DE IPPING RODS - DIS N ALL TASKS AND	N - DISCUSS PICK UP AN SHPIPE & EQUIPMENT T RRICK AND ON GROUNI CUSSED IMPORTANTAN HOLDING ADDITIONAL S SCOPE CHANGES OR NO	O/FROM DERF D - DISCUSS C NCE OF MAINTA SAFETY & PRO	CICK/RIG FLOOR & URRENT TASK AT AINING SAFE CEDURE MEETINGS	
7:30	08:00	0.50	ACTIVE	RUNCOM			RIH WITH 2- 1.0" RODS - LED PUNCHING HOLES			
08:00	08:30		ACTIVE ACTIVE	RUNCOM	INSURE F	ISH IS CHASED TO),800' - LEAVING 12- 1.0") BOTTOM PRIOR TO PU IN FOR RIG REPAIRS.		TOP OF FISH TO	
0.30	09.00	0.50	AUTIVE	SHOLDOWN	SECURE	WLLL - SHUT DOW	NI ON NIG KEFAIKS.			
	•	2023 05	:00 - 3/16/202	3 05:00						
	Summary WITH F	RODS	JET CUT TBG	- POOH WITH 2	7/8" PH-6					
Start Time	End Time	Dur (hr)	Ops Status	Operation			Description			NPT
05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI					
06:30	07:00		ACTIVE	SAFETY	PJSM					
7:00	07:30		ACTIVE	RUNCOM	TOP OF F	ISH (7/8" RODS) @				
)7:30	11:30		ACTIVE	PULCOM	TOTAL) - 5/8" SINK	REMAINING FISH D ER BAR DOWN HO		? 7/8" EUE = 9-	7/8" RODS & 10- 1-	
11:30	13:00	1.50	ACTIVE	WIRELINE	6.0' SPEA		HEAD, 10' X 1- 11/16" WE 025' - PULL TBG INTO 20	,		
13:00	14:00	1.00	ACTIVE	WIRELINE	NO CHAN		IB & 2.188" JET CUTTER TO 20,000# TENSION - RE LD TOOL STRING.			
14:00	15:00	1.00	ACTIVE	WIRELINE	NO CHAN HITS - NC 9,219' - FI	GE - PULL TBG INT CHANGE - LOCAT RE CUTTER - POO		ETAG @ 9,250' 9,203' - POSITIO	- RETAG WITH 4 DN JET CUTTE R @	
15:00	16:30		ACTIVE	FISH	USW TO T FIRST HO FREEPOI	73K OSW FOR TOT DUR - CONTINUE TO NT IN AM.	EVATORS - WORKING PI AL PULL OF 140K - LD 2) WORK PIPE SAME LOS	JTS PH-6 & 1-	12' PH-06 PUP IN	
16:30	17:00	0.50	ACTIVE	SHUTDOWN	SECURE	WELL & BOPS - SD	FN.			
Rpt# 3	5, 3/16/2	2023 05	:00 - 3/17/202	3 05:00						
	Summary	CHEM	CUT - POOH	WITH TRG						
Start	End									
Time 05:00	Time 06:30	Dur (hr) 1.50	Ops Status ACTIVE	Operation SHUTDOWN	SI		Description			NPT
6:30	07:00		ACTIVE	SAFETY	PJSM & H	AZZARDS AROUNI	CEM CUTTER			
7:00	07:30		ACTIVE	KILLOP	MIN - FLU	SH CASING ANNUL	LEED OFF TO TANK ON LAS WITH 20 BBLS 2.0%	KCL - CSG ON	VACUUM.	
07:30	09:30	2.00	ACTIVE	WIRELINE	10 STATION LD FREEF TENSON STRING V	ONS PULLING 20,00 POINT TOOL - MUR FOR TOTAL OF 80,0	POINT TOOL- TAG FLUID 10 OS ON EACH - STUCK 11H WITH 2 1/8" CHEM CL 1000 ON HOOK - MAKE CI ANGING 60,000 AFTER ((@ 7,790 - FRE JTTER - PULL T HEM CUT @ 7,	EE @ 7,770 - POOH & BG INTO 20,000 731' - LOOSE 20,000	
9:30	10:30	1.00	ACTIVE	TRIP OUT	LD 1 JT 2	7/8" PH-6 - UNTIE	DRILL LINE - CHANGE O'DS (20 JTS) PH-6 - TIE B			
0:30			ACTIVE				JRE BOPS & WELL - SDF			
	6, 3/17/2 Summary	2023 05	:00 - 3/18/202	3 05:00						
POOH	WITH F	H-6 - LI	O 65 1/2 JTS E	UE - RIH WITH	MOUSE TE	RAP GRAPPLE				
Start Time	End Time	Dur (hr)		Operation			Description			NPT
05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI		·			
)6:30)7:00	07:00 07:30		ACTIVE ACTIVE	SAFETY	SITP: 0 P	,	RDS. LEED OFF TO TANK ON I BBLS 2.0% KCL - CSG O		" IN 30 SEC - FLUSH	
7:30	10:30	3.00	ACTIVE	TRIP OUT	CONTIUN PH-06, 65 (FISHED)	E TO POOH WITH 2 FULL JTS 2 7/8" EU = 2,164' - 90% OF E	2 7/8" PH-6 - PULLED 176 JE & 1/2 JT 2 7/8" EUE (C EUE JOINTS BENT OR CO ACT PATTERN ON TOP R	3 JTS PH-6 TO CUT JOINT) - TO ORK SCREWEI	OTAL 2 7/8" EUE LD O - ALL COUPLING	
			ACTIVE	TRIP IN					NGS. 'TAPPERED CATCH,	

Operation Summary (Ascending)

OH - Property #: 38212

ALL THE WAY DOWN-FIRM TOP OF 2019 1899 ACTIVE TRIP OUT TRIP			SEA	SNAKE 35			Eigld Name		County.	lo: : :5	dinas
SCHOOL	DELAV	VARE B			LAWARE BASIN		THISTLE	_	LEA	NM	
100			ion			La 35	atitude (°) 2° 15' 15.941" N	Longitude (°) 103° 32' 29.404" W			
1.530 1.500 ACTIVE FIGH WORK PIER DOWN SMALL OWNER FIRST ADDITIONAL ALTS 3.000 TO 8.000 TO 8	Start	End	Dur (br)	One Statue							
170 1739 0.50 ACTIVE SILLITOOWN SECURE WELL & ROPE-SIGN.	14:30	15:30	1.00	ACTIVE	FISH	ALL THE W BELOW @ IMMEDIATE	'AY DOWN - FINAL ⁻ 7,731') - ATTEMPT ⁻ ELY.	VING FISH ADDITIONA TAG OF 20,000# USW (TO TORQUE PIPE WIT	@ 7,714' (TOP OF (H TONGS - PIPE T	CHEM CUT TBG ORQUES UP	NF I
1975 1976						TO 8,000# I	DRAG - STAND BAC	K 140 JTS TO DERRIC		SHOWING 0,000	
1975 1976	D=4# 2	7 2/40/	2022.05	-00 2/40/202	3.05:00						
Second 1,00	24 Hour S	Summary									
Text Text			PH-6 & F	ROD FISH GRA	APPLE - LD FISH	IED RODS -	TIH W/ WORK STR	ING TBG FISH BHA			
19.00 10.00 ACTIVE SAFETY SAFETY SAFETY SAME STRIPPINGCUTTING A LID FIBER CALASS ROOS SAFETY SAME STRIPPINGCUTTING A LID FIBER CALASS ROOS SAFETY SAME STATE SAFETY SAME STATE SAFETY SAFETY	Time	Time	, ,			CI		Description			NPT
17:30 10:30 3:00 ACTIVE KILLOP TRIP OUT CONTINUE TO PLOOH WITH PH-HE WS & ROD FISH BH-A STAND TO BERRICK 66 JIS 2 MILLOPEN 29 IN 30 SEC - FLUSH CONTINUE TO PLOOH WITH PH-HE WS & ROD FISH BH-A STAND TO BERRICK 66 JIS 2 MILLOPEN 29 IN 30 SEC - FLUSH CONTINUE TO PLOOH WITH PH-HE WS & ROD FISH BH-A STAND TO BERRICK 66 JIS 2 MILLOPEN 29 IN 30 SEC - FLUSH CONTINUE TO PLOOH WITH PH-HE WS & ROD FISH BH-A STAND TO BERRICK 66 JIS 2 MILLOPEN 29 JIS 1 SEC	06:30			_			RIPPING/CUTTING 8	LD FIBER GLASS RO	DDS.		
RODS STICKING UP - STREP RELATING REDIS & 2 778 FEB C STEEL ORD - LD 16.13 S 7.78"		07:30	0.50	ACTIVE	KILLOP	SITP: 0 PSI CASING AN CONTINUE	I, SICP: 20 PSI - BLE INULAS WITH 20 BI TO POOH WITH PI	EED OFF TO TANK ON BLS 2.0% KCL - CSG O H-6 WS & ROD FISH BH	FULL OPEN 2.0" IN IN VACUUM. HA - STAND TO DE	RRICK 66 JTS 2	
SUB. 3-34** HYDRAULIC JAR, 4-3-12" DC, 3-34" MTENSIFIER, IF XPH-6 WO (BHA TOTAL—157.25) TH WYTBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END OF BHA @ 7,213" TH WYTBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END OF BHA @ 7,213" TH WYTBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END OF BHA @ 7,213" TH WYTBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END OF BHA @ 7,213" TH WYTBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END OF BHA @ 7,213" TH WYTBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END OF BHA @ 7,213" TH WYTBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END OF BHA @ 7,213" TH WYTBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END OF BHA @ 7,213" TH WYTBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END OF BHA @ 7,213" TH WYTBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END OF BHA @ 7,213" TH WYTBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END OF BHA @ 7,213" TH WYTBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END OF BHA @ 7,213" TH WYTBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END OF BHA @ 7,213" TH WYTBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END OF BHA @ 7,213" TH WYTBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END OF BHA @ 7,213" TH WYTBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END OF BHA @ 7,213" TH WYTBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END OF BHA @ 7,213" TH WYBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END OF BHA @ 7,213" TH WYBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END OF BHA @ 7,213" TH WYBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END OF BHA WYBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END OF BHA WYBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END OF BHA WYBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END OF BHA WYBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END OF BHA WYBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END OF BHA WYBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END OF BHA WYBG ISIBHAN OR 278" PH-6 - RAN 225 JTS (7,056") - END O						RODS STICE EUE TBG & RECOVER/ (NOTE: 57.5 HOLE BESI REMAIN IN	CKING UP - STRIP F & 17.5 RODS, X/O, 5 (FISHED (732') 19.5- 5 - 1-1/4" FG SLICK IDE TUBING AND 9 SIDE TBG ABOVE F	EMÁINING RODS & 2 1 3/4" MOUSETRAP & 2 1-1/4" SLICK FG RODS RODS & 24- 1-1/4" FG - 7/8" STEEL RODS, 10 ACKER).	7/8" EUE OOH - LD ? FULLRODS BELO S. GUIDED RODS RE 0 - 1 5/8" SINKER B	16 JTS 2 7/8" DW MOUSETRAP - MAIN DOWN AR & BHP	
Soo 15:00 15:00 ACTIVE RUNCOM PREPARE TO THE WITH 1.0" PRODS FROM DERRICK FOR LAY DOWN - RAN 213 ROOS.	10:30	12:30	2.00	ACTIVE	ВНА	SUB, 3- 3/4	" HYDRAULIC JAR,				
Secure S									* * *	•	
Secure S	15:00 16:30								FOR LAY DOWN -	KAN 213 RODS.	
A				l		JEGGINE W					
D. 1.0P RODS - LATCH AND FISH 2 7/8" TBG	24 Hour S	Summary									
Intent District			- LATC	H AND FISH 2	2 7/8" TBG						
18-30 07-00 0.50 ACTIVE SAFETY P.JSM. LD ROD PINCH POINTS & OVERHEAD HAZZARDS	Time	Time						Description			NPT
17.00 07.30 0.50 ACTIVE KILLOP SITE* 0 PSI . SICE* 10 PSI . SICE* 10 PSI . SICE* 0 TANK ON FULL OPEN 2.0* IN 30 SEC - FLUSH CASING ANNUALS WITH 10 BBLS 2.0% KCL - CSG ON VACUUM							BOD BINICH BOINI	rs & OVEDHEAD HA7:	7ADDQ		
17.50 17.5				_						N 30 SEC - FLUSH	
13:00 10:00 3:00											
13:00 15:00 16:30 15:00 16:30 15:00 16:30 15:00 16:30 15:00 16:30 15:00 16:30 15:00 16:30 15:00 16:30 15:00 16:30 15:00 16:3										RAN 187 RODS	
1.50	11:30									RAN 107 RODS.	
A	15:00	16:30	1.50	ACTIVE	TRIP IN	PH-06 TO T CUT = 7,73	AG SOLID @ 7,728 1') - WORK TBG DR	- 15' STICK UP ON JT OP & CATCH FOR 45 N	241 (WIRELINE DE	EPTH ON CHEM	
A HOUR SUMMARY STEIN TIME TIM	16:30	17:00	0.50	ACTIVE	FISH	SECURE W	/ELL & BOPS - SDF	N.			
SISHING POOH OS, TIH WISHOE	Rpt# 3	9, 3/21/	2023 05	:00 - 3/22/202	3 05:00						
Start End Dur (tr) Ope Status Operation Op	24 Hour S	Summary G POO	H OS. T	TH W/SHOE							
1.500 06:30 1.50 ACTIVE SHUTDOWN SI PJSM	Start	End			Oncortion			Dagarintian			NDT
17:00 07:30 0.50 ACTIVE FUNCTION TEST BOP, POOH W/241 JTS PH6 WS, ACC., 4 - 3 1/2 COLLARS, JARS, BS, 4 1/16 OS W/2 7/8 GRAPPLE, WITH 6" LIP GUIDE, HAD SOME COUPLE OF PIECES OF FG INSIDE OS. 11:30 16:30 5:00 ACTIVE TRIP IN			, ,			SI		Description			NPT
11:30						-	_				
11/36 SW/2 7/8 GRAPPLE, WITH 6" LIP GUIDE, HAD SOME COUPLE OF PIECES OF FG INSIDE OS. 11/36 OS W/2 7/8 GRAPPLE, WITH 6" LIP GUIDE, HAD SOME COUPLE OF PIECES OF FG INSIDE OS. 11/36 OS W/2 7/8 GRAPPLE, WITH 6" SHOE W/2 7/8 ID, 2 JTS 5 3/4 WP, TB, 4 1/4 JARS, X-OVER, 244 JTS 2 7/8 PH6 WS, TAG @7720, TIE BACK RIG, RU POWER SWIVEL, WASH DOWN TO 7728", PU ON TUBING, SECURE WELL SDON, CONTINUE WASHING OVER IN A.M. SI								N/241 ITS PHE MS AG	CC 4-3.1/2.COLL	ARS JARS RS 4	
PH6 WS, TAG @7720, TIE BACK RIG, RU POWER SWIVEL, WASH DOWN TO 7728', PU ON TUBING, SECURE WELL SDON, CONTINUE WASHING OVER IN A.M.						11/16 OS W INSIDE OS.	//2 7/8 GRAPPLE, W	/ITH 6" LIP GUIDE, HAI	D SOME COUPLE (OF PIECES OF FG	
A Hour Summary POOH W/SHOE, TIH W/MOUSE TRAP	11:30					PH6 WS, TA ON TUBING	AG @7720', TIE BAG	CK RIG, RU POWER SV	WIVEL, WASH DOV	VN TO 7728', PU	
A Hour Summary	16:30	05:00	12.50	ACTIVE	SHUTDOWN	SI					
Start Find Time Time Dur (hr) Ops Status Operation	_	•	2023 05	:00 - 3/23/202	3 05:00						
Start End Time Dur (hr) Ops Status Operation Description Description NPT	24 Hour S POOH	ummary W/SHC	E, TIH \	W/MOUSE TR	AP						
15:00 06:30 1.50 ACTIVE SHUTDOWN SI 16:30 07:00 0.50 ACTIVE SAFETY PJSM 17:00 07:30 0.50 ACTIVE PCHECK TAIP 0, CSIP 0 17:30 09:30 2.00 ACTIVE RMWASH FUNCTION TEST BOP, CONTINUE WASHING OVER FISH, WASH DOWN TO 7783'. 18:00 18:00 3.50 ACTIVE TRIP OUT RD POWER SWIVEL, POOH WITH 246 JT 2 7/8 PH6, JARS, BS, X-OVER, 2 JTS 5 3/4 WP, AND SHOE, HAD COUPLE OF PIECES OF FG INSIDE SHOE. 18:00 17:00 4.00 ACTIVE TRIP IN TIH WITH 5 3/4 MOUSE TRAP W/1 1/4 TO 1 1/2 INSERT, 3 JTS 2 7/8 L80 EUE, X-OVER, 245 JTS OF 2 7/8 PH6 WS, TAG @7783', LD ONE JT HAD LITTLE DRAG COMING OFF BOTTOM. SECURE WELL SDON. 18:00 Statt Statt End En	Start	End						Description			NPT
17:00 07:30 0.50 ACTIVE PCHECK TAIP 0, CSIP 0 FUNCTION TEST BOP, CONTINUE WASHING OVER FISH, WASH DOWN TO 7783'. RD POWER SWIVEL, POOH WITH 246 JT 2 7/8 PH6, JARS, BS, X-OVER, 2 JTS 5 3/4 WP, AND SHOE, HAD COUPLE OF PIECES OF FG INSIDE SHOE. TIH WITH 5 3/4 MOUSE TRAP W/1 1/4 TO 1 1/2 INSERT, 3 JTS 2 7/8 L80 EUE, X-OVER, 2 45 JTS OF 2 7/8 PH6 WS, TAG @7783', LD ONE JT HAD LITTLE DRAG COMING OFF BOTTOM. SECURE WELL SDON. SI	05:00	06:30	1.50	ACTIVE	SHUTDOWN			2 oct. ipilon			1
13:00 13:00 3.50 ACTIVE RMWASH TRIP OUT RD POWER SWIVEL, POOH WITH 246 JT 2 7/8 PH6, JARS, BS, X-OVER, 2 JTS 5 3/4 WP, AND SHOE, HAD COUPLE OF PIECES OF FG INSIDE SHOE. 17:00 17:00 4.00 ACTIVE TRIP IN TIH WITH 5 3/4 MOUSE TRAP W/1 1/4 TO 1 1/2 INSERT, 3 JTS 2 7/8 L80 EUE, X-OVER, 245 JTS OF 2 7/8 PH6 WS, TAG @7783', LD ONE JT HAD LITTLE DRAG COMING OFF BOTTOM. SECURE WELL SDON. 17:00 05:00 12:00 ACTIVE SHUTDOWN SI Start End Dur (hr) Ops Status Operation Operation Description NPT 15:00 06:30 07:00 0.50 ACTIVE SHUTDOWN SI PJSM							ID 0				
13:00 13:00 3.50 ACTIVE						,		NUE WASHING OVER	FISH, WASH DOW	N TO 7783'	
3:00 17:00 4:00 ACTIVE TRIP IN TIH WITH 5 3/4 MOUSE TRAP W/1 1/4 TO 1 1/2 INSERT, 3 JTS 2 7/8 L80 EUE, X-OVER, 245 JTS OF 2 7/8 PH6 WS, TAG @7783', LD ONE JT HAD LITTLE DRAG COMING OFF BOTTOM. SECURE WELL SDON. Rept# 41, 3/23/2023 05:00 - 3/24/2023 05:00 HOUR Summary POOH W/MOUSE TRAP, TIH W/OS Start Time End Time Dur (hr) Ops Status Operation Description NPT 15:00 06:30 07:00 0.50 ACTIVE SHUTDOWN SI PJSM	09:30			_		RD POWER	R SWIVEL, POOH W	ITH 246 JT 2 7/8 PH6,	JARS, BS, X-OVER		
Total Time Time Dur (hr) Ops Status Operation Operat	13:00	17:00	4.00	ACTIVE	TRIP IN	TIH WITH 5	3/4 MOUSE TRAP	W/1 1/4 TO 1 1/2 INSE	RT, 3 JTS 2 7/8 L80		
Hour Summary POOH W/MOUSE TRAP, TIH W/OS	17:00	05:00	12.00	ACTIVE	SHUTDOWN	воттом. 9					
Start Time Dur (hr) Ops Status Operation O		•	2023 05	:00 - 3/24/202	3 05:00						
Start Time End Time Dur (hr) Ops Status Operation NPT 55:00 06:30 1.50 ACTIVE SHUTDOWN SI SAFETY PJSM			JSE TRA	AP, TIH W/OS							
05:00 06:30 1.50 ACTIVE SHUTDOWN SI 06:30 07:00 0.50 ACTIVE SAFETY PJSM	Start	End						Description			NDT
	05:00	06:30		•		SI		Description			NPI
77:00 07:30 0.50 ACTIVE PCHECK TSIP 0, CSIP 0							ID 0				
	υ/:00	07:30	0.50	ACTIVE	PCHECK	TSIP 0, CSI	IF 0				

Page 8/16

Operation Summary (Ascending)

OH - Property #: 38212

Well I	Name:	SEA	SNAKE 35 S	TATE 3H		
Sub-Divis	ion VARE B	ASIN	Regio DEL	n AWARE BASIN	Field Name County State/Province EAST THISTLE LEA NM	ce
	egal Locat		1255	API/UWI 3002542283		KB - GL (ft) 25.00
Start	End	D (1)	0 01-1			
7ime 07:30	Time 10:30	3.00	Ops Status ACTIVE	Operation TRIP OUT	Description FUNCTION TEST BOP, CONTINUE POOH W/244 JTS WS, X-OVER, 3 JTS 2 7/8 EUE, 5 3/4	NPT
10:30	16:30	6.00	ACTIVE	TRIP IN	MOUSE TRAP. HAD NO FISH. TIH W/4 11/16 OS W/2 7/8 GRAPPLE, BS, JARS, 4 -3 1/2 DC, 244 JTS WS TAG TOF	
10:30	10:30	6.00	ACTIVE	IRIPIN	@7783', COULDN'T GET A GOOD BITE, OS COMING OFF AT 5 PTS OVER, RU SWIVEL	
					WORKED OS, GOT A BETTER BITE, BUT WAS SLIPPING OFF AT 15 PTS OVER, WOULDN'T BITE ANYMORE AFTER A FEW MORE TRIES. RD SWIVEL LD 1 JTS, SECURE	
					WELL SDON.	
16:30	05:00	12.50	ACTIVE	SHUTDOWN	SI	
Rpt# 4	•	2023 05	:00 - 3/25/2023	05:00		
POOH	W/ OŚ	ı				
Start Time	End Time	Dur (hr)	Ops Status	Operation	Description	NPT
05:00 06:30	06:30 07:00		ACTIVE ACTIVE	SHUTDOWN SAFETY	SI PJSM	
07:00	07:30		ACTIVE	PCHECK	TSIP 0, CSIP 0	
07:30	11:30	4.00	ACTIVE	TRIP OUT	FUNCTION TEST BOP, POOH 244 JTS WS, DC, JARS, BS, AND OS. HAD NO FISH, GRAPPLE HAD MARKING SHOWING IT BARLEY HAD A BITE ON FISH, DIDN'T GET ALL	
					THE WAY OVER IT. WILL RAN BACK WITH SHOE AND WASH OVER.	
11:30	05:00	17.50	ACTIVE	SHUTDOWN	SI	
_		2023 05	:00 - 3/26/2023	05:00		
	SHOÉ V	WASH C	OVER FISH, PO	ОН		
Start Time	End Time	Dur (hr)	Ops Status	Operation	Description	NPT
05:00	06:30		ACTIVE	SHUTDOWN	SI DIGM	
06:30 07:00	07:00 07:30		ACTIVE ACTIVE	SAFETY PCHECK	PJSM TSIP 0, CSIP 0	
07:30	14:30		ACTIVE	TRIP IN	FUNCTION TEST BOP, TIH 6" SHOE W/2 7/8 ID, TOP SUB W/CUTRITE, 4 1/4 JARS, X-	
					OVER, 248 JTS WS, TAG 7783, RU SWIVEL, WASHED OVER FISH FIRST 2 1/2 FT, FELL THRU DOWN TO 7788', WELL BROKE CIRCULATION AFTER 200 BBLS, HAD FG	
14:30	16:30	2.00	ACTIVE	TRIP OUT	CUTTING IN RETURNS, RD SWIVEL. POOH WITH 120 JTS, SECURE WELL SD.	
16:30	05:00		ACTIVE	SHUTDOWN	SI	
Rot# 4	4. 3/27/	2023 05	:00 - 3/28/2023	05:00		
24 Hour S	Summary					
Start	End		V/SHOE AND V		_	
Time 05:00	Time 06:30	Dur (hr) 1.50	Ops Status ACTIVE	Operation SHUTDOWN	Description SI	NPT
06:30	07:00	0.50	ACTIVE	SAFETY	PJSM	
07:00 07:30	07:30 09:30		ACTIVE ACTIVE	PCHECK TRIP OUT	TSIP 0, CSIP 0 FUNCTION TEST BOP, CONTINUE TO POOH WITH TUBING,120 JTS WS, X-OVER, JARS	
07.00	00.00	2.00	7.01172	11111 001	AND 6" SHOE W/2 7/8 ID, SHOE HAD NO MARKING INSIDE, NO WIRES WERE BROKING,	
09:30	11:30	2.00	ACTIVE	BOPS	DIDN'T GET OVER FISH. RD TONGS AND WORK FLOOR, CHANGE OUT BOP DUE TO 21 DAYS ON WELL, ND	
					BOP, FUNCTION TEST BOP, NU BOP, RU WORK FLOOR AND TUBING TONGS.	
11:30	16:00	4.50	ACTIVE	TRIP IN	TIH WITH 5 3/4 SHOE W/6" CROWN, WITH WIRES INSIDE, 2 JTS 5 3/4 WP, TOP BUSHING W/CUT RITE, 4 1/4 JARS, X-OVER, 246 JTS 2 7/8 PH6 WS, RU POWER SWIVEL	
40.00	05.00	40.00	A O.T.I) (F.	OLULTDOMAN	AND TUBING STRIPPER. STARTED HAVING ISSUES WITH WSU, SECURE WELL SDON.	
16:00	05:00	13.00	ACTIVE	SHUTDOWN		
Rpt# 4	•	2023 05	:00 - 3/29/2023	05:00		
		FISH, P	OOH W/SHOE			
Time	Time	Dur (hr)	Ops Status	Operation	Description	NPT
05:00 06:30	06:30 07:00		ACTIVE ACTIVE	SHUTDOWN SAFETY	SI PJSM	
07:00	07:30	0.50	ACTIVE	PCHECK	TSIP 0, CSIP 0	
07:30	16:30	9.00	ACTIVE	RMWASH	FUNCTION TEST BOP, BROKE CIRCULATION AFTER 200 BBLS 2% KCL, WASHED OVER FISH FROM 7783' TO 7836'. 53' OVER FISH,, CIRCULATED WELL CLEAN, HAD FG	
10.00	05:00	10.50	ACTIVE	CHITTON	CUTTINGS IN THE RETURNS. SECURE WELL SDON.	
	05:00		ACTIVE	SHUTDOWN	SI Control of the con	
Rpt# 4	<u> </u>	2023 05	:00 - 3/30/2023	05:00		
TIH W/	SHOÉ,	TIH W/	os			
Start Time	End Time	Dur (hr)	Ops Status	Operation	Description	NPT
05:00 06:30	06:30 07:00		ACTIVE ACTIVE	SHUTDOWN	SI PJSM	
07:00	07:30	0.50	ACTIVE	PCHECK	TSIP 0, CSIP 0	
07:30	13:00	5.50	ACTIVE	TRIP OUT	FUNCTION TEST BOP, RD POWER SWIVEL AND TUBING, POOH WITH 246 JTS PH6 WS, JARS, 2 JTS -5 3/4 WP, 6" SHOE. TUBING PULLED WET, JARS WAS PLUGGED WITH FG	
					CUTTINGS, HAD SOME FG DEBRI INSIDE TOP JT OF WP. SHOE WAS WORN DOWN	
13:00	17:00	4.00	ACTIVE	TRIP IN	AND WIRES WERE GONE. TIH 5 3/4 OS W/2 7/8 BASKET GRAPPLE, 3 3/4 MBS, 3 3/4 JARS, 4 -3 1/2 DC, 3 3/4 ACC, X	
					-OVER, 124 JTS 2 7/8 PH6 WS, SECURE WELL SDON.	
17:00	05:00	12.00	ACTIVE	SHUTDOWN	SI	
Rpt# 4	•	2023 05	:00 - 3/31/2023	05:00		
TIH OS	. POÓH					
Time	End Time	Dur (hr)	Ops Status	Operation	Description	NPT
05:00 06:30	06:30 07:00		ACTIVE ACTIVE	SHUTDOWN SAFETY	SI PJSM	
55.50	57.00	0.00	, TO TIVE	37 ti E i i		ted: 1/4/2024

devon

Operation Summary (Ascending)

OH - Property #: 38212

\ \	Nome	CEV	SNAKE	25 6	TATE	วบ
vven	maine.	SEA	SINANE	งอ จ	DIAIC	JП

		SEAS	SNAKE 35 S			leccos:		To :	Т-	
	VARE B		Regio DEL	AWARE BASIN		Field Name THISTLE		County	State/Provir NM	
Surface L 35-23S	egal Locat 3-33E	tion		API/UWI 3002542283		atitude (°) 2° 15' 15.941" N	Longitude (°) 103° 32' 29.404" W	Orig KB Elevation (ft) 3,672.00	Ground Elevation (ft) 3,647.00	KB - GL (ft) 25.00
Start Time	End Time	Dur (hr)	Ops Status	Operation			Description			NPT
07:00 07:30	07:30 12:30	0.50	ACTIVE ACTIVE	PCHECK TRIP IN	LATCH ON CIRCULATI	TEST BOP, CONTIN TO FISH, @7783', R	NUE TIH WITH ACC, DO RU POWER SWIVEL AN T WOULD GET A BITE	D TUBING STRIPF	PER, BROKE	N. I
12:30	15:30	3.00	ACTIVE	TRIP OUT	POOH WIT		PH6 WS, TUBING PUL ELL SDON.	LING WET, WIND S	STARTED	
15:30	05:00	13.50	ACTIVE	SHUTDOWN	SI					
		2023 05	:00 - 4/1/2023 (05:00						
	W/OS, F	RU WL 1	TAG W/LEAD E	LOCK						
Start Time	End Time	Dur (hr)	Ops Status	Operation			Description			NPT
05:00 06:30	06:30 07:00		ACTIVE ACTIVE	SHUTDOWN	SI PJSM					
07:00	07:30		ACTIVE	PCHECK	TSIP 0, CS	IP 0				
07:30	10:30		ACTIVE	TRIP OUT	FUNCTION	TEST BOP, CONTIN	NUE POOH WITH TUBI	NG, ACC, DC, JAR	S, BS AND OS,	
10:30	13:30	3.00	ACTIVE	WIRELINE	RU WL, TIH HAD TUBIN	IG AND ROD MARKI	BLOCK AND TAG TOF (NGS ON IT. RD WL, SE			
13:30	05:00	15.50	ACTIVE	SHUTDOWN	CONDITION	NS.				
			00 - 4/2/2023 0							
24 Hour S	Summary	AP, POC		5.00						
Start	End			Onorri			Description			NDT
05:00	Time 06:30	1.50	Ops Status ACTIVE	Operation SHUTDOWN	SI		Description			NPT
06:30	07:00		ACTIVE	SAFETY	PJSM					
07:00	07:30		ACTIVE	PCHECK	TSIP 0, CS			DANIOE 4 50% 5 00	DEII 0 0 / 4 DO 0 0 / 4	
07:30	14:30	7.00	ACTIVE	TRIP IN	JARS, 4 -3 SWIVEL W	1/2 DC, ACC, X-OVE ORKED BOX TAP, W	5 3/4 BOX TAP, CATCH FR, 244 JTS 2 7/8 PH6, OULD GET A BITE, BU E TIME, SAME RESULT	TAG TOF 7788", RI T WOULD SLIP OF	U POWER FF AFTER 20 PTS	
14:30 16:30	16:30 05:00		ACTIVE ACTIVE	TRIP OUT SHUTDOWN	POOH W/1: SI	20 JTS, SECURE W	ELL SD.			
Dot# 5	0 4/3/3		00 - 4/4/2023 0	5:00						
24 Hour S	Summary									
Start	W/BOX	TAP, I	IH W/SHOE, EA	ASHOVER						
Time 05:00	Time 06:30	Dur (hr)	Ops Status ACTIVE	Operation SHUTDOWN	SI		Description			NPT
06:30	07:00		ACTIVE	SAFETY	PJSM					
07:00	07:30		ACTIVE	PCHECK	TSIP 0, CS	IP 0				
07:30	09:30	2.00	ACTIVE	TRIP OUT		- ,	NUE POOH WITH 124 J O FISH, HAD MARKING	, ,	,,	
09:30	17:30	8.00	ACTIVE	TRIP IN	248 JTS 27 AFTER 200 BUSHING, CUTTINGS	7/8 PH6, RU POWEF BBLS, WENT OVEF @7788' DRESS OFF	3/4 WP, TOP BUSHING R SWIVEL AND TUBING R FISH @7788', RAN IN TOF 2' DOWN TO 779 BULATED CLEAN, RD S BDON.	STRIPPER, BROP TO 7820, TAG TO 0' WAS GETTING	KE CIRCULATION F W/TOP LOTS OF METAL	
17:30	05:00	11.50	ACTIVE	SHUTDOWN	SI					
	,	023 05:0	00 - 4/5/2023 0	5:00						
	W/SHC	E, TIH \	N/OS							
Start Time	End Time	Dur (hr)	Ops Status	Operation			Description			NPT
05:00 06:30	06:30 07:00		ACTIVE ACTIVE	SHUTDOWN SAFETY	SI PJSM,					
07:00	07:30		ACTIVE	PCHECK	· · · · ·	S, FUNCTION TEST	BOP, SITP 0 PSI, SICE	O PSI, OPEN WE	LL NO GAS.	
07:30	10:30		ACTIVE	TRIP OUT	N/D STRIPI	PER HEAD, L/D 2 x 2	2.875 PH6, POH W 62 x DS. SECURE WELL SD	2.875 PH6, LEAVE		
10:30	05:00	18.50	ACTIVE	SHUTDOWN	SI	DUE TO HIGH WINL	JS. SECURE WELL SD	FIN		
		023 05:0	00 - 4/6/2023 0	5:00						
	NUE PO	OH W T	BG / BHA							
Start Time	End Time	Dur (hr)	Ops Status	Operation			Description			NPT
05:00	06:30		ACTIVE	SHUTDOWN	SI					
06:30 07:00	07:00 07:30		ACTIVE ACTIVE	SAFETY	PJSM SITP 0 PSI	SICP 0 PSI, TEST I	INES/ FUNTION BOP.	OPEN WELL NO G	BAS.	
07:30 10:30	10:30 13:30	3.00	ACTIVE ACTIVE	TRIP OUT	CONTINUE RIH W 5 3/4	POH W TBG/ BHA, 4 CUT LIP GUIDE OI	NO MARKS ON TOP S N 4 11/16 O/S, 2.875 GF	UB RAPPLE, B/S, JARS	S, 4 D.C.,	
13:30	05:00	15.50	ACTIVE	SHUTDOWN	SI	NIOK, 38 X 2.8/5 PI	H 6, TAG TOF @ 1,350',	SECURE WELLS	DEN	
Rpt# 5	3, 4/6/2	023 05:0	00 - 4/7/2023 0	5:00						
24 Hour S	Summary		G LATCH ONT							
Start	End									
Time 05:00	Time 06:30	1.50	Ops Status ACTIVE	Operation SHUTDOWN	SI		Description			NPT
06:30	07:00	0.50	ACTIVE	SAFETY	PJSM					
07:00	07:30	0.50	ACTIVE	PCHECK	SITP 0 PSI	SICP 0 PSI, TEST I	LINES, FUNCTION TES	T BOP, OPEN WE	LL NO GAS	

Page 10/16

Page 13 of 19 DELAWARE BASIN UNRESTRICTED

Operation Summary (Ascending)

OH - Property #: 38212

Sub-Divis DELAV	on /ARE B	ASIN		egion ELAWARE BASIN	EAST	Field Name THISTLE		County LEA	State/Pro	vince	
Surface L 35-23S	egal Locat -33E	ion		API/UWI 3002542283		Latitude (°) 32° 15' 15.941" N	Longitude (°) 103° 32' 29.404" W	Orig KB Elevation (ft) 3,672.00	Ground Elevation (ft) 3,647.00	кв - 25.	- GL (ft) .00
Start Time	End Time	Dur (hr)	Ops Status	Operation			Description				NPT
07:30	09:30	2.00	ACTIVE	TRIP IN	CONTINU	E RIH W BHA/ TBG W	206 x 2.875 PH6, TAG	TOF @7,790', LAT	CH ONTO FISH.		
09:30	16:30	7.00	ACTIVE	FISH			G, SETTING JARS OFF OVING. GAINING 10K IN	_	GHT OF TBG		
16:30	17:30	1.00	ACTIVE	TRIP OUT		I x 2.875 PH6 TBG LEA WELL SDFN	AVE O/S SWINGING @	5,870', BOTTOM C	OF FISH @ 7,300	,	
17:30	05:00	11.50	ACTIVE	SHUTDOWN	SI						

devon

24 Hour Summary POOH WITH PH-6 & EUE TBG FISH

Start Time	End Time	Dur (hr)	Ops Status	Operation	Description	NPT	
05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI		
06:30	07:00	0.50	ACTIVE	SAFETY	PJSM		
07:00	07:30	0.50	ACTIVE	PCHECK	SITP: 0 PSI, SICP: 0 PSI - OPEN CSG & TBG - NO GAS BLOW - FUNCTION TEST PIPE RAMS.		
07:30	11:00	3.50	ACTIVE	TRIP OUT	CONTINUE TO POOH WITH 2 7/8" PH-6 - PULLED 183 JTS PH-6 TO DERRICK (242 TOTAL) - LD ACCELERATOR - STAND 4 DC - LD HYDRAULIC JARS, X/O, & OS (2 7/8" EUE FISH IN OS) - LD 42.5 JTS 2 7/8" EUE FISHED TBG WITH EOT JET CUT FROM PREVIOUS CUT - FISHED TBG BADLY CORK SCREWED AND BENT.		
11:00	15:00	4.00	ACTIVE	TRIP IN	MURIH WITH 5 3/4" GUIDE SHOE, MOUSE TRAP WITH 1.0" TO 1.75" TAPPERED CATCH, 17 JTS 2 7/8" L80 EUE, X/O, 242 JTS PH-6 FROM DERRICK - STARTING TAKING WEIGHT 240 JTS @ 8.069' - RACK & TALLY PH-6.		
15:00	16:00	1.00	ACTIVE	FISH	CONTINUE RIH WITH ADDITIONAL 33 JTS PH-6 TO TAG OUT @ 9,167' (TOP OF EUE TBG FISH @ 9,219') - PULL TBG INTO NEUTRAL - TORQUE PIPE WITH TONGS - PIPE TORQUES UP IMMEDIATELY - PIPE HANGING +/- 6000# OSW.		
16:00	16:30	0.50	ACTIVE	TRIP OUT	BEGIN TO POOH WITH TBG - PULL 10 STANDS TO DERRICK SHOWING 2,000 TO 6,000# DRAG BOBBLES.		
16:30	17:00	0.50	ACTIVE	SHUTDOWN	SECURE WELL & BOPS - SDFN.		

Rpt# 55, 4/11/2023 05:00 - 4/12/2023 05:00

24 Hour Summary POOH WITH TAPERED TRAP - TIH WITH SAME

Start Time	End Time	Dur (hr)	Ops Status	Operation	Description	NPT
05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI	
06:30	07:00	0.50	ACTIVE	SAFETY	PJSM	
07:00	07:30	0.50	ACTIVE	PCHECK	SITP: 0 PSI, SICP: 0 PSI - OPEN CSG & TBG - NO GAS BLOW - FUNCTION TEST PIPE RAMS.	
07:30	10:00	2.50	ACTIVE	TRIP OUT	CONTINUE TO POOH WITH 2 7/8" PH-6 - STAND BACK 254 JTS (274 TOTAL IN DERRICK) - LD 17 JTS 2 7/8" L80 EUE TBG, X/O & MOUSE TRAP - RECOVERED 4' PIECE OF FRAYED 1 1/4" FG ROD IN TRAP.	
10:00	14:00	4.00	ACTIVE	TRIP IN	MURIH WITH 5 3/4" GUIDE SHOE, MOUSE TRAP WITH 1.0" TO 1.75" TAPPERED CATCH, 17 JTS 2 7/8" L80 EUE, X/O, 274 JTS PH-6 FROM DERRICK - PU 1 JT PH-6 & TAG @ 9,167'.	
14:00	16:30	2.50	ACTIVE	FISH	RE-TAG - TAG UP SOLID @ 9,167' - PULL INTO NEUTRAL - TURN PIPE RH WITH TONGS - TBG TORQUES UP - NO OVER PULL ON PICK-UP - PUMP 100 BBLS 2.0% KCL DWN TBG - RETAG NO CHANGE - NO OVER PULL - LD 1 JT PH-6 - RI POWER SWIVEL - PU 1 JT PH-6 WITH PS - ROTATE DOWN @ 40 RPM WHILE PUMPING DWN TBG @ 2.5 BPM @ 500 PSI - HARD TAG @ 9,167' - PIPE TORQUES UP ON CONTACT - HYDRAULIC BYPASS SET AT 2000 FT/LBS - ROTATE FOR 45 MINS WITH NEG 6000# ON BRIDGE/FISH - BROKE FORWARD CIRC AFTER 200 BBLS AWAY - PU ON PIPE - SWITCH TO REVERSE CIRC - REV CIRC 130% TBG VOLUME (62 BBLS) @ 2.5 BPM @ 500 PSI - NO DEBRIS OR SOLIDS SEEN ON SCREEN @ TANK.	
16:30	17:00	0.50	ACTIVE	SHUTDOWN	SECURE WELL & BOPS - SDFN.	

Rpt# 56, 4/12/2023 05:00 - 4/13/2023 05:00

POOH W/ MOUSE TRAP - TIH W/ W/0S

Start Time	End Time	Dur (hr)	Ops Status	Operation	Description	NPT
05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI	
06:30	07:00	0.50	ACTIVE	SAFETY	PJSM - DISCUSS PINCH POINTS & OVERHEAD HAZZARDS OF LD POWER SWIVEL.	
07:00	10:00	3.00	ACTIVE	TRIP OUT	SITP: 0 PSI, SICP: 0 PSI - WELL DEAD - LD POWER SWIVEL - POOH & STAND 274 JTS PH-6, LD 17 JTS 2-7/8" L80 EUE, X/0 & MOUSE TRAP - TRAP CLEAN NO DEBRIS - POINT ON CUT LIP ROUNDED DUE TO STEEL TO STEEL ROTATION.	
10:00	16:30	6.50	ACTIVE	TRIP IN	TIH WITH: 6.0" X 3 7/8" ID WO SHOE, 2 JTS 5-3/4" WP, TOP BUSHING W/ CUTRITE, 4-1/4" HYDRAULIC JARS, X/O & 274 JTS 2-7/8" PH-6 - RACK, TALLY & PU 15 JTS PH-6 (289 JTS TOTAL) - TAG @ 2,170' - LD 1 JT PH-6.	
16:30	16:30		ACTIVE	LOCATN	TIE BACK DRILL LINE - CHANGE OVER TO YT ELEVATORS.	
16:30	17:00	0.50	ACTIVE	SHUTDOWN	SECURE WELL & BOPS - SDFN.	

Rpt# 57, 4/13/2023 05:00 - 4/14/2023 05:00

24 Hour Summary RU POWER SWIVEL - DRILL AHEAD WITH WASH OVER

Start	End	D (1)	004.4	0	Description	NDT
Time	Time	Dur (hr)	•	Operation	Description	NPT
05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI	
06:30	06:30		ACTIVE	SAFETY	PJSM - DISCUSS PINCH POINTS & OVERHEAD HAZZARDS (POWER SWIVEL).	
06:30	07:00	0.50	ACTIVE	PCHECK	SITP: 0 PSI, SICP: 0 PSI - WELL DEAD.	
07:00	08:00	1.00	ACTIVE	LOCATN	RU POWER SWIVEL - PU 1 JT 2-7/8" PH-6 TBG & STAB STRIPPER HEAD - NU TBG STRIPPER HEAD.	
08:00	08:30	0.50	ACTIVE		ROLL PUMP & CATCH REVERSE CIRC AFTER 15 BBLS AWAY - CIRCULATING @ 2.0 BPM - TAG @ 9,170' & DRILL AHEAD W/ WASHOVER BHA.	
08:30	12:00	3.50	ACTIVE	RMWASH	WASH OVER @ 80 RPM, REV CIRC @ 1.5 BPM - REC FIBERGLASS SHARDS W/ TRACES OF METAL FILINGS - MADE 3.0' @ 9,173' - NO FLUID LOSSES.	
12:00	13:00	1.00	ACTIVE	RMWASH	PU 1 JT PH-6 - WASH OVER @ 80 RPM, REV CIRC @ 1.5 BPM - MILL 10' - DROP THROUGH FOR 8' - MILL 2' - DROP THROUGH FOR 14.5' @ 9,204' - REV CIRC 1 TBG VOL.	

Page 14 of 19 DELAWARE BASIN UNRESTRICTED

Operation Summary (Ascending)

OH - Property #: 38212

Well Name: SEA SNAKE 35 STATE 3H

Sub-Divis	sion NARE B	ASIN	Regio DEL	on LAWARE BASIN	Field Name	vince
Surface L 35-23S	egal Loca S-33E	tion	•	API/UWI 3002542283	Latitude (°) Cround Elevation (ft) 32° 15' 15.941" N Longitude (°) 103° 32' 29.404" W 3,672.00 3,647.00 3,647.00	KB - GL (ft) 25.00
Start Time	End Time	Dur (hr)	Ops Status	Operation	Description	NPT
13:00	13:30	0.50	ACTIVE	RMWASH	PU 1 JT PH-6 - WASH OVER @ 80 RPM, REV CIRC @ 1.5 BPM - DROP WITH A FEW WEIGHT BOBBLES TO 9,235' (TOF@ 9,219') - REV CIRC 1 TBG VOL - 10 BBLS FLUID LOSS.	
13:30	14:00	0.50	ACTIVE	RMWASH	PU 1 JT PH-6 - WASH OVER @ 80 RPM, REV CIRC @ 1.5 BPM - DROP WITH A FEW WEIGHT BOBBLES TO TAG TOP OF WASHOVER X/O BUSHING @ 2,219' (WO MILL @ 2,286') - 12 BBLS FLUID LOSS.	
14:00	15:00	1.00	ACTIVE	CIRC	REVERSE CIRCULATE 100 BBLS (2 TBG VOL) FOR CLEAN UP - TOTAL DAILY FLUID LOSS = 35 BBLS.	
15:00	15:00		ACTIVE	TRIP OUT	RD POWER SWIVEL & STRIPPER HEAD - LD 1 JT PH-6 - CHANGE OVER DRILL LINE - SWAP TO MYT ELEVATORS POOH & STAND 120 JTS TBG.	
15:00	17:00	2.00	ACTIVE	SHUTDOWN	SECURE WELLHEAD & BOPS - SDFN.	

Rpt# 58, 4/14/2023 05:00 - 4/15/2023 05:00

POOH W/ WP - TIH W/ TBG OS

	Start Time	End Time	Dur (hr)	Ops Status	Operation	Description	NPT
ı	05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI	
	06:30	06:30		ACTIVE	SAFETY	PJSM	
	06:30	07:00	0.50	ACTIVE	PCHECK	SITP: 0 PSI, SICP: 0 PSI - WELL DEAD.	
	07:00	09:30	2.50	ACTIVE	TRIP OUT	CONTINUE TO POOH W/ PH-6 & WP BHA - STAND 172 JTS PH-6 (292 TOTAL IN DERRICK) - LD X/O, HYDRAULIC JARS, TOP BUSHING, 2 JTS 5-3/4" WP & WO SHOE.	
	09:30	10:00	0.50	ACTIVE	ВНА	MURIH FISHING BHA AS FOLLOWS: 5-1/2" DRESS-OFF GUIDE, LOWER EXTENSION, 4-11/16 OVER SHOT (2-7/8" GRAPPLE), 3-3/4" BUMPER SUB, 3-3/4" HYDRAULIC JARS, 4 X 3-1/2" DRILL COLLARS, 3-3/4" ACCELERATOR, X/O, 2-7/8" PH-6 TO SURF.	
	10:00	14:00	4.00	ACTIVE	TRIP IN	TIH W/ BHA & 288 JTS PH-6 - TAG TOF @ 9,173' - LD 1 JT.	
	14:00	15:00	1.00	ACTIVE	DRLG	TIE BACK DRILL LINE - SWAP TO YT ELEVATORS - RU POWER SWIVEL - TAG TOP FISH & BURN OVER & DRESS TOP OF 2-7/8" EUE - PULL 30,000 OS - GOOD LATCH - LD POWER SWIVEL.	
	15:00	15:00		ACTIVE	FISH	STRING WEIGHT = 76,000# - CYCLING TBG 45 to 60,000# OSW FIRING JARS - 50 HITS - NO MOVEMENT OF FISH.	
	15:00	17:00	2.00	ACTIVE	SHUTDOWN	SECURE WELLHEAD & BOPS - SDFN.	

Rpt# 59, 4/15/2023 05:00 - 4/16/2023 05:00

CONTINUE TO FISH/JAR 2-7/8" EUE TBG & PACKER - POOH W/ TBG & BHA

Start	End					
Time	Time	Dur (hr)	Ops Status	Operation	Description	NPT
05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI	
06:30	06:30		ACTIVE	SAFETY	PJSM	
06:30	07:00	0.50	ACTIVE	PCHECK	SITP: 0 PSI, SICP: 0 PSI - WELL DEAD - CHECK AND RE-TIGHTEN DERRICK GUY LINES - CHECK TELESCOPIC DERRICK PINS.	
07:00	08:30	1.50	ACTIVE	FISH	SWAP FROM YT TO MYT ELEVATORS - NEUTRAL STRING WEIGHT = 76,000# - CYCLE TBG 55,000# OSW TO FIRE JARS THEN STRAIGHT PULL TO 84,000# OSW (160,000# TOTAL PULL) - REPEAT SAME FOR 30 HITS - PULL FREE.	
08:30	12:30	4.00	ACTIVE	TRIP OUT	SWAP TO YT ELEVATORS - POOH & STAND 288 JTS 2-7/8" PH-6 - LD ACCELERATOR - STAND 4 X 3-1/2" DC - LD 3-3/4" HYDRAULIC JARS, 3-3/4" BUMPER SUB, OS/EXT/DRESS -OFF SHOE - RECOVERED 6 ' PIECE 2-7/8" EUE TBG ON OS - (NOTE: PULLED WET FOR FIRST 22 JTS - EUE TBG BROKE CLEAN @ WEAK SPOT FROM PRIOR WASHOVER RUN CAUSED BY MILLING IN ONE SPOT FOR THE FIRST 3.0' - REFER TO PRIOR DAY WASHOVER RUN).	
12:30	13:00	0.50	ACTIVE	SHUTDOWN	SECURE WELLHEAD & BOPS - SDFN.	

Rpt# 60, 4/17/2023 05:00 - 4/18/2023 05:00

WELL CONTROL CLASS

Start Time	End Time	Dur (hr)	Ops Status	Operation	Description	NPT
05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI	
06:30	14:30	8.00	ACTIVE	SAFETY	HAD WELL CONTROL CLASS	
14:30	05:00	14.50	ACTIVE	SHUTDOWN	SI	

Rpt# 61, 4/18/2023 05:00 - 4/19/2023 05:00

TIH W/SHOE AND DRESS TOF, POOH

	Start	End					1
	Time	Time	Dur (hr)	Ops Status	Operation	Description	NPT
ſ	05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI	
	06:30	07:00	0.50	ACTIVE	SAFETY	PJSM	
	07:00	07:30	0.50	ACTIVE	PCHECK	TSIP 0, CSIP 0	
	07:30	14:00	6.50	ACTIVE		FUNCTION TEST BOP, TIH 4 3/4 CONCAVE MILL WITH 2 1/4 PILOT MILL SKIRTED WITH A 6" FB SHOE WITH LITTLE MESH ID. RAN 293 JTS OF 2 7/8 PH6 WS TAG TOF @9180, RU SWIVEL, AND TUBING STRIPPER, NOTICE MUFFLER ON WSU WAS PARTED AT THE CONNECTION TO THE ENGINE AND COULD SEE SPARKS COMING OUT, SO SECURE WELL SDON, HAD PARTS COMING TO GET WSU FIXED.	
	14:00	05:00	15.00	ACTIVE	SHUTDOWN	SI	

Rpt# 62, 4/19/2023 05:00 - 4/20/2023 05:00

POOH W/SHOE, TIH W/OS

		_,	,							
Start	End									
Time	Time	Dur (hr)	Ops Status	Operation	Description	NPT				
05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI					
06:30	07:00	0.50	ACTIVE	SAFETY	PJSM					
07:00	07:30	0.50	ACTIVE	PCHECK	TSIP 0, CSIP 0					
07:30	10:30	3.00	ACTIVE	DRLG	FUNCTION TEST BOP, BROKE CIRCULATION, DRESS TOF FROM 9180' DOWN TO 9182'					
					CIRCULATED WELL CLEAN HAD METAL SHAVINGS IN RETURNS.					

devon

Operation Summary (Ascending)

OH - Property #: 38212

Wall	Namo:	SEV	SNVKE	25	STATE 3H	

Sub-Divis	ion		R	STATE 3H		Field Name		County	State/Provi	nce
	VARE B egal Local		טן	ELAWARE BASIN		THISTLE tude (°)	Longitude (°)	LEA Orig KB Elevation (1	ft) Ground Elevation (ft)	KB - GL (ft)
35-238				3002542283		° 15 ^ì 15.941" N	103° 32' 29.404" W	3,672.00	3,647.00	25.00 `
Start Time	End Time	Dur (hr)	Ops Status	Operation			Description			NPT
10:30	17:00	6.50	ACTIVE	TRIP OUT			TUBING STRIPPER, PO THEM AWHILE TO GET			
							3/4 CONCAVE MILL AND			
					SDON.					
7:00	05:00	12.00	ACTIVE	SHUTDOWN	SI					
Rpt# 6	3, 4/20/	2023 05	5:00 - 4/21/20	23 05:00						
	Summary	LWI CI	JT TBG, POO)LI						
Start	End	T WE CO								
Time 05:00	Time 06:30	Dur (hr)	Ops Status ACTIVE	Operation SHUTDOWN	SI		Description			NPT
06:30	07:00		ACTIVE	SAFETY	PJSM					
07:00	07:30		ACTIVE	PCHECK	TSIP 0, CSIP	0				
07:30	11:00	3.50	ACTIVE	TRIP IN			4 11/16 OS W/ 2 7/8 GR			
						· · · · · · · · · · · · · · · · · · ·	ED ON TO FISH @9182	•		
11:00	14:00	3.00	ACTIVE	WIRELINE			T TOOL, TAG TOP OF R FREE @10,000', TIH WI			
					COULDN'T G	SET PASS 9703', C	AME OUT AND CHANG			
						•	BING @9,994', RD WL.			
4:00	16:30		ACTIVE	TRIP OUT		20 JTS SLOWLY	TUBING DRAGGING 20	PTS OVER, SE	CURE WELL SDON.	
6:30	05:00	12.50	ACTIVE	SHUTDOWN	SI					
Rpt# 6	4, 4/21/	2023 05	:00 - 4/22/20	23 05:00						
	Summary /FISH									
Start	End									
Time 5:00	Time 06:30	Dur (hr)	Ops Status ACTIVE		SI		Description			NPT
6:30	07:00		ACTIVE	SAFETY	PJSM					
7:00	07:30		ACTIVE	PCHECK	TSIP 0, CSIP	0				
7:30	13:00		ACTIVE	TRIP OUT	<i>'</i>		NUE POOH WITH FISH	PULLED 6 MOR	E JTS, HUNG UP,	
							LUCK, RU PUMP AND			
							IUE OUT WITH 267 JTS E, TOTAL OF 25 JTS 2			
						ING WAS BENT L		770 200, 010, 10	J. (@10.000.	
3:00	16:00	3.00	ACTIVE	TRIP IN			W/1 1/4 INSERT, 17 JTS	S OF 2 7/8 L80, X	X-0VER, 104 JTS 2	
	05.00	40.00	A OT!) (E			SECURE WELL S	SDON.			
6:00	05:00	13.00	ACTIVE	SHUTDOWN	SI					
Rpt# 6	5, 4/22/	2023 05	:00 - 4/23/20	23 05:00						
	Summary		OOH W/FISH	1						
Start	End	INAF, FO								
Time 05:00	Time 06:30	Dur (hr)	Ops Status ACTIVE	Operation SHUTDOWN	SI		Description			NPT
6:30	07:00		ACTIVE	SAFETY	PJSM					
7:00	07:30		ACTIVE	PCHECK	TSIP 0, CSIP	0				
7:30	11:00	3.50	ACTIVE	TRIP IN	FUNCTION T	TEST BOP, CONTI	NUE TIH WITH MOUSE	TRAP, TAGGED	@9571' W/JT 289,	
						OOL DOWN TO 99				
1:00	16:00	5.00	ACTIVE	TRIP OUT			' JTS 2 7/8 L80, AND MC RI INSIDE TOOL. SECU			
6:00	05:00	13.00	ACTIVE	SHUTDOWN	ISI	7.E01 01 1 0 DED	11 11401BE 100E. 0E00	THE WELL OBT V	. .	
	6, 4/24/3 Summary	2023 05	5:00 - 4/25/20	23 05:00						
		ETRAP,	POOH W/F	SH						
Start Time	End Time	Dur (hr)	Ops Status	Operation			Description			NPT
5:00	06:30	1.50	ACTIVE	SHUTDOWN	SI					
	07:00		ACTIVE	SAFETY	PJSM					
7:00	07:30		ACTIVE	PCHECK	TSIP 0, CSIP		E 2/4 MOURE TRAD 10	ITC OF 0.7/0.1	20 V OVED 202 IT	
7:30	12:00	4.50	ACTIVE	TRIP IN			5 3/4 MOUSE TRAP, 10 KED TOOL MADE COU		50, ∧- UVEK, 306 JI,	
2:00	16:00	4.00	ACTIVE	TRIP OUT		•	R, LD 10 JTS OF 2 7/8 L8		SE TRAP W/6"	
							N, SECURE WELL SDO			
6:00	05:00	13.00	ACTIVE	SHUTDOWN	SI					
pt# 6	7, 4/25/	2023 05	5:00 - 4/26/20	23 05:00						
4 Hour S	Summary									
CHANO Start	GE OUT	BOP, T	<mark>TIH W/SHOE</mark> T	AND WP						
Time	Time	Dur (hr)	Ops Status	· ·			Description			NPT
5:00	06:30		ACTIVE		SI					
6:30 7:00	07:00 07:30		ACTIVE ACTIVE	SAFETY	PJSM TSIP 0, CSIP	2.0				
7:00 7:30	10:00		ACTIVE		· · · · · · · · · · · · · · · · · · ·		EST NEW BOP, RD WO	RK FLOOR ND	USED BOP NU	
	. 5.55	2.50		23.3		U WORK FLOOR		LOOK, ND	1111 DOI, NO	
0:00	14:00	4.00	ACTIVE	TRIP IN			V/MESH ID AND DIAMO			
					TOP BUSHIN	NG W/CUTRITE, 4 VN, SECURE WEL	1/4 JARS, X-OVER, RAN	N 210 JTS OF 2	7/8 PH6 WS, WSU	
4:00	05:00	15.00	ACTIVE		ISI	VIN, SECURE WEL	L SDON.			
+.00	03.00	13.00	ACTIVE	SHOTDOWN	OI .					
<u>. </u>		2023 05	:00 - 4/27/20	23 05:00						
	Summary SHOE \	WASH (OVER							
Start	End									
Time 5:00	Time 06:30	Dur (hr)	Ops Status ACTIVE	Operation SHUTDOWN	SI		Description			NPT
	07:00		ACTIVE	SAFETY	PJSM					
						Dogo 1				ntod: 1/4/202

Page 13/16

DELAWARE BASIN UNRESTRICTED

Operation Summary (Ascending)

OH - Property #: 38212

Well Name: SEA SNAKE 35 STATE 3H

	ion VARE B	ASIN		^{ion} LAWARE BASIN		Field Name THISTLE		County LEA	State/Prov	vince
	egal Locat		- -	API/UWI	Lat	titude (°)	Longitude (°) 103° 32' 29.404" W	Orig KB Elevation (ft) Ground Elevation (ft)	KB - GL (ft) 25.00
5-235 Start	End			3002542283	32	2° 15' 15.941" N		3,672.00	3,647.00	
Time 7:00	Time 07:30	Dur (hr)	Ops Status ACTIVE	Operation PCHECK	TSIP 0, CSIF	P 0	Description			NPT
7:30	13:30		ACTIVE	TRIP IN	WSU WAS E CONTINUE BROKE CIR	BROKE DOWN, MI TIH TAG @9919' V CULATION WASH	ECHANIC WORKED ON, VITH JT #311, RU TUBIN DOWN TO 9931', HAD F CONTINUE WASHING O	IG STRIPPER AIFG CUTTINGS IN	ND POWER SWIVEL,	,
3:30	17:00	3.50	ACTIVE	SHUTDOWN	SI	LLE ODON, WILL	SONTHING WAGHING O	V LIV IIV A.IVI.		
n## 6	9 4/27/	2023 05	:00 - 4/28/202	3.05:00						
Hour :	Summary			3 03.00						
VASH Start	OVER,	POOH	W/SHOE							
Time	Time	Dur (hr)	Ops Status	Operation	01		Description			NPT
05:00 06:30	06:30 07:00		ACTIVE ACTIVE	SHUTDOWN	SI PJSM					
7:00	07:30		ACTIVE	PCHECK	TSIP 0, CISE	P 0				
7:30	11:30		ACTIVE	DRLG	FUNCTION T JT #312 SHO	TEST BOP, BROKI OE STOP MAKING	E CIRCULATION WASH HOLE, TUBING START	ED TO PSI UP, D	ECIDED TO POOH.	
11:30	17:00	5.50	ACTIVE	TRIP OUT	OF WP AND	SHOE, WIRES W	BING STRIPPER, POOH IAS MISSING AND DIAM LED WET. SECURE WEI	OND WERE FOI	, , , , , , , , , , , , , , , , , , ,	
7:00	05:00	12.00	ACTIVE	SHUTDOWN	SI					
2nt# 7	0 4/29/	2023 05	:00 - 4/29/202	3 05-00						
4 Hour	Summary	_020 00	.50 - 7/25/202	0.00						
TH W	SHOE End									
Time	Time	Dur (hr)	Ops Status	Operation	CI		Description			NPT
05:00 05:00	05:00 05:00		ACTIVE ACTIVE	SHUTDOWN	SI PJSM					
5:00	05:00		ACTIVE	PCHECK	TSIP 0, CSIF	P 0				
5:00	05:00		ACTIVE	TRIP IN	FUNCTION 7		T TO TIH W/ SHOE, WIN	ID STARTED BL	OWING, COULDN'T	
)5.00	05:00		ACTIVE	CHITDOWN	TIH					
)5:00	05:00		ACTIVE	SHUTDOWN	SI					
•	,	2023 05	:00 - 4/30/202	3 05:00						
	Summary /SHOE \	NASH (OVER							
Start Time	End Time	Dur (hr)	Ops Status	Operation			Description			NPT
5:00	06:30	1.50	ACTIVE	SHUTDOWN	SI		2 0 3 0 1 ption			IN I
06:30	07:00		ACTIVE	SAFETY	PJSM					
)7:00)7:30	16:00		ACTIVE ACTIVE	PCHECK TRIP IN	EXTENSION OVER, 316 S PREVIOUS	TEST BOP, TIH WAN WITH 2 SETS OF JTS 2 7/8 PH6 WS TRIP, RU POWER	/ 6' FB SHOE W/ 2 7/8 ID F FINGERS, TOP BUSHII , TAGGED HIGH @9928 SWIVEL AND TUBING S HAD FG CUTTINGS IN R	NG W/CUT RITE ', HAD WASH DO STRIPPER, WAS	, 4 1/4 JARS, X- DWN TO 9946' H DOWN TO 9940',	
16:00	05:00	13.00	ACTIVE	SHUTDOWN	SI	D WELL CLEAN, I	IAD I G COTTINGS IN IN	LIONNS.SECO	NE WELL SDTW.	
74# 7	2 5/4/2/	000 05.4	00 5/0/0000	NE-00						
4 Hour	Summary		00 - 5/2/2023 (75.00						
VASH	OVER,	POOH	W/SHOE							
Ctort							Description			
Start Time	Time	Dur (hr)	Ops Status	Operation						NPT
Time 05:00	Time 06:30	1.50	ACTIVE	SHUTDOWN	SI P.ISM					NPT
Time 05:00 06:30	Time	1.50 0.50			PJSM TSIP 0, CSIF	2 0	·			NPT
Time	Time 06:30 07:00	1.50 0.50 0.50	ACTIVE ACTIVE	SHUTDOWN SAFETY	PJSM TSIP 0, CSIF FUNCTION TO 9951', SH	TEST BOP, BROKI HOE STOP MAKIN	E CIRCULATION, CONTI IG HOLE, CIRCULATED POWER SWIVEL AND T	WELL CLEAN, I	HAD FG AND METAL	
Time 05:00 06:30 07:00 07:30	Time 06:30 07:00 07:30	1.50 0.50 0.50 9.00	ACTIVE ACTIVE ACTIVE	SHUTDOWN SAFETY PCHECK	PJSM TSIP 0, CSIF FUNCTION TO 9951', SE CUTTINGS I	TEST BOP, BROKI HOE STOP MAKIN	IG HOLE, CIRCULATED	WELL CLEAN, I	HAD FG AND METAL	
7:00 17:00 17:30 17:30 17:30	Time 06:30 07:00 07:30 16:30 05:00	1.50 0.50 0.50 9.00	ACTIVE ACTIVE ACTIVE ACTIVE	SHUTDOWN SAFETY PCHECK RMWASH	PJSM TSIP 0, CSIF FUNCTION TO 9951', SE CUTTINGS I SDON.	TEST BOP, BROKI HOE STOP MAKIN	IG HOLE, CIRCULATED	WELL CLEAN, I	HAD FG AND METAL	
75:00 06:30 07:00 07:30 76:30 77:30	Time 06:30 07:00 07:30 16:30 05:00 05:00	1.50 0.50 0.50 9.00 12.50	ACTIVE ACTIVE ACTIVE ACTIVE	SHUTDOWN SAFETY PCHECK RMWASH	PJSM TSIP 0, CSIF FUNCTION TO 9951', SE CUTTINGS I SDON.	TEST BOP, BROKI HOE STOP MAKIN	IG HOLE, CIRCULATED	WELL CLEAN, I	HAD FG AND METAL	
Time 05:00 06:30 07:00 07:30 16:30 Rpt# 7	Time 06:30 07:00 07:30 16:30 05:00 3, 5/2/2/ Summary W/SHO End	1.50 0.50 0.50 9.00 12.50 023 05:0	ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE	SHUTDOWN SAFETY PCHECK RMWASH SHUTDOWN	PJSM TSIP 0, CSIF FUNCTION TO 9951', SE CUTTINGS I SDON.	TEST BOP, BROKI HOE STOP MAKIN	IG HOLE, CIRCÚLATED POWER SWIVEL AND T	WELL CLEAN, I	HAD FG AND METAL	
Time 05:00 06:30 07:00 07:30 0	Time 06:30 07:00 07:30 16:30 05:00 3, 5/2/2/2	1.50 0.50 0.50 9.00 12.50 023 05:0	ACTIVE ACTIVE ACTIVE ACTIVE	SHUTDOWN SAFETY PCHECK RMWASH SHUTDOWN 05:00	PJSM TSIP 0, CSIF FUNCTION TO 9951', SE CUTTINGS I SDON.	TEST BOP, BROKI HOE STOP MAKIN	IG HOLE, CIRCULATED	WELL CLEAN, I	HAD FG AND METAL	
Time 05:00 06:30 07:00 07:30 16:30 Rpt# 7 24 Hour s POOH Start Time 05:00	Time 06:30 07:00 07:30 16:30 05:00 3, 5/2/26 Summary W/SHO End Time	1.50 0.50 0.50 9.00 12.50 023 05:0 E	ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE On - 5/3/2023 (SHUTDOWN SAFETY PCHECK RMWASH SHUTDOWN 05:00	PJSM TSIP 0, CSIF FUNCTION TO 9951', SI CUTTINGS I SDON. SI	TEST BOP, BROKI HOE STOP MAKIN	IG HOLE, CIRCÚLATED POWER SWIVEL AND T	WELL CLEAN, I	HAD FG AND METAL	
Time 05:00 06:30 07:00 07:30 (6:30 Rpt# 7 4 Hours POOH Start Time 05:00 06:30 07:00	Time 06:30 07:00 07:30 16:30 05:00 3, 5/2/2/ W/SHO End Time 06:30 07:00 07:30	1.50 0.50 0.50 9.00 12.50 023 05:1 Dur (hr) 1.50 0.50 0.50	ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE Ops Status ACTIVE ACTIVE ACTIVE ACTIVE	SHUTDOWN SAFETY PCHECK RMWASH SHUTDOWN 05:00 Operation SHUTDOWN SAFETY PCHECK	PJSM TSIP 0, CSIF FUNCTION TO 9951', SI CUTTINGS I SDON. SI SI PJSM TSIP 0, CSIF	TEST BOP, BROK HOE STOP MAKIN IN RETURNS, RD	IG HOLE, CIRCÚLATED POWER SWIVEL AND T Description	WELL CLEAN, I	HAD FG AND METAL ER, SECURE WELL	
Time 05:00 06:30 07:00 07:30 16:30 Rpt# 7	Time 06:30 07:00 07:30 16:30 05:00 3, 5/2/2/ W/SHO End Time 06:30 07:00	1.50 0.50 0.50 9.00 12.50 023 05:1 Dur (hr) 1.50 0.50 0.50	ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE Ope Status ACTIVE ACTIVE ACTIVE	SHUTDOWN SAFETY PCHECK RMWASH SHUTDOWN 05:00 Operation SHUTDOWN SAFETY	PJSM TSIP 0, CSIF FUNCTION TO 9951', SE CUTTINGS ISDON. SI SI PJSM TSIP 0, CSIF FUNCTION EXTENSION WAS PACKE	TEST BOP, BROK HOE STOP MAKIN IN RETURNS, RD P 0 TEST BOP, POOH NS 4' 6' WITH FINGED WITH FG RODE	IG HOLE, CIRCÚLATED POWER SWIVEL AND T	PH6 WS, X-OVI N/ 27/8 ID. EXTE 13' OF IT. WILL	ER, TOP BUSHING, SNSIONS AND SHOE GO BACK WITH	NPT
Time 15:00 16:30 17:00 17:30 16:30 16:30 16:30 16:30 16:30 17:00 17:30	Time 06:30 07:00 07:30 16:30 05:00 3, 5/2/2/ W/SHO End Time 06:30 07:00 07:30	1.50 0.50 0.50 9.00 12.50 023 05:0 E Dur (hr) 1.50 0.50 0.50 7.00	ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE Ops Status ACTIVE ACTIVE ACTIVE ACTIVE	SHUTDOWN SAFETY PCHECK RMWASH SHUTDOWN 05:00 Operation SHUTDOWN SAFETY PCHECK	PJSM TSIP 0, CSIF FUNCTION TO 9951', SF CUTTINGS ISDON. SI SI PJSM TSIP 0, CSIF FUNCTION TEXTENSION WAS PACKE SAME KIND	TEST BOP, BROK HOE STOP MAKIN IN RETURNS, RD P 0 TEST BOP, POOH NS 4' 6' WITH FINGED WITH FG RODE	Description WITH 317 JTS OF 2 7/8 SERS AND 6" FB SHOE VS AND LOTS OF DEBRI	PH6 WS, X-OVI N/ 27/8 ID. EXTE 13' OF IT. WILL	ER, TOP BUSHING, SNSIONS AND SHOE GO BACK WITH	NPT
Time 15:00 16:30 17:00 17:30 17:30 16:30 17:30 16:30 17:30 16:30 17:00 17:30 17:30 17:30	Time 06:30 07:00 07:30 16:30 05:00 3, 5/2/20 Summary W/SHO End Time 06:30 07:30 14:30	1.50 0.50 0.50 9.00 12.50 023 05:0 E Dur (hr) 1.50 0.50 0.50 7.00	ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE Ops Status ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE	SHUTDOWN SAFETY PCHECK RMWASH SHUTDOWN D5:00 Operation SHUTDOWN SAFETY PCHECK TRIP OUT SHUTDOWN	PJSM TSIP 0, CSIF FUNCTION TO 9951', SE CUTTINGS ISDON. SI SI PJSM TSIP 0, CSIF FUNCTION EXTENSION WAS PACKE SAME KIND OUT.	TEST BOP, BROK HOE STOP MAKIN IN RETURNS, RD P 0 TEST BOP, POOH NS 4' 6' WITH FINGED WITH FG RODE	Description WITH 317 JTS OF 2 7/8 SERS AND 6" FB SHOE VS AND LOTS OF DEBRI	PH6 WS, X-OVI N/ 27/8 ID. EXTE 13' OF IT. WILL	ER, TOP BUSHING, SNSIONS AND SHOE GO BACK WITH	NPT
Time 15:00 16:30 17:00 17:30 6:30 17:30 6:30 17:30 6:30 17:30 6:30 17:00 17:30 4:30 4:30 4:40 4 Hour:	Time 06:30 07:00 07:30 16:30 05:00 3, 5/2/20 Summary W/SHO End Time 06:30 07:00 07:30 14:30	1.50 0.50 0.50 9.00 12.50 023 05:10 1.50 0.50 0.50 7.00 14.50 023 05:10	ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE Ops Status ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE	SHUTDOWN SAFETY PCHECK RMWASH SHUTDOWN D5:00 Operation SHUTDOWN SAFETY PCHECK TRIP OUT SHUTDOWN	PJSM TSIP 0, CSIF FUNCTION TO 9951', SE CUTTINGS ISDON. SI SI PJSM TSIP 0, CSIF FUNCTION EXTENSION WAS PACKE SAME KIND OUT.	TEST BOP, BROK HOE STOP MAKIN IN RETURNS, RD P 0 TEST BOP, POOH NS 4' 6' WITH FINGED WITH FG RODE	Description WITH 317 JTS OF 2 7/8 SERS AND 6" FB SHOE VS AND LOTS OF DEBRI	PH6 WS, X-OVI N/ 27/8 ID. EXTE 13' OF IT. WILL	ER, TOP BUSHING, SNSIONS AND SHOE GO BACK WITH	NPT
Time 15:00 16:30 17:00 17:30 6:30 17:30 6:30 17:30 6:30 17:30 6:30 17:00 17:30 4:30 4:30 4:40 4 Hour:	Time 06:30 07:00 07:30 16:30 05:00 3, 5/2/20 Summary W/SHO End Time 06:30 07:00 07:30 14:30	1.50 0.50 0.50 9.00 12.50 023 05:10 1.50 0.50 0.50 7.00 14.50 023 05:10	ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE Ops Status ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE	SHUTDOWN SAFETY PCHECK RMWASH SHUTDOWN D5:00 Operation SHUTDOWN SAFETY PCHECK TRIP OUT SHUTDOWN	PJSM TSIP 0, CSIF FUNCTION TO 9951', SE CUTTINGS ISDON. SI SI PJSM TSIP 0, CSIF FUNCTION EXTENSION WAS PACKE SAME KIND OUT.	TEST BOP, BROK HOE STOP MAKIN IN RETURNS, RD P 0 TEST BOP, POOH NS 4' 6' WITH FINGED WITH FG RODE	Description WITH 317 JTS OF 2 7/8 SERS AND 6" FB SHOE VS AND LOTS OF DEBRI	PH6 WS, X-OVI N/ 27/8 ID. EXTE 13' OF IT. WILL	ER, TOP BUSHING, SNSIONS AND SHOE GO BACK WITH	NPT
Time 15:00 16:30 17:00 17:30 16:30 17:30 16:30 16:30 16:30 16:30 17:30 16:30 17:30 16:30 17:30 17:30 18:30 1	Time 06:30 07:00 07:30 16:30 05:00 3, 5/2/20 Summary W/SHO 06:30 07:30 14:30 05:00 4, 5/3/20 Summary UTING O End Time	1.50 0.50 0.50 9.00 12.50 023 05:0 1.50 0.50 0.50 7.00 14.50 0X SHOR	ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE OD - 5/3/2023 (Ops Status ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE OD - 5/4/2023 (ES Ops Status	SHUTDOWN SAFETY PCHECK RMWASH SHUTDOWN D5:00 Operation SHUTDOWN SAFETY PCHECK TRIP OUT SHUTDOWN Operation Operation	PJSM TSIP 0, CSIF FUNCTION TO 9951', SE CUTTINGS ISDON. SI SI PJSM TSIP 0, CSIF FUNCTION EXTENSION WAS PACKE SAME KIND OUT. SI	TEST BOP, BROK HOE STOP MAKIN IN RETURNS, RD P 0 TEST BOP, POOH NS 4' 6' WITH FINGED WITH FG RODE	Description WITH 317 JTS OF 2 7/8 SERS AND 6" FB SHOE VS AND LOTS OF DEBRI	PH6 WS, X-OVI N/ 27/8 ID. EXTE 13' OF IT. WILL	ER, TOP BUSHING, SNSIONS AND SHOE GO BACK WITH	NPT
Time 15:00 16:30 17:00 17:30 16:30 16:30 16:30 16:30 16:30 16:30 17:30 18:30 1	Time 06:30 07:00 07:30 16:30 05:00 3, 5/2/20 Summary W/SHO 06:30 07:30 14:30 4, 5/3/20 Summary UTING O End Time 06:30	1.50 0.50 0.50 9.00 12.50 023 05:0 1.50 0.50 0.50 0.50 7.00 14.50 N SHOR	ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE OD - 5/3/2023 (Ops Status ACTIVE	SHUTDOWN SAFETY PCHECK RMWASH SHUTDOWN D5:00 Operation SHUTDOWN SAFETY PCHECK TRIP OUT SHUTDOWN SHUTDOWN SAFETY PCHECK TRIP OUT	PJSM TSIP 0, CSIF FUNCTION TO 9951', SE CUTTINGS ISDON. SI SI PJSM TSIP 0, CSIF FUNCTION EXTENSION WAS PACKE SAME KIND OUT. SI SI	TEST BOP, BROK HOE STOP MAKIN IN RETURNS, RD P 0 TEST BOP, POOH NS 4' 6' WITH FINGED WITH FG RODE	Description WITH 317 JTS OF 2 7/8 GERS AND 6" FB SHOE VS AND LOTS OF DEBRIE TO GET A SHOE BUIL	PH6 WS, X-OVI N/ 27/8 ID. EXTE 13' OF IT. WILL	ER, TOP BUSHING, SNSIONS AND SHOE GO BACK WITH	NPT
Time 15:00 16:30 17:00 17:30 16:30 17:30 16:30 17:30 16:30 17:30 18:30 1	Time 06:30 07:00 07:30 16:30 05:00 3, 5/2/20 Summary W/SHO 06:30 07:30 14:30 05:00 4, 5/3/20 Summary UTING O End Time	1.50 0.50 0.50 9.00 12.50 023 05:0 1.50 0.50 0.50 7.00 14.50 0.50 N SHOR Dur (hr) 1.50 0.50	ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE OD - 5/3/2023 (Ops Status ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE OD - 5/4/2023 (ES Ops Status	SHUTDOWN SAFETY PCHECK RMWASH SHUTDOWN D5:00 Operation SHUTDOWN SAFETY PCHECK TRIP OUT SHUTDOWN Operation SHUTDOWN SHUTDOWN SHUTDOWN SHUTDOWN Operation SHUTDOWN	PJSM TSIP 0, CSIF FUNCTION TO 9951', SE CUTTINGS ISDON. SI SI PJSM TSIP 0, CSIF FUNCTION EXTENSION WAS PACKE SAME KIND OUT. SI	TEST BOP, BROK HOE STOP MAKIN IN RETURNS, RD P 0 TEST BOP, POOH NS 4' 6' WITH FINGED WITH FG RODE	Description WITH 317 JTS OF 2 7/8 GERS AND 6" FB SHOE VS AND LOTS OF DEBRIE TO GET A SHOE BUIL	PH6 WS, X-OVI N/ 27/8 ID. EXTE 13' OF IT. WILL	ER, TOP BUSHING, SNSIONS AND SHOE GO BACK WITH	NPT
Time 15:00 16:30 17:00 17:30 16:30 17:30 16:30 16:30 16:30 16:30 17:30 16:30 17:30 16:30 17:30 17:30 18:30 1	Time 06:30 07:00 07:30 16:30 05:00 3, 5/2/20 Summary W/SHO 06:30 07:00 07:30 14:30	1.50 0.50 0.50 9.00 12.50 023 05:0 1.50 0.50 0.50 7.00 14.50 0.50	ACTIVE ACTIVE ACTIVE ACTIVE ACTIVE OD - 5/3/2023 (Ops Status ACTIVE	SHUTDOWN SAFETY PCHECK RMWASH SHUTDOWN D5:00 Operation SHUTDOWN SAFETY PCHECK TRIP OUT SHUTDOWN Operation SHUTDOWN SAFETY SHUTDOWN SAFETY SHUTDOWN SAFETY	PJSM TSIP 0, CSIF FUNCTION TO 9951', SI CUTTINGS I SDON. SI SI PJSM TSIP 0, CSIF FUNCTION EXTENSION WAS PACKE SAME KIND OUT. SI SI PJSM CSIP 0	TEST BOP, BROK HOE STOP MAKIN IN RETURNS, RD P 0 TEST BOP, POOH NS 4' 6' WITH FINGED WITH FG RODE	Description WITH 317 JTS OF 2 7/8 GERS AND 6" FB SHOE VS AND LOTS OF DEBRI E TO GET A SHOE BUILL Description	PH6 WS, X-OVI N/ 27/8 ID. EXTE 13' OF IT. WILL	ER, TOP BUSHING, SNSIONS AND SHOE GO BACK WITH	NPT

devon

Operation Summary (Ascending)

OH - Property #: 38212

Well I	Name:	SEA	SNAKE 35 S	STATE 3H						
Sub-Divis	ion VARE B	ASIN	Regio DEL	AWARE BASIN	EAST	Field Name THISTLE		County LEA	State/Prov NM	ince
Surface L	egal Locat		152	API/UWI		Latitude (°)	Longitude (°)	Orig KB Elevation (ft)	Ground Elevation (ft)	KB - GL (ft)
35-23S		023 05·0	00 - 5/5/2023 0	3002542283		32° 15' 15.941" N	103° 32' 29.404" W	3,672.00	3,647.00	25.00
24 Hour S	Summary			0.00						
Start	SHOE A	AND WA	ASH OVER							
Time 05:00	Time 06:30	Dur (hr)	Ops Status ACTIVE	Operation SHUTDOWN	SI		Description			NPT
06:30	07:00		ACTIVE	SAFETY	PJSM					
07:00	07:30		ACTIVE	PCHECK	CSIP 0					
07:30	16:00	8.50	ACTIVE	TRIP IN		ON TEST BOP, TIH 6" F				
						S, 2 JTS 5 3/4 WP, TOP WS, TAG 9951', RU PO				
					CIRCULA	ATIÓN, WASH DOWN T	O 9956', 5 FT TOTAL,	CIRCULATED WEL		
40:00	05.00	40.00	A OTIVE	CHITDOWAL		METAL CUTTINGS IN F	RETURNS, SECURE W	'ELL SDON.		
16:00	05:00	13.00	ACTIVE	SHUTDOWN	SI					
	•	023 05:0	00 - 5/6/2023 0	5:00						
24 Hour S WASH	OVER I	FISH								
Start Time	End Time	Dur (hr)	Ops Status	Operation			Description			NPT
05:00	06:30		ACTIVE		SI		·			
06:30	07:00		ACTIVE	SAFETY	PJSM	OUD 0				
07:00 07:30	07:30 16:30		ACTIVE ACTIVE	PCHECK RMWASH	TSIP 0, C	ON TEST BOP, BROKE	CIRCUII ATION CONTII	NI IE WASH OVER	FROM 9956'	
07.50	10.00	3.00	TOTIVE	TAMWY AGIT	DOWN T	O 9967', PU OFF BOTT	TOM AND CIRCULATED	WELL CLEAN, HA		
16.00	05.00	10.50	ACTIVE	CHLITDOMAN		UTTINGS IN RETURNS	S, SECURE WELL SDC	DN.		
16:30	05:00	12.50	ACTIVE	SHUTDOWN	SI					
Rpt# 7	•	023 05:0	00 - 5/7/2023 0	5:00						
POOH	W/ SHC	DE								
Start Time	End Time	Dur (hr)	Ops Status	Operation			Description			NPT
05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI					
06:30	07:00		ACTIVE	SAFETY	PJSM	OCID O				
07:00 07:30	07:30 14:00		ACTIVE	PCHECK TRIP OUT	TSIP 0, C	SSIP 0 ON TEST BOP. POOH V	VITH 313 ITS 2 7/8 PH	6 WS X-OVER TO	PRUSHING 2	
07.50	14.00	0.50	AOTIVE	11111 001	JTS WP,	EXTENSION WITH FIN	IGERS, 2 JTS WP, AND	SHOE. RECOVER	RED 10' OF FG	
					RODS AN	ND DEBRI INSIDE SHO	E AND WP. LD ALL OF	YELLOW JACKET	TOOLS. SECURE	
14:00	05:00	15.00	ACTIVE	SHUTDOWN	SI) VV.				
D=4# 7	0 5/0/0/	000 05.4	00 5/0/2022 0	F-00						
24 Hour S	Summary		00 - 5/9/2023 0	5.00						
TIH W/	SHOE,	WASH	OVER							
Time	Time 06:30	Dur (hr)	Ops Status ACTIVE	Operation SHUTDOWN	SI		Description			NPT
06:30	07:00		ACTIVE	SAFETY	PJSM					
07:00	07:30		ACTIVE	PCHECK	CSIP 0					
07:30	17:00	9.50	ACTIVE	TRIP IN		ON TEST BOP, TIH WIT				
						ION W/2 SETS OF FINO 18 JTS 2 7/8 PH6 WS,				
47.00	05.00	40.00	A OTIV /F	OLULTDOMAI		STRIPPER, SECURE V	VELL SDON.			
17:00	05:00	12.00	ACTIVE	SHUTDOWN	SI					
	•	023 05:0	00 - 5/10/2023	05:00						
24 Hour S WASH										
Start Time	End Time	Dur (hr)	Ops Status	Operation			Description			NPT
05:00	06:30	1.50	ACTIVE	SHUTDOWN	SI					
06:30	07:00		ACTIVE	SAFETY	PJSM	OUD 0				
07:00 07:30	07:30 17:00		ACTIVE ACTIVE	PCHECK DRLG	TSIP 0, C	CSIP 0 ON TEST BOP, BROKE	CIRCUI ATION WASH	DOWN FROM 886	7' DOWN TO	
37.50	17.00	0.50	. TOTIVE	DILEG	9982' 15'	TOTAL, SHOE STOP N	MAKING HOLE, DECIDI	ED TO POOH, CIRC	CULATE WELL	
						IAD FG AND METAL CU ND TUBING STRIPPE				
17:00	05:00	12.00	ACTIVE	SHUTDOWN	SI SI					
Rnt# 9	0. 5/10/	2023.05	5:00 - 5/11/2023	3 05:00						
24 Hour S	Summary									
POOH Start	W/SHO End	ı⊑, IIH\	W/NEW SHOE							
Time	Time	Dur (hr)		Operation	CI		Description			NPT
05:00 06:30	06:30 07:00		ACTIVE ACTIVE	SHUTDOWN SAFETY	SI PJSM					
07:00	07:30		ACTIVE	PCHECK	TIP 0, CS	SIP 0				
07:30	12:30	5.00	ACTIVE	TRIP OUT		ON TEST BOP, POOH V				
						EXTENSION W/FINGEF ORN DOWN PRETTY B.				
12:30	17:00	4.50	ACTIVE	TRIP IN	TIH WAV	Y BOTTOM SHOE 3 7/8	8 ID, 1 JT 5 3/4 WP, EX	TENSION W/2 SET	OF FINGERS, 1	
						WP, TOP SUB, 4 1/14 J	ARS, X-OVER, RAN 23	4 JTS OF PH6 WS	FROM DERRICK.	
17:00	05:00	12 00	ACTIVE	SHUTDOWN	SECURE	WELL SDON.				
		l			<u> </u>					
D-44 0	-	2023 05	5:00 - 5/12/2023	3 05:00						
24 Hour S	Summary									
24 Hour S WASH	OVEŘ I	FISH								
24 Hour S WASH Start Time	OVER I End Time	Dur (hr)		Operation			Description			NPT
24 Hour S WASH Start Time 05:00	OVER I End Time	Dur (hr)	Ops Status ACTIVE ACTIVE		SI PJSM		Description			NPT

Page 15/16

DELAWARE BASIN UNRESTRICTED

Operation Summary (Ascending)

OH - Property #: 38212

Sub-Divis	ion VARE B	MISAS	Regi	on LAWARE BASIN	Field Name EAST THISTLE		County LEA	State/Pro	/ince			
	egal Locat		IDE	API/UWI	Latitude (°) Longitude (°) Orig KB Elevation (ft) Ground Elevation				·			
35-23S	-33E			3002542283	32° 15' 15.941" N	103° 32' 29.404" W	3,672.00	3,647.00	25.00			
Start Time	End Time	Dur (hr)	Ops Status	Operation		Description			NP ⁻			
07:00	07:30		ACTIVE	PCHECK	TSIP 0, CSIP 0							
07:30	17:00	9.50	ACTIVE	TRIP IN	SWIVEL AND TUBING STRIPPER SHOE PLUGGED UP, TRIED TO AND STRIPPER. STARTED OUT, ROTATED TUBING WORKED ST UNPLUGGED, PUMPED DOWN (CTION TEST BOP, CONTINUE TIH W/NEW SHOE, TAGGED 9964', RU POWER VEL AND TUBING STRIPPER, BROKE CIRCULATION, STARTED WASHING OVER, DE PLUGGED UP, TRIED TO UNPLUG, NO LUCK, DECIDED TO POOH, RD SWIVEL STRIPPER. STARTED OUT, SHOE HUNG UP @9886', HAD TO RU SWIVEL AGAIN, ATED TUBING WORKED STUCK TUBING FINALLY CAME FREE, TUBING PLUGGED, PUMPED DOWN CASING, HAD GOOD CIRCULATION, SLOWLY RAN DE BACK DOWN TO 9964' CIRCULATING EVERY CONNECTION, CIRCULATE WELL						
17:00	05:00	12.00	ACTIVE	SHUTDOWN	SI							
		2023 05	:00 - 5/13/202	3 05:00								
	Summary OVER	FISH										
Start	End											
Time 05:00	Time 06:30	Dur (hr)	Ops Status ACTIVE	Operation SHUTDOWN	SI	Description			NP ⁻			
06:30	07:00		ACTIVE	SAFETY	PJSM							
07:00	07:30		ACTIVE	PCHECK	TSIP 0, CSIP 0							
07:30	16:00		ACTIVE	RMWASH	TOIL 0, 001 TO THE OF T	HOME, CIRCULATED RNS, RD POWER SV	WELL CLEAN, GE	TTING BACK FG				
16:00	05:00	13.00	ACTIVE	SHUTDOWN	SI							
Rpt# 8	3. 5/15/	2023 05	:00 - 5/16/202	3 05:00								
24 Hour S POOH	Summary W/SHO		NEW SHOE									
Start Time	End Time	Dur (hr)	Ops Status	Operation		Description			NP ⁻			
05:00	06:30		ACTIVE		SI							
06:30	07:00		ACTIVE	SAFETY	PJSM							
07:00 07:30	07:30 12:00		ACTIVE ACTIVE	PCHECK TRIP OUT	TSIP 0, CSIP 0 FUNCTION TEST BOP, POOH W BUSHING 2 JTS WP W/FINGERS DOWN.		,	,				
12:00	16:00	4.00	ACTIVE	TRIP IN	TIH 6" WAVY BOTTOM SHOE, EX JARS, X-OVER, 316 JTS, RU PO' SECURE WELL SDON.	,	,					
16:00	04:00	12.00	ACTIVE	SHUTDOWN	SI							
•	•	2023 05	:00 - 5/17/202	3 05:00								
	Summary OVER.	LD WS	AND TOOLS									
Start	End			Ι								
Time 05:00	Time 06:30	Dur (hr)	Ops Status ACTIVE	Operation SHUTDOWN	SI	Description			NP ⁻			
06:30	07:00		ACTIVE	SAFETY	PJSM							
07:00	07:30		ACTIVE		TSIP 0, CSIP 0							
07:30	12:00		ACTIVE	RMWASH	FUNCTION TEST BOP, BROKE (ABOUT A 1', SWIVEL WOULD ST OF MORNING, WAS TOLD THEY CIRCULATED WELL CLEAN HAD	ALL OUT PU ON TUB CALLED IT GOOD O	ING AND LOSE H	OLE, DID MOST				
12:00	17:00	5.00	ACTIVE	TRIP OUT	RD POWER SWIVEL AND TUBIN SECURE WELL SDON.			S AND LD,				
17:00	05:00	12.00	ACTIVE	SHUTDOWN	SI							
Rpt# 8	5, 5 <u>/</u> 17/	2023 05	:00 - 5/18/202	3 05:00								
	Summary S. ND BC	OP. NU	WH, RD WSU									
Start	End			T _								
Time 05:00	Time 06:30	Dur (hr)	Ops Status ACTIVE	Operation SHUTDOWN	SI	Description			NP'			
06:30	07:00		ACTIVE	SAFETY	PJSM							
07:00	07:30		ACTIVE	PCHECK	TSIP 0, CSIP 0							
07:30	11:00		ACTIVE	TRIP OUT	FUNCTION TEST BOP, CONTINU BUSHING, 1 JT WP AND SHOE. I			VER, TOP				
11:00	12:00	2.00	ACTIVE	BOPS	RD TONGS AND WORK FLOOR	ND BOD NITTWH WIT	TH ANK DA ADADT	ED EL ANGE WITH				

RD WSU, LOADED UP WS AND PIPE RACKS, CLEAN LOC.

RD TONGS AND WORK FLOOR, ND BOP, NU WH, WITH 10K B1 ADAPTER FLANGE WITH 5K BALL VALVE AND GAUGE, SI WELL.

13:00

16:00

05:00

11:00

13:00

16:00

2.00 ACTIVE

3.00 ACTIVE

13.00 ACTIVE

BOPS

RIGD

SHUTDOWN

NO REPORT

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 300127

CONDITIONS

Operator:	OGRID:
DEVON ENERGY PRODUCTION COMPANY, LP	6137
333 West Sheridan Ave.	Action Number:
Oklahoma City, OK 73102	300127
	Action Type:
	[C-103] Sub. Workover (C-103R)

CONDITIONS

Created By	Condition	Condition Date
kfortne	Submit Plan going forward	1/16/2024