

Form 3160-5
(June 2019)

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
OMB No. 1004-0137
Expires: October 31, 2021

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

5. Lease Serial No.

6. If Indian, Allottee or Tribe Name

SUBMIT IN TRIPLICATE - Other instructions on page 2

7. If Unit of CA/Agreement, Name and/or No.

1. Type of Well

Oil Well Gas Well Other

8. Well Name and No.

2. Name of Operator

9. API Well No.

3a. Address

3b. Phone No. (include area code)

10. Field and Pool or Exploratory Area

4. Location of Well (Footage, Sec., T.,R.,M., or Survey Description)

11. Country or Parish, State

12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Hydraulic Fracturing	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input type="checkbox"/> Other
	<input type="checkbox"/> Change Plans	<input type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.)

14. I hereby certify that the foregoing is true and correct. Name (Printed/Typed)

Title

Signature

Date

THE SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

Title

Date

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office

Title 18 U.S.C Section 1001 and Title 43 U.S.C Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

Additional Information

Location of Well

0. SHL: SWSW / 870 FSL / 1020 FWL / TWSP: 32N / RANGE: 7W / SECTION: 25 / LAT: 36.94656 / LONG: -107.523749 (TVD: 0 feet, MD: 0 feet)

BHL: SWSW / 870 FSL / 1020 FWL / TWSP: 32N / SECTION: / LAT: 36.94656 / LONG: 107.523749 (TVD: 0 feet, MD: 0 feet)



HILCORP ENERGY COMPANY
Burnt Mesa 1B
Frac Isolation
API: 3004533275

JOB PROCEDURES

NMOCD **Contact OCD and BLM (where applicable) 24 hrs prior to MIRU or running MITs. Record and document all casing pressures daily, including BH, IC (if present) and PC. Comply with all NMOCD, BLM (where applicable), and HEC safety**

BLM

1. MIRU workover rig and associated equipment; NU and test BOP.
2. Scan out with **2-3/8"** tubing set at **8,217'**
3. RIH bit and scraper to **8,120** to clean wellbore, POOH.
4. Set CIBP 50' above top of Dakota perforations **+/-8,105'**. Set packer at **+/-6,320'**, load hole with 2% KCl, pressure test down tubing to ensure bridge plug is set.
5. Leave well isolated for 9-12 months.
6. Move in slickline, RIH and set three slip stop in Mesa Verde interval (**4,863'-6,271'**), perforate above stop, drop plunger, and produce MV.
7. With 100% working interest, Hilcorp will be leaving the Dakota zone temporarily abandoned and produce from the Mesa Verde formation alone.



HILCORP ENERGY COMPANY

Burnt Mesa 1B

Frac Isolation

Burnt Mesa 1B - CURRENT WELLBORE SCHEMATIC




Current Schematic - Version 3

Well Name: BURNT MESA #1B

API / UWI 3004533275	Surface Legal Location 025-032N-007W-M	Field Name SUNCO MESA/ENC (GRATED GAS)	Block 0507	State/Province NEW MEXICO	Well Configuration Type VERTICAL
Ground Elevation (ft) 6,648.00	Original NTRM Elevation (ft) 6,663.00	Tubing Hanger Elevation (ft)	Head to GL (ft) 15.00	Well Casing Range Distance (ft)	Well Tubing Hanger Distance (ft)

Original Hole [VERTICAL]

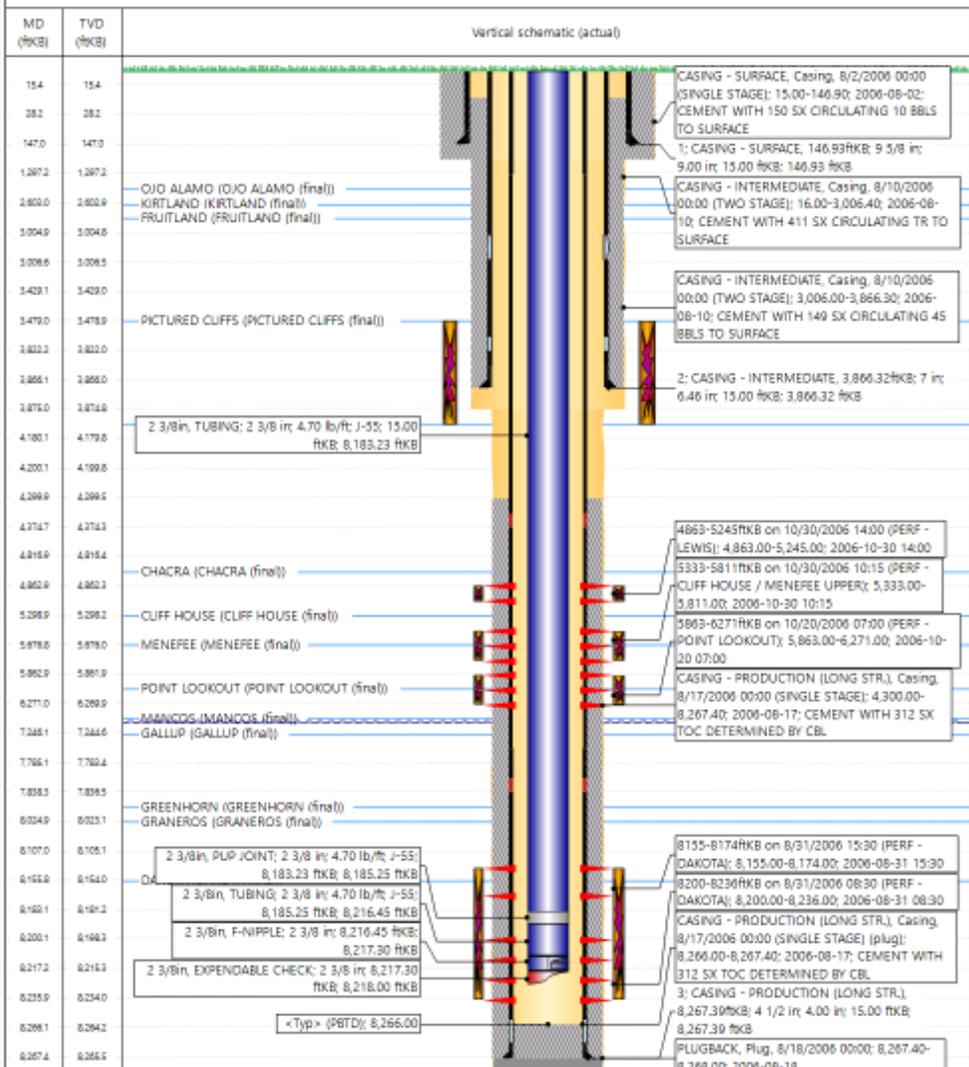



HILCORP ENERGY COMPANY

Burnt Mesa 1B

Frac Isolation

Burnt Mesa 1B - PROPOSED WELLBORE SCHEMATIC

Proposed




Current Schematic - Version 3

Well Name: BURNT MESA #1B

API / UWI 3004633275	Surface Leg Location 025-032N-007W-M	Field Name BLANCO HILLS AREA (PROPOSED)	House 0507	State/Province NEW MEXICO	Well Configuration Type VERTICAL
Ground Elevation (ft) 6,648.00	Original KBRT Elevation (ft) 6,663.00	Tubing Hanger Elevation (ft)	RKB to GL (ft) 16.00	KB-Casing Flange Distance (ft)	KB-Tubing Hanger Distance (ft)

Original Hole [VERTICAL]

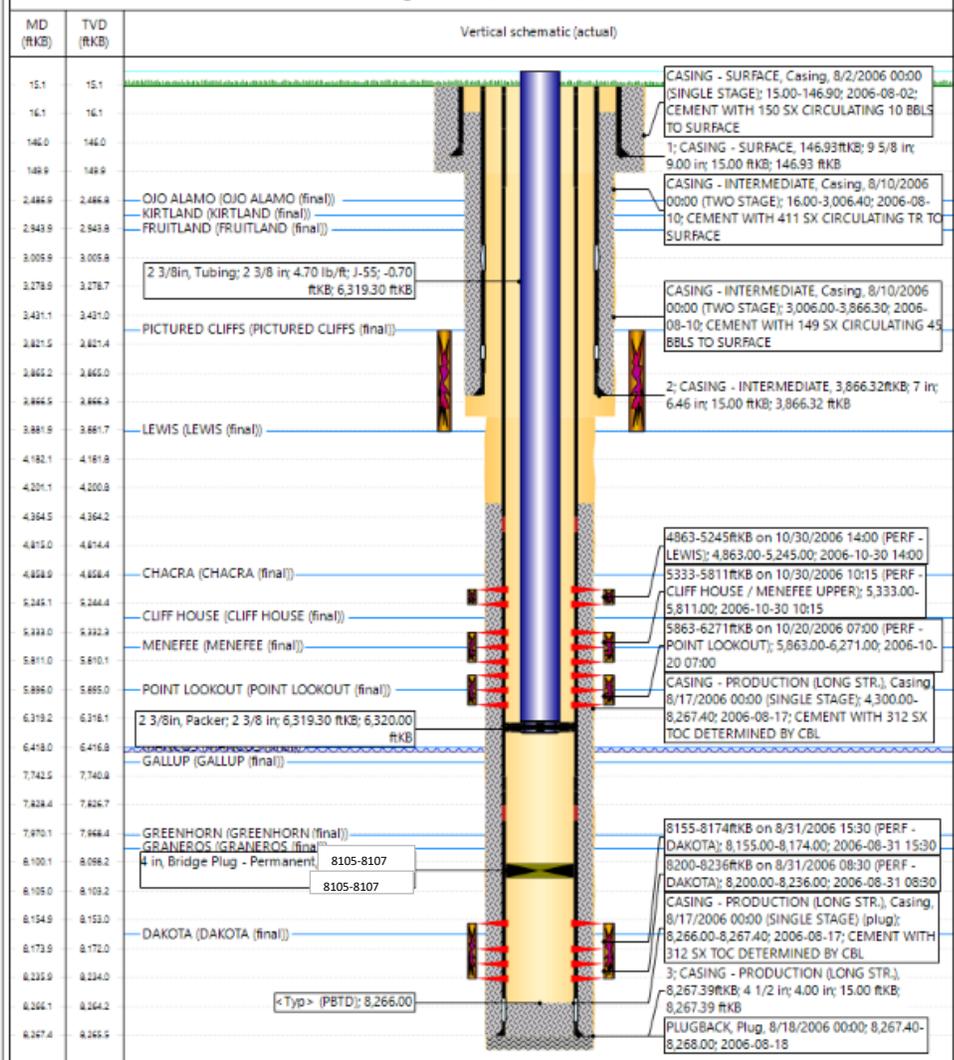

www.peloton.com

Page 1/1

Report Printed: 7/18/2024

District I
 1625 N. French Dr., Hobbs, NM 88240
 Phone:(575) 393-6161 Fax:(575) 393-0720
District II
 811 S. First St., Artesia, NM 88210
 Phone:(575) 748-1283 Fax:(575) 748-9720
District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
 1220 S. St Francis Dr., Santa Fe, NM 87505
 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS
 Action 367848

CONDITIONS

Operator: HILCORP ENERGY COMPANY 1111 Travis Street Houston, TX 77002	OGRID: 372171
	Action Number: 367848
	Action Type: [C-103] NOI Workover (C-103G)

CONDITIONS

Created By	Condition	Condition Date
dmcclure	Operator approved to isolate the well only and shall submit another NOI requesting approval to conduct additional work prior to reconfiguring the well to bring it back to production and after submission of a SR detailing the work to isolate the well.	7/31/2024