

Santa Fe Main Office
Phone: (505) 476-3441
General Information
Phone: (505) 629-6116

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised July 18, 2013

Online Phone Directory Visit:
<https://www.emnrd.nm.gov/ocd/contact-us/>

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-015-10254
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator Sandlott Energy (Jackie Brewer DBA)		6. State Oil & Gas Lease No.
3. Address of Operator P.O. Box 711 Lovington, NM 88260		7. Lease Name or Unit Agreement Name Resler Yates State
4. Well Location Unit Letter F: 1650 feet from the North line and 1650 feet from the West line Section 21 Township 18S Range 28E NMPM Eddy County		8. Well Number #317
11. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. OGRID Number 154329
10. Pool name or Wildcat (3230) Artesia; Queen-Grayburg-San Andres		

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒ TEMPORARILY ABANDON ☐ CHANGE PLANS ☐ PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐ DOWNHOLE COMMINGLE ☐ CLOSED-LOOP SYSTEM ☐ OTHER: ☐		SUBSEQUENT REPORT OF: REMEDIAL WORK ☐ ALTERING CASING ☐ COMMENCE DRILLING OPNS. ☐ P AND A ☐ CASING/CEMENT JOB ☐ OTHER: ☐	
--	--	--	--

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Please see attached procedure & wellbore schematics

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE _____ TITLE _____ DATE _____

Type or print name _____ E-mail address: _____ PHONE: _____

For State Use Only

APPROVED BY: _____ TITLE _____ DATE _____

Conditions of Approval (if any):

*Mewbourne Oil Company***Plug and Abandon**

Submitted By: C. Key

Wellname: RESLER YATES 317**Location:** 1650' FNL & 1650' FWL; Sec 21, T18S, R28E;
Eddy CO., NM**Date:** August 6, 2025**API #:** 30-015-10254**Surf Csg Set:** 8 5/8" 32# L.W.**Csg Size:** 4 1/2" 9.5# J.55**Set @:** 549'**Set @:** 2397'**Inter #1:** ~**Perfs:** 2074'-2082'**Set @:** ~


Well is to be plugged & abandoned.

Procedure:

1. MIRU plugging crew.
2. ND WH & NU BOP.
3. POOH w/rods and tbg
4. Run wireline w/4 1/2 CIBP
5. Set CIBP @ 2050' (Top perf @ 2074)
6. Fill csg & test to 500# for 30 minutes
7. Run wireline & CBL to surface
8. RIH w/tbg & tag CIBP
9. Spot 10 sks Class C neat cmt (150' +/-) on top CIBP. (Grayburg @2359, Queen @2073')
10. WOC 6 hrs & tag plug @ 1917' or higher
11. Lay down pipe to 609'
12. Circulate approximately 42 sks Class C neat cmt to surface.
13. POOH w/tbg
14. WOC & confirm wellbore remains full
15. Cut off WH & install dry hole marker. Cut off anchors & clean location

*Mewbourne Oil Company***Plug and Abandon**


Vertical schematic (actual)

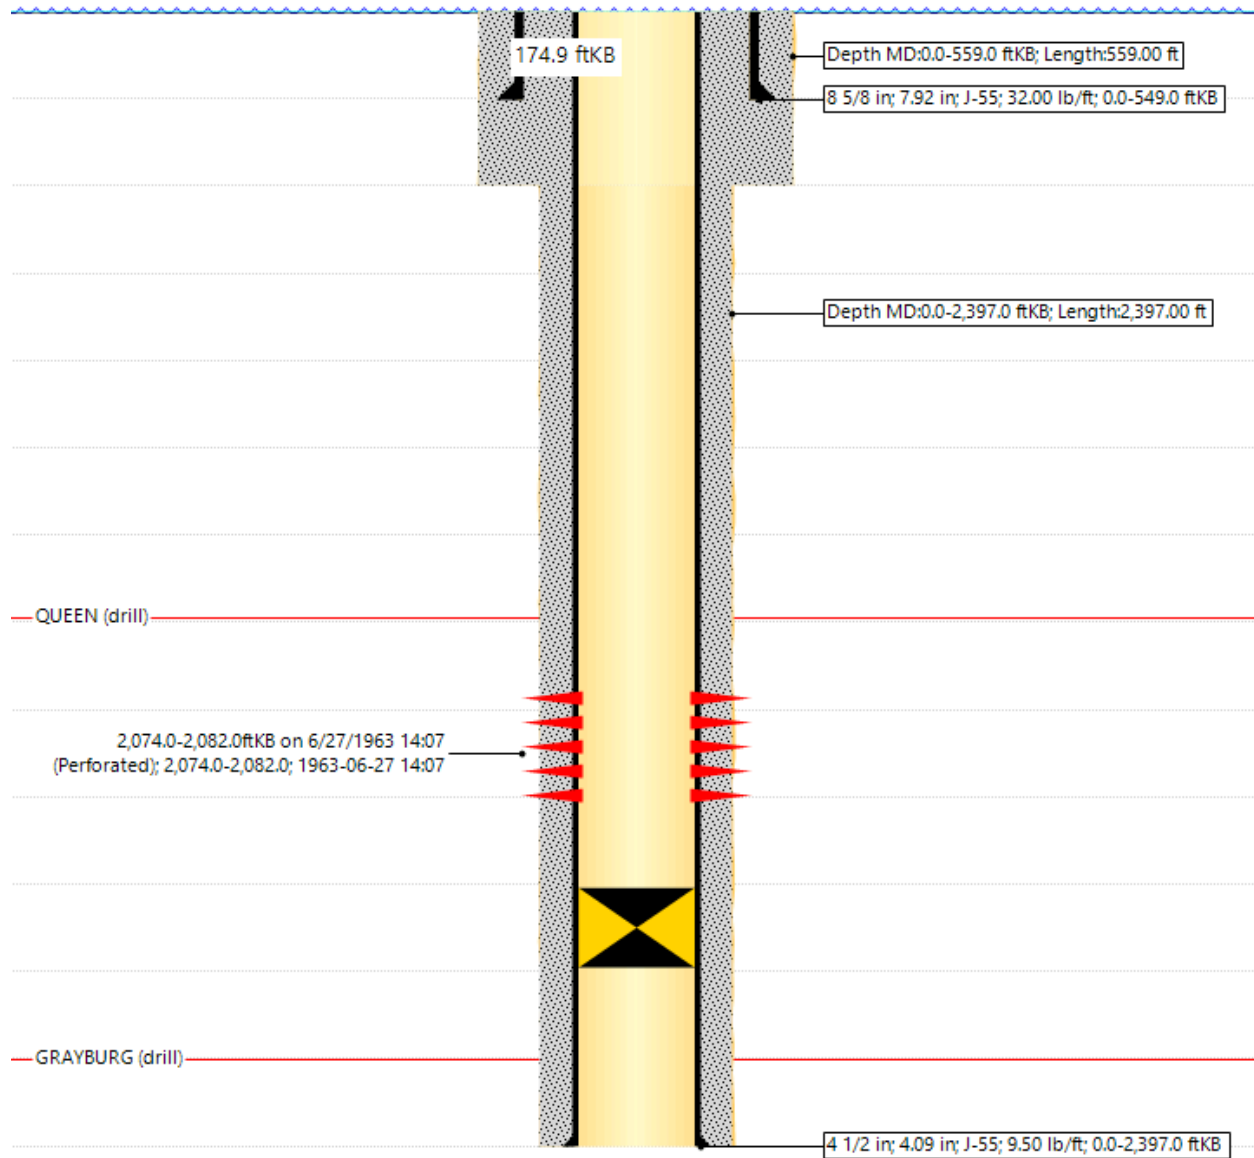

Mewbourne Oil Company

Plug and Abandon

Vertical schematic (proposed)

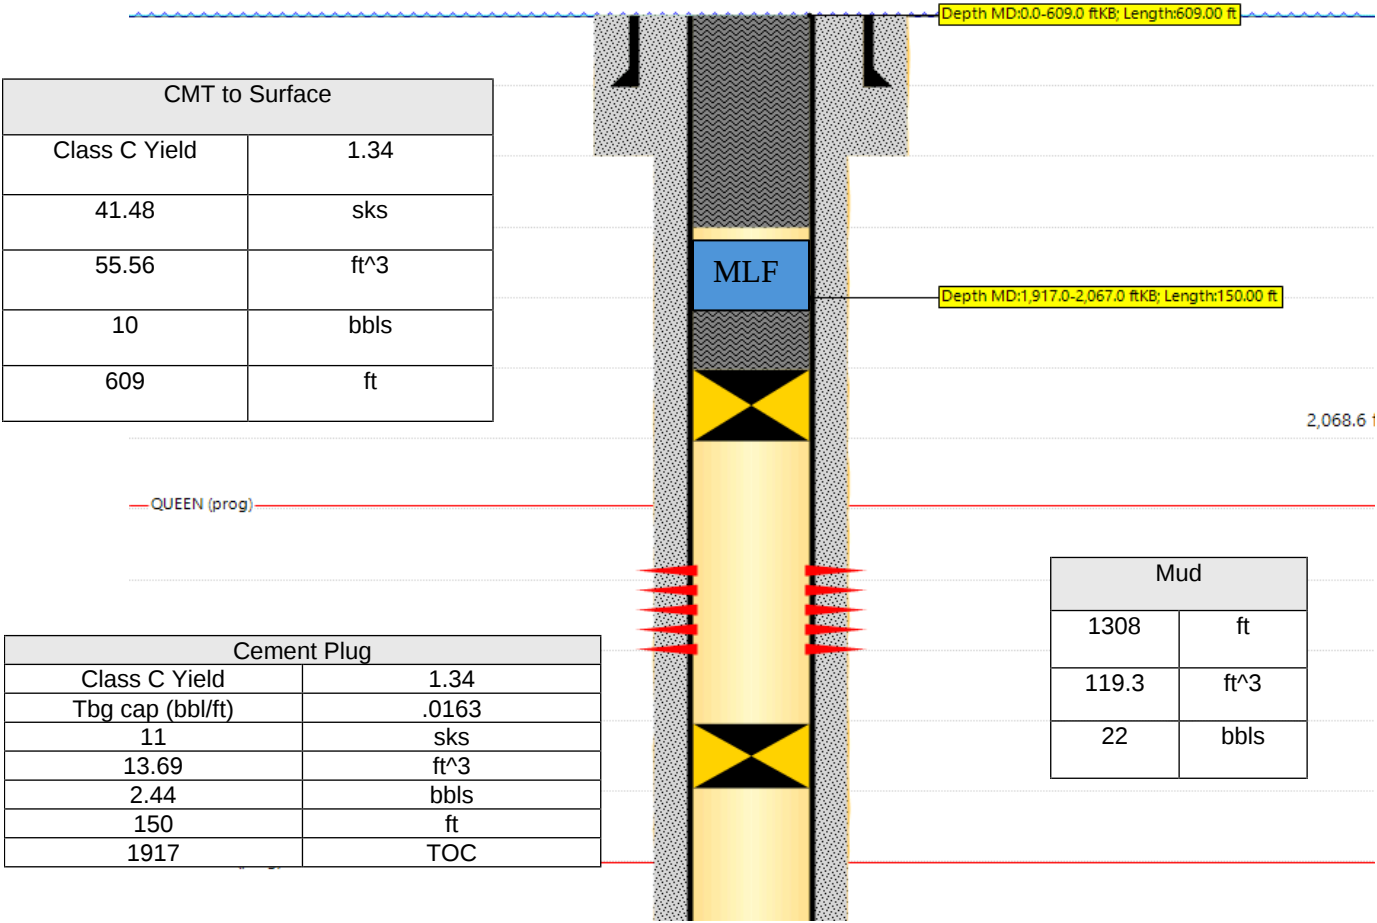

Santa Fe Main Office
Phone: (505) 476-3441
General Information
Phone: (505) 629-6116

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised July 18, 2013

Online Phone Directory Visit:

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO.

30015-10234

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

Resler Yates State

8. Well Number 4317

9. OGRID Number

154329

10. Pool name or Wildcat (3230)

Artesia, Queen-Grayburg San Andre

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

Sandlott Energy (Jackie Brewer DBA)

3. Address of Operator P.O. Box 711

Lovington, NM 88260

4. Well Location

Unit Letter P; 1650 feet from the North line and 1650 feet from the West line

Section 21 Township 18N Range 28E NMPM 1000 County

11. Elevation (Show whether DR, RKB, RT, GR, etc.)

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPL ☐

DOWNHOLE COMMINGLE ☐

CLOSED-LOOP SYSTEM ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐

ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐

P AND A ☐

CASING/CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Please see attached procedure & wellbore schematics

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

Jackie Brewer

TITLE

DATE

9/25/2025

Type or print name

E-mail address:

PHONE:

For State Use Only

APPROVED BY:

TITLE

DATE

Conditions of Approval (if any):

Plug and Abandon


Submitted By: C. Key

Wellname: RESLER YATES 317**Location:** 1650' FNL & 1650' FWL; Sec 21, T18S, R28E;
Eddy CO., NM**Date:** August 6, 2025**API #:** 30-015-10254**Surf Csg Set:** 8 5/8" 32# L.W.**Csg Size:** 4 1/2" 9.5# J.55**Set @:** 549'**Set @:** 2397'**Inter #1:** ~**Perfs:** 2074'-2082'**Set @:** ~

Well is to be plugged & abandoned.


Procedure:

1. MIRU plugging crew.
2. ND WH & NU BOP.
3. POOH w/rods and tbg
4. Run wireline w/4 1/2 CIBP
5. Set CIBP @ 2050' (Top perf @ 2074)
6. Fill csg & test to 500# for 30 minutes
7. Run wireline & CBL to surface
8. RIH w/tbg & tag CIBP
9. Spot 10 sks Class C neat cmt (150' +/-) on top CIBP. (Grayburg @2359, Queen @2073')
10. WOC 6 hrs & tag plug @ 1917' or higher
11. Lay down pipe to 609'
12. Circulate approximately 42 sks Class C neat cmt to surface.
13. POOH w/tbg
14. WOC & confirm wellbore remains full
15. Cut off WH & install dry hole marker. Cut off anchors & clean location

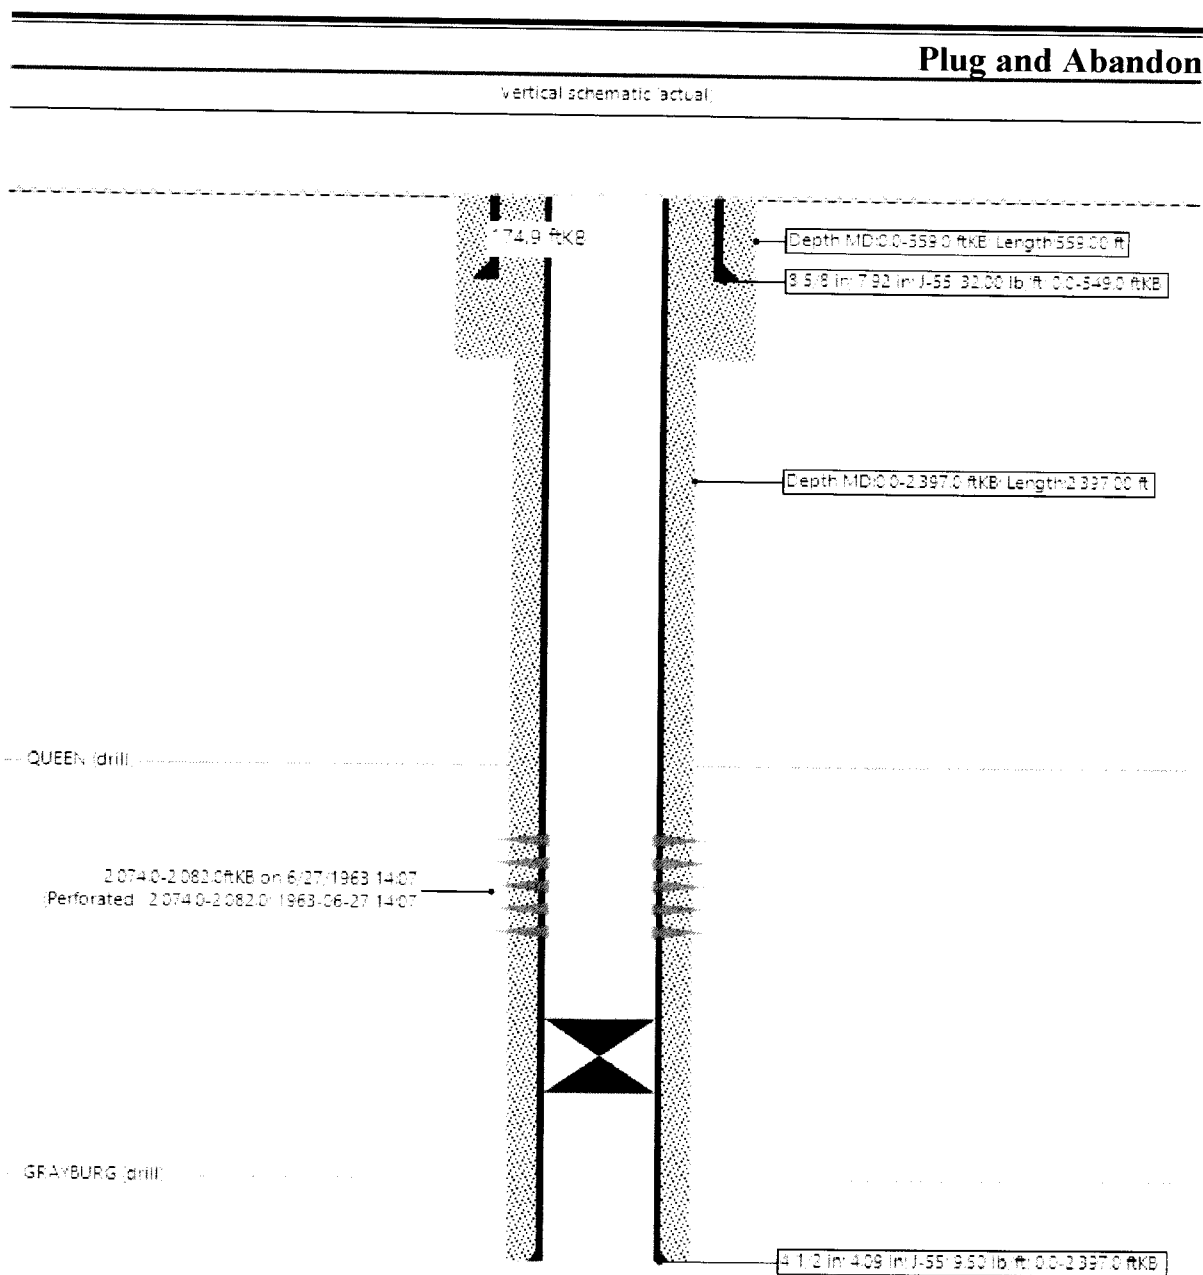

Plug and Abandon

Vertical schematic proposed:

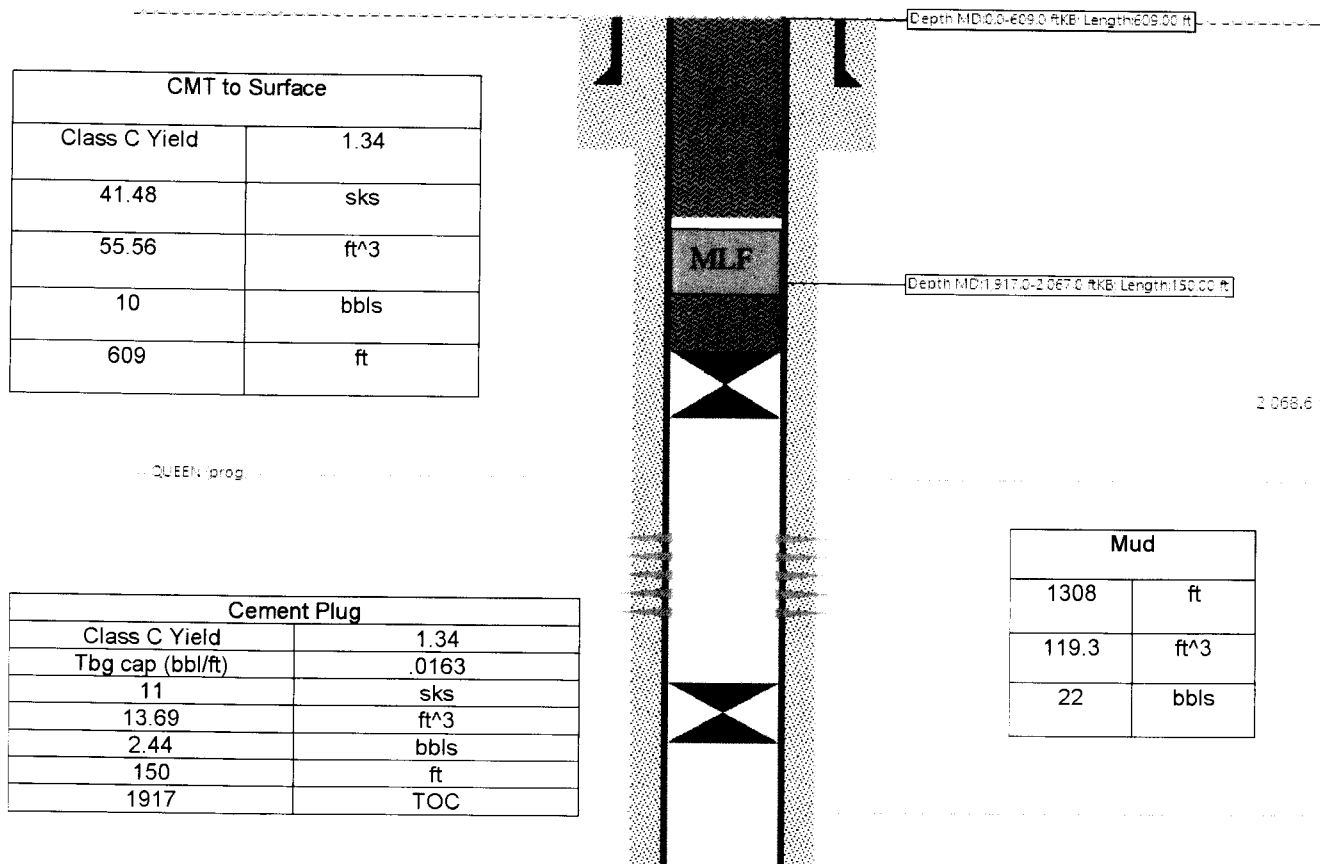

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 517919

CONDITIONS

Operator: MEWBOURNE OIL CO P.O. Box 5270 Hobbs, NM 88241	OGRID: 14744
	Action Number: 517919
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
loren.diede	Notify the OCD inspection supervisor via email 24 hours prior to beginning Plug & Abandon (P&A) operations.	10/24/2025
loren.diede	NMOCD does not consider this well to be within the LPCH restricted area and an above ground P&A marker is required. NMOCD has picked the Queen formation top at 1580'. Please adjust the Queen plug to match. NMOCD requires that plug (s) be added to cover the 7 Rivers = (1068') and Yates = (674') formation tops. Submit photo and GPS coordinates of the P&A marker with the final P&A reports. The API# on the marker is to be clearly legible. Run CBL from CIBP to surface. Submit the CBL tif file to NMOCD for uploading into the Well Log File.	10/24/2025