U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Sundry Print Report

Well Name: JETER Well Location: T25N / R13W / SEC 1 / County or Parish/State: SAN

SESE / 36.426524 / -108.166045 JUAN / NM

Well Number: 1S Type of Well: OTHER Allottee or Tribe Name:

Lease Number: NMSF078155 Unit or CA Name: Unit or CA Number:

US Well Number: 300453299000S1 **Operator:** DUGAN PRODUCTION

CORPORATION

Notice of Intent

Sundry ID: 2884970

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 12/02/2025 Time Sundry Submitted: 03:38

Date proposed operation will begin: 12/10/2025

Procedure Description: Dugan Production plans to plug and abandon the well per the attached procedure.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

Jeter_1S_Rec_Plan_10_21_25_20251202153603.pdf

Jeter_1S_proposed_PA_formation_tops_20251202153540.pdf

 ${\sf Jeter_1S_proposed_PA_planned_wellbore_schematic_20251202153531.pdf}$

Jeter_1S_proposed_PA_current_wellbore_schematic_20251202153524.pdf

Jeter_1S_proposed_PA_planned_work_20251202153514.pdf

eceived by OCD: 12/3/2025 4:13:00 PM Well Name: JETER

Well Location: T25N / R13W / SEC 1 /

SESE / 36.426524 / -108.166045

County or Parish/State: SAN 2 of

JUAN / NM

Well Number: 1S

Type of Well: OTHER

Allottee or Tribe Name:

Lease Number: NMSF078155

Unit or CA Name:

Unit or CA Number:

US Well Number: 300453299000S1

Operator: DUGAN PRODUCTION

CORPORATION

Conditions of Approval

Specialist Review

2884970_1S_3004532990_NOIA_KR_12032025_20251203160117.pdf

Jeter_1S_Geo_KR_20251203160117.pdf

General_Requirement_PxA_20251203160053.pdf

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: TYRA FEIL Signed on: DEC 02, 2025 03:37 PM

Name: DUGAN PRODUCTION CORPORATION

Title: Authorized Representative **Street Address:** PO BOX 420

City: FARMINGTON State: NM

Phone: (505) 325-1821

Email address: TYRAFEIL@DUGANPRODUCTION.COM

Field

Representative Name: Aliph Reena

Street Address: PO Box 420

City: Farmington State: NM Zip: 87499-0420

Phone: (505)360-9192

Email address: Aliph.Reena@duganproduction.com

BLM Point of Contact

BLM POC Name: KENNETH G RENNICK BLM POC Title: Petroleum Engineer

BLM POC Phone: 5055647742 BLM POC Email Address: krennick@blm.gov

Disposition: Approved **Disposition Date:** 12/03/2025

Signature: Kenneth Rennick


Page 2 of 2

Dugan Production plans to plug and abandon the well per the following procedure:

- Run 4½" casing scraper to 1130'. RIH & set 4½" cement retainer to 1095'. Fruitland Coal perforations @ 1138'-1180'. Load and circulate hole.
- Attempt to pressure test casing to 600 psi for 30 mins.
- Run CBL from 1095' to surface.
- Plug I, Pictured Cliffs-Fruitland: Sting in the cement retainer. Squeeze 20 sks, 23 cu ft Class G neat cement to cover the Pictured Cliffs below the retainer. Sting out. Spot plug inside 4½" casing above cement retainer @ 1095' to 746' w/30 sks (34.5 cu ft) Class G neat cement to cover the Pictured Cliffs, Fruitland tops (5 gal/sk, 15.8 #/gal, 1.15 cu ft/sk). Total cement 50 sks, 57.5 cu ft. Tag and verify. Plug I, Inside 4½" casing, cement retainer at 1095', 50 sks, 57.5 cu ft, Pictured Cliffs-Fruitland, 746'-1138'.
- Plug II, Kirtland-Ojo Alamo-Surface Casing-Surface: Spot inside 4½" casing from 180' to Surface w/18 sks (20.7 cu ft) Class G cement to cover the Kirtland, Ojo Alamo tops, surface casing shoe & surface casing. Plug II, Kirtland-Ojo Alamo-Surface Casing shoe to Surface, 0' 180'.
- Cut wellhead off. Fill casing w/cement in case needed. Install dry hole marker.
- Clean location. Rig down and move.
- Take pictures of the dry hole marker. Show API number clearly on the dry hole marker.
- Attach GPS Coordinates of the dry hole marker to the final sundry.

Current Wellbore Schematic

Jeter #001S 30-045-32990 Basin Fruitland Coal 1300' FSL & 1300' FEL P-S01-T25N-R13W San Juan County, NM

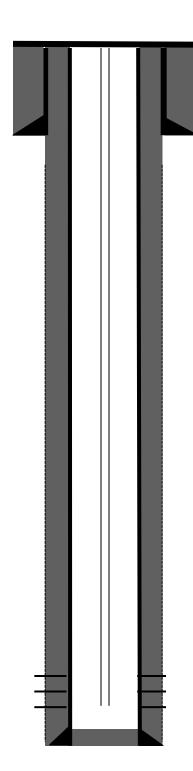

7" 23#, J-55 casing @ 129': Hole size – 8-3/4" Cemented with 60 sks, type 5 cement w/2% CaCl2 w/1/4# celloflake/sx (80 cu ft total slurry) Circ 2 bbls cement

2-3/8" tubing ran to 1247'


4 ½" 10.5#, J-55 casing @ 1357'. Hole size: 6-1/4"
Cement w/ 80 sks 2% Lodense w/3# Gilsonite/Sk w/14#
celloflake/Sx. Tail w/50sx type 5 cement w/1/4# celloflake/sx
(232 cu ft total slurry) Circ 10 bbls cement

Fruitland Coal Perforated @ 1138' - 1180' w/4 spf

PBTD @ 1317', TD 1370'

Planned P & A Wellbore Schematic

Jeter #001S 30-045-32990 Basin Fruitland Coal 1300' FSL & 1300' FEL P-S01-T25N-R13W San Juan County, NM

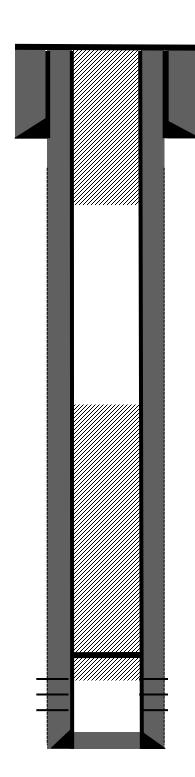

7" 23#, J-55 casing @ 129': Hole size – 8-3/4"
Cemented with 60 sks, type 5 cement w/2% CaCl2 w/1/4#
celloflake/sx (80 cu ft total slurry) Circ 2 bbls cement

Plug II, Kirtland-Ojo Alamo-Surface Casing shoe to Surface, 0' – 180'

Set 4 $\frac{1}{2}$ " CR @ 1095'. Squeeze 20 sks, 23 Cu.ft cement to cover the Pictured cliffs top below the retainer.

Plug I, Inside 4½" casing, cement retainer at 1095', 50 sks, 57.5 cu ft, Pictured Cliffs-Fruitland, 746'-1138'.

4 ½" 10.5#, J-55 casing @ 1357'. Hole size: 6-1/4" Cement w/ 80 sks 2% Lodense w/3# Gilsonite/Sk w/14# celloflake/Sx. Tail w/50sx type 5 cement w/1/4# celloflake/sx (232 cu ft total slurry) Circ 10 bbls cement

Fruitland Coal Perforated @ 1138' - 1180' w/4 spf

PBTD @ 1317', TD 1370'

Jeter #001S

30-045-32990 Basin Fruitland Coal 1300' FSL & 1300' FEL P-S01-T25N-R13W San Juan County, NM

Formation Tops (Operator Submitted)

- Surface Casing 129'
- Ojo Alamo 24'
- Kirtland 126'
- Fruitland 846'
- Perforations 1138'-1180'
- Pictured Cliffs 1181'



United States Department of the Interior

BUREAU OF LAND MANAGEMENT Farmington District Office 6251 College Boulevard, Suite A Farmington, New Mexico 87402 http://www.blm.gov/nm



CONDITIONS OF APPROVAL

December 3, 2025

Notice of Intent - Plug and Abandonment

Operator: Dugan Production Corporation

Lease: NMSF 0078155

Well(s): Jeter 1S, US Well # 30-045-32990

Location: SESE Sec 1 T25N R13W (San Juan, NM)

Sundry Notice ID #: 2884970

The Notice of Intent to Plug and Abandon is accepted with the following Conditions of Approval (COA):

- 1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
- 2. The following modifications to your plugging program are to be made: a. No changes to the procedure.
- 3. Notification: Farmington Office is to be notified at least 24 hours before the plugging operations commence at (505) 564 7750.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

K. Rennick 12/03/2025

GENERAL REQUIREMENTS FOR PERMANENT ABANDONMENT OF WELLS ON FEDERAL AND INDIAN LEASES FARMINGTON FIELD OFFICE

- 1.0 The approved plugging plans may contain variances from the following <u>minimum general</u> requirements.
 - 1.1 Modification of the approved plugging procedure is allowed only with the prior approval of the Authorized Officer, Farmington Field Office.
 - 1.2 Requirements may be added to address specific well conditions.
- 2.0 Materials used must be accurately measured. (densometer/scales)
- 3.0 A tank or lined pit must be used for containment of any fluids from the wellbore during plugging operations and all pits are to be fenced with woven wire. These pits will be fenced on three sides and once the rig leaves location, the fourth side will be fenced.
 - 3.1 Pits are not to be used for disposal of any hydrocarbons. If hydrocarbons are present in the pit, the fluids must be removed prior to filling in.
- 4.0 All cement plugs are to be placed through a work string. Cement may be bull-headed down the casing with prior approval. Cement caps on top of bridge plugs or cement retainers may be placed by dump bailer.
 - 4.1 The cement shall be as specified in the approved plugging plan.
 - 4.2 All cement plugs placed inside casing shall have sufficient volume to fill a minimum of 100' of the casing, or annular void(s) between casings, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
 - 4.3 Surface plugs may be no less than 50' in length.
 - 4.4 All cement plugs placed to fill annular void(s) between casing and the formation shall be of sufficient volume to fill a minimum of 100' of the annular space plus 100% excess, calculated using the bit size, or 100' of annular capacity, determined from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
 - 4.5 All cement plugs placed to fill an open hole shall be of sufficient volume to fill a minimum of 100' of hole, as calculated from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug. In the absence of a caliper log, an excess of 100% shall be required.
 - 4.6 A cement bond log or other accepted cement evaluation tool is required to be run if one had not been previously ran or cement did not circulate to surface during the original casing cementing job or subsequent cementing jobs.

2

- 5.1 The top of any cement plug verified by tagging must be at or above the depth specified in the approved plan, without regard to any excess.
- 5.2 Testing will not be required for any cement plug that is mechanically contained by use of a bridge plug and/or cement retainer, if casing integrity has been established.
- 5.3 Any cement plug which is the only isolating medium, for a fresh water interval or a zone containing a prospectively valuable deposit of minerals, shall be tested by tagging.
- 5.4 If perforations are required below the surface casing shoe, a 30 minute minimum wait time will be required to determine if gas and/or water flows are present. If flow is present, the well will be shut-in for a minimum of one hour and the pressure recorded. Short or long term venting may be necessary to evacuate trapped gas. If only a water flow occurs with no associated gas, shut well in and record the pressures. Contact the Engineer as it may be necessary to change the cement weight and additives.
- 6.0 Before setting any cement plugs the hole needs to be rolled. All wells are to be controlled by means of a fluid that is to be of a weight and consistency necessary to stabilize the wellbore. This fluid shall be left in place as filler between all plugs.
 - 6.1 Drilling mud may be used as the wellbore fluid in open hole plugging operations.
 - 6.2 The wellbore fluid used in cased holes shall be of sufficient weight to balance known pore pressures in all exposed formations.
- 7.0 A blowout preventer and related equipment (BOPE) shall be installed and tested prior to working in a wellbore with any exposed zone(s); (1) that are over pressured, (2) where the pressures are unknown, or (3) known to contain H_2S .
- 8.0 Within 30 days after plugging work is completed, file a Sundry Notice, Subsequent Report of Abandonment (Form 3160-5), through the Automated Fluid Minerals Support System (AFMSS) with the Field Manager, Bureau of Land Management, 6251 College Blvd., Suite A, Farmington, NM 87402. The report should show the manner in which the plugging work was carried out, the extent, by depth(s), of cement plugs placed, and the size and location, by depth(s), of casing left in the well. Show date well was plugged.
- 9.0 All permanently abandoned wells are to be marked with a permanent monument as specified in 43 CFR 3162.6(d). Unless otherwise approved.
- 10.0 If this well is located in a Specially Designated Area (SDA), compliance with the appropriate seasonal closure requirements will be necessary.

All of the above are minimum requirements. Failure to comply with the above conditions of approval may result in an assessment for noncompliance and/or a Shut-in Order being issued pursuant to 43 CFR 3163.1. You are further advised that any instructions, orders or decisions issued by the Bureau of Land Management are subject to administrative review pursuant to 43 CFR 3165.3 and appeal pursuant to 43 CFR 3165.4 and 43 CFR 4.700.

BLM - FFO - Geologic Report

Date Completed 12/03/2025

Well No. Jeter 1S Surf. Loc. 1300 FSL 1300 FEL

US Well No. 30-045-32990 SESE Section 1 T. 25N R. 13W

Lease No. NMSF 0078155

County San Juan State New Mexico

Operator Dugan Production Corporation Formation Basin Fruitland Coal

TVD 1370 PBTD 1317 Elevation KB NA

Elevation GL 6229

Geologic Formations	Est. tops	Remarks
Ojo Alamo	24	
Kirtland Surface Casing	126 129	
Fruitland Fm Top Perforation Bottom Pictured Cliffs	846 1138 1180 1181	

Remarks: Reference Well:

Limited raster log data. Operator selected formation tops are appropriate. No changes to the procedure.

Prepared by: Kenneth Rennick

Sante Fe Main Office Phone: (505) 476-3441

General Information Phone: (505) 629-6116

Online Phone Directory https://www.emnrd.nm.gov/ocd/contact-us

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Action 531653

CONDITIONS

Operator:	OGRID:
DUGAN PRODUCTION CORP	6515
PO Box 420	Action Number:
Farmington, NM 87499	531653
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By		Condition Date
loren.diede	Notify the OCD inspection supervisor via email 24 hours prior to beginning Plug & Abandon (P&A) operations.	12/4/2025
loren.diede	Submit photo and GPS coordinates of the P&A marker with the C-103P subsequent report. The API# on the marker must be clearly legible.	12/4/2025