

District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM
87505

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-041-10413
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. K-3935
7. Lease Name or Unit Agreement Name Haley Chaveroo San Andres Unit
8. Well Number #008
9. OGRID Number 164557
10. Pool name or Wildcat Chavaroo San Andres

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well Gas Well Other

2. Name of Operator
Ridgeway Arizona Oil Corporation

3. Address of Operator
PO Box 1110, St. Johns, AZ 85936

4. Well Location
Unit Letter **H** : **1980** feet from the **N** line and **660** feet from the **E** line
Section **34** Township **07S** Range **33E** NMPM County **Roosevelt**

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
4388 DF

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	P AND A <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPL <input type="checkbox"/>	CASING/CEMENT JOB <input type="checkbox"/>	
DOWNHOLE COMMINGLE <input type="checkbox"/>			
CLOSED-LOOP SYSTEM <input type="checkbox"/>			
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

**JMR Services, LLC respectfully proposes the attached NOI to P&A this well on behalf of
Ridgeway Arizona Oil Corporation for the State of New Mexico.**

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE *Jim Lamb* TITLE *Regional* DATE *2/18/26*

Type or print name _____ E-mail address: _____ PHONE: _____
For State Use Only

APPROVED BY: _____ TITLE _____ DATE _____
Conditions of Approval (if any): _____

Proposed P&A Procedure
Ridgeway Arizona Oil Coporation/NMOCD
Haley Chaveroo SA Unit #008
30-041-10413

Note: All Cement is Class C mixed at 14.8 ppg, yield 1.32 cu ft / sx. If WOC is required then we will use 2% Calcium Chloride in order to reduce the wait time to 4 hrs, Cement volumes are based on inside capacities + 50' excess and outside 100% excess in open hole.

Prior to MOL 24 hrs Notification is Required to Regulatory Agency (NMOCD in this case)


1. Hold pre-job meeting. Comply with all NMOCD, BLM along with Corporate and environmental regulations.
2. MIRU P&A rig and equipment.
3. Check and record tubing, casing and bradenhead pressures.
4. Remove existing piping from casing valve. Lay out relief lines to tanks and blow well down. Kill well if necessary. Ensure well is dead or on vacuum.
5. If well has rods and pump TOH and LD.
- 5a. TOH and LD tubing.
6. ND WH. NU BOP and function test BOP.
7. Round trip gauge ring to 4110' or as deep as possible. If unable to get to 4110' then discuss with Regulatory for procedure change. RIH and set 4.5" CIBP @ 4110'. POH.
8. Pressure test casing to 500#. If casing does not test, then discuss with Regulatory for procedure change. If casing tests and MIRU wireline truck. Run CBL from CIBP to surface. Send an electronic copy of CBL to NMOCD representative. Results of CBL may change procedure. Record TOC per CBL on DWR.
9. PU tubing workstring and RIH. Drop ball valve down tubing and pressure test to 1000#.
10. Plug #1: (CIBP) Spot 11 sxs class "C" cmt, yield of 1.32 cf. BOC @ 4110' to TOC 4010'. If casing did not test and WOC and tag. If casing tested then continue on to Plug #2.
11. Plug #2:(San Andres) Mix and spot 11 sxs Class C cement, yield 1.32, inside csg from BOC 3580' to TOC @ 3380'.
12. Plug #3 (Queen/Grayburg) Perf @ 3108'. Mix 92 sxs Class C cement, yield 1.32cf. Squeeze 76 sxs outside casing and leave 16 sxs inside casing from BOC 3108' to TOC 2889'. WOC and tag. If cement tags low then contact Regulatory for procedure change.
13. Plug #4 (7Rvrs/Yates/Bsalt) Perf @ 2525'. Mix 144 sxs Class C cement, yield 1.32cf. Squeeze 120 sxs outside casing and leave 24 sxs inside casing from BOC 2525' to TOC 2190'. WOC and tag. If cement tags low then contact Regulatory for procedure change.
14. Plug #5:(Tsalt/Rustler) Perf @ 1955'. Mix 74 sxs Class C cement, yield 1.32cf. Squeeze 61 sxs outside casing and leave 13 sxs inside casing from BOC 1955' to TOC 1780'. WOC and tag. If cement tags low then contact Regulatory for procedure change.
15. Plug #6: (casing shoe, Surface)Perf @ 366'. Mix and pump 113 sxs Class C cement, yield 1.32cf, squeeze 18 sxs into 4.5"x 7-7/8" OH, 69 sxs 4.5" x 8.625" annulus and leave 26 sxs inside casing from 366' to surface.
16. Contact Regulatory Representative to witness setting P&A marker.ND cementing valves and cut off wellhead. Test and record if gas is present. Top off annuli with cement if necessary. Record GPS coordinate for P&A marker on DWR. Photograph P&A marker in Place. RD and MOL.

Author: Neil @ JMR
 Well Name: Haley Chavero SA Unit #008
 Field/Pool: Chavero San Andres
 County: Roosevelt
 State: New Mexico
 Spud Date: 12/10/65

API: 30-041-10413
 Location: Unit H 1980 FNL; 660 FEL
 DF: Sec. 34, T7S, R33E
4388

Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx	TOC
Surface Csg	8.625		24	316	12 1/4	250	Circ
Prod Csg	4.5		9.5	4,472	7 7/8	200	TS3640
Tubing	?	?	?	?	?	?	?

8.625 24 CSG @ 316
 Hole Size: 12 1/4

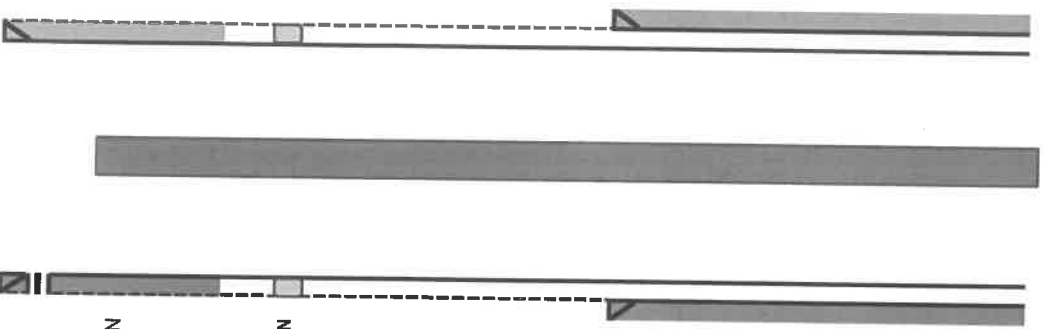


Note: 1989 Squeeze. Holes in csg @ 3206-3214'
 Perforated @ 3225 and squeeze with 450 sxs Class C

Note: Original TD 4480'

Perfs @ 4161' - 4352'
 4.5 9.5 CSG @ 4,472
 Hole Size: 7 7/8

Formation Tops	
Rustler	1880
T Salt	1905
B Salt	2290
Yates	2300
7 RVrs	2475
Queen	2989
Grayburg	3058
San Andres	3480

Author:	Neil @ JMR	30-041-10413
Well Name	Haley Chaverro SA Unit #008	Unit H 1980 FNL; 660 FEL
Field/Pool	Chaverro San Andres	Sec. 34, T7S, R33E
County	Roosevelt	4388
State	New Mexico	
Spud Date	12/10/65	
API:		
Location:		
DF		

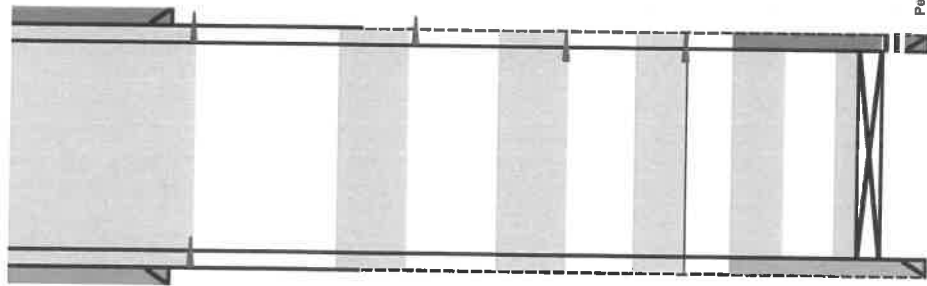

Plug #6: (Csg shoe and surface). Mix 113 sxs, spot 26 sxs from 416' to surface, 18 sxs 4.5" x 7-7/8" open hole and 69 sxs inside 4.5" x 8.625" annulus (yield 1.32cf) Perforate @366'

Plug #5: (Tsalt/Rusler). Mix 74 Class "C" cmt yield 1.32 cf, spot 13 sxs from BOC 1955' to TOC 1780' | Squeeze 81 sxs (100% excess) from 1955' in annulus. WOC and Tag. Perforate @ 1955'

Plug #4: (7Rvrs/Yates/Bsail). Mix 144 Class "C" cmt yield 1.32 cf, spot 24 sxs from BOC 2525 to TOC 2190'. Squeeze 120 sxs (100% excess) from 2525' in annulus. WOC and Tag. Perforate @ 2525'

Plug #3: (Grayburg/Queen) Mix 92 sxs Class "C" cmt yield 1.32cf, spot 16 sxs inside csg BOC @ 3108' to TOC @ 2889' (50' excess). Squeeze 76 sxs (100% excess) from 3108' in annulus. WOC and Tag. Perforate @ 3108'

Plug #2: (San Andres) Spot 11 sxs Class "C" cmt yield 1.32cf, inside csg BOC @ 3530' to TOC @ 3380' (50' excess).

Plug #1: (CIBP) Spot 11 sxs class "C" cmt, yield 1.32 cf BOC @ 4110' to TOC 4010'. Set CIBP @ 4110' Perfs @ 4161' - 4352'

Formation Tops	
Rusler	1880
T Salt	1905
B Salt	2290
Yates	2300
7 Rvrs	2475
Queen	2989
Grayburg	3058
San Andres	3480

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

DEFINITIONS

Action 556765

DEFINITIONS

Operator: JMR SERVICES, LLC (OPG Vendor) 4706 Green Tree Blvd. Midland, TX 79707	OGRID: 333576
	Action Number: 556765
	Action Type: [UF-OMA] NOI Plug & Abandon Well (UF-OMA-C-103F)

DEFINITIONS

The OCD Mitigation Activity (OMA) forms are a subset of the OCD's forms exclusively designed for activities related to State of New Mexico's contracted evaluation, plugging, decommissioning, remediation, salvage and reclamation activities. Specifically, these forms are typically used where the OCD has acquired a hearing order allowing the OCD to perform mitigation activities on wells and associated facilities that no longer have an authorized or viable operator to perform the necessary work. These forms are not to be utilized for any other purpose.

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS

Action 556765

QUESTIONS

Operator: JMR SERVICES, LLC (OPG Vendor) 4706 Green Tree Blvd. Midland, TX 79707	OGRID: 333576
	Action Number: 556765
	Action Type: [UF-OMA] NOI Plug & Abandon Well (UF-OMA-C-103F)

QUESTIONS

Prerequisites	
[OGRID] Well Operator	[164557] RIDGEWAY ARIZONA OIL CORP.
[API] Well Name and Number	[30-041-10413] HALEY CHAVEROO SA UNIT #008
Well Status	Temporary Abandonment (expired)

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 556765

CONDITIONS

Operator: JMR SERVICES, LLC (OPG Vendor) 4706 Green Tree Blvd. Midland, TX 79707	OGRID: 333576
	Action Number: 556765
	Action Type: [UF-OMA] NOI Plug & Abandon Well (UF-OMA-C-103F)

CONDITIONS

Created By	Condition	Condition Date
loren.diede	Notify NMOCD 24 hours prior to beginning P&A operations. This well is within the LPCH restricted area and a BELOW GRADE P&A marker will be required. Submit photo and GPS coordinates of the P&A marker with the C-103P subsequent P&A report. The results of the CBL will determine whether plugs are to be inside or inside/outside squeezed plugs.	2/26/2026