

District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
1301 W. Grand Avenue, Artesia, NM 88210  
District III  
1000 Rio Brazos Road, Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy Minerals and Natural Resources

Oil Conservation Division  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

Form C-141  
Revised October 10, 2003

Submit 2 Copies to appropriate  
District Office in accordance  
with Rule 116 on back  
side of form

Release Notification and Corrective Action

OPERATOR

☐ Initial Report ☒ Final Report

Name of Company	BOPCO, LP	Contact	Tony Savoie
Address	522 W. Mermod, Suite 704 Carlsbad, NM 88220	Telephone No.	(432) 556-8730
Facility Name	Poker Lake Unit #89	Facility Type	E & P


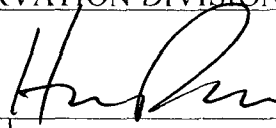
Surface Owner Federal	Mineral Owner: Federal	Lease No. NML C061705B
-----------------------	------------------------	------------------------

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
A	25	24S	30E					Eddy

Latitude N. 32.189988 Longitude W. 103.832185

NATURE OF RELEASE

Type of Release	Produced water and crude oil	Volume of Release: 455 bbls of produced water and 6 bbls of crude oil. Total fluid 461 bbls	Volume Recovered: 430 bbls of produced water and 5 bbls of crude oil. Total fluid 435 bbls
Source of Release:	Storage tank overflow	Date and Hour of Occurrence 5/11/11, Hour unknown	Date and Hour of Discovery 5/11/11 8:55 a.m.
Was Immediate Notice Given?	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Mike Bratcher NMOCD and Jim Amos BLM	
By Whom?	Tony Savoie	Date and Hour: 5/11/11 9:11 a.m.	
Was a Watercourse Reached?	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	
If a Watercourse was Impacted, Describe Fully.*			
Describe Cause of Problem and Remedial Action Taken.* The primary water transfer pump coupling between the motor and pump failed, the secondary pump failed to come on due to a communication problem between the primary and secondary pump. The pump was repaired and the electrical communication problem was corrected.			
Describe Area Affected and Cleanup Action Taken.* The release affected approximately 3500 sq. ft. within the earthen containment and 3268 sq. ft. of caliche on the adjacent well/battery bad. The release was remediated as per NMOCD guidelines. Please see the attached Remediation Summary and Site Closure Request, dated May 2012, for details of remediation activities and laboratory analytical results from confirmation soil samples.			
I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases, which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.			
Signature: 		OIL CONSERVATION DIVISION	
Printed Name: <del>Ben S. Arguijo</del> Ben S. Arguijo (agent of BOPCO, LP)		Approved by District Supervisor: 	
Title: <del>Project Manager, Basin Environmental</del> Project Manager, Basin Environmental		Approval Date: 9/3/14 Expiration Date: NA	
E-mail Address: tasavoie@basspet.com b.sarguijo@basinenv.com		Conditions of Approval: Attached <input type="checkbox"/>	
Date: <del>5/11/13</del> 2/14/13 Phone: (432) 556-8730 (806) 549-9597		Final 2RR-780	

