		SITI	E INFORMA	TION	
	Report T	ype: Soil Rem	ediation Cl	osure Re	quest 1RP-3960
General Site I	nformation:				
Site:		Eunice Yard			
Company:		Globe Energy Serv	vices		
Section, Town	nship and Range	Unit I	Sec. 34	T 21S	R 37E
Lease Numbe	r:				
County:		Lea County			
GPS:			32.433563° N		103.144684º W
Surface Owne		Chevron USA, Inc.			
Mineral Owne	r:				
Directions:					travel SOUTH on 4th St for approx 0.25 mi, turn of Globe Energy Yard is approx 125 feet north of
Release Data:					
Date Released	d:	Unknown			
Type Release:		Produced Water			
Source of Con	tamination:	Frac Tank Failure			
Fluid Released		Unknown			
Fluids Recove	red:	None			
Official Comm	nunication:				
Name:	Tommy Morris				Ike Tavarez
Company:	Globe Energy Ser	vices			Tetra Tech
Address:	113 Texas Ave.				4000 N. Big Spring
					Ste 401
City:	Eunice, NM 88231	1			Midland, Texas
Phone number					
Prione number Fax:	(325) 207-7775				(432) 687-8110
rax. Email:	to many morris (1)	maalla aam			lles Toylorez @tetratech com
EIIIaII.	tommy.morris@	<u>gesiic.com</u>			Ike.Tavarez@tetratech.com
Ranking Crite	ria				
Donth to Cro	ndwator:		Panking Coors	1	Site Data
Depth to Groun	iuwaier:		Ranking Score 20		Site Data
50-99 ft			10		
>100 ft.			0		0
WellHead Prote	ection:		Ranking Score		Site Data
	1,000 ft., Private <200	ft.	20	†	
	1,000 ft., Private >200		0		0
Surface Body o	of Water:		Ranking Score	1	Site Data

Accepta	ble Soil RRAL (n	ng/kg)
Benzene	Total BTEX	TPH
10	50	100

20 10 **0** 

20

<200 ft. 200 ft - 1,000 ft. >1,000 ft.

Total Ranking Score:



May 31, 2017

Olivia Yu Environmental Specialist, District 1 Oil Conservation Division, EMNRD 1625 North French Drive Hobbs, New Mexico 88240

RE: Soil Remediation Closure Request for the Globe Energy Services, Produced Water Release Located in Unit I, Section 34, Township 21 South, Range 37 East, Lea County, New Mexico. RP #3960

Dear Ms. Yu:

Tetra Tech was contacted by Globe Energy Services (Globe) to assess and remediate a spill located in Unit I, Section 34, Township 21 South, Range 37 East, Lea County, New Mexico (Site). The GPS coordinates for the site are N 32.433563 and W 103.144684°. The site location is shown on Figures 1 and 2.

#### **BACKGROUND**

According to Globe, a produced water release occurred from frac tanks being stored on the south side of the Globe yard located in Eunice, New Mexico. The produced water migrated onto the adjacent property impacting the surface soils. No fluids were recovered and the volume of the fluids released is unknown. Chevron discovered the release on their property and contacted the NMOCD. The initial C-141 for the release is enclosed in Appendix A.

#### **GROUNDWATER AND REGULATORY**

According to the New Mexico Office of the State Engineer (NMOSE) online database, five (5) wells were shown in Section 34 with depths to groundwater ranging from 29.0' to 48.0' below surface. The NMOCD groundwater map showed the average depth to groundwater in this area is approximately 50' below surface. However, Chevron has a groundwater investigation site located west, or adjacent, to the Globe Eunice facility. According to the Chevron groundwater monitoring report, dated September 26, 2012, the report indicated the depth to groundwater at approximately 27' below surface. The groundwater data is shown in Appendix B.

According to the Ground Water Report 6, "Geology and Ground Water Conditions in Southern Lea County, New Mexico," published by the New Mexico institute of Mining & Technology (1961), the groundwater in the area is produced from the Ogallala formation and ranges from 100' to 250' in thickness.



A risk-based evaluation will be performed for the Site in accordance with the New Mexico Oil Conservation Division (NMOCD) Guidelines for Remediation of Leaks, Spills and Releases, dated August 13, 1993. The guidelines require a risk-based evaluation of the site to determine recommended remedial action levels (RRAL) for benzene, toluene, ethylbenzene and xylene (collectively referred to as BTEX) and total petroleum hydrocarbons (TPH) in soil. Based upon the depth to groundwater, the proposed RRAL for TPH is 100 mg/kg.

## SOIL INVESTIGATION AND ASSESSMENT

### Auger holes Installation and Sampling

On November 19, 2015, Tetra Tech personnel inspected and sampled the spill area. The impacted areas were located outside the Globe facility along the west and south fence line. A total of twenty-four (24) auger holes (AH-1 through AH-24) were installed using a stainless steel hand auger to assess the impacted soils. Soil samples were collected to depths ranging from 1.0' to 2.5'-3.0' below surface. Deeper samples were not collected due to a dense caliche formation at the site. Soil samples were analyzed for TPH analysis by EPA method 8015 modified, BTEX by EPA Method 8021B and chloride by EPA method 300.0. Copies of laboratory analysis and chain-of-custody documentation are included in Appendix E. The sampling results are summarized in Table 1. The auger hole locations are shown on Figure 3.

## Auger hole Sampling Results

Referring to Table 1, all of the auger hole samples selected for BTEX analysis were below the RRAL. The areas of AH-1, AH-16 and AH-21 showed TPH concentrations above the RRAL with concentrations of 350 mg/kg, 387 mg/kg and 320 mg/kg, respectively. However, the impact in these areas were vertically defined in the shallow soils at a depth of approximately 1-1.5' below surface. In addition, auger holes (AH-3, AH-4, AH-8, AH-15, AH-17, AH-19, AH-20 and AH-22) exceeded the TPH RRAL and were not vertically defined. The remaining auger holes (AH-2, AH-5, AH-6, AH-7, AH-9, AH-10, AH-11, AH12, AH-13, AH-14, AH-18, AH-23 and AH-24) did not show any TPH concentrations above the RRAL.

The areas of auger holes (AH-9 and AH-23) showed chloride concentrations of 1,370 mg/kg and 345 mg/kg at 0-1', but were vertically defined at 1-1.5' and 2-2.5', respectively. The areas of auger holes (AH-1, AH-2, AH-3, AH-4, AH-6, AH-7, AH-12, AH-13, AH-14, AH-17 and AH-21) showed chloride concentrations above the RRAL, or delineation concentration, of 250 mg/kg, and were not vertically defined. The remaining auger holes (AH-5, AH-8, AH-10, AH-11, AH-15, AH-16, AH-18, AH-19, AH-20, AH-22 and AH-24) did not show any chloride concentrations in the soils above 250 mg/kg.

## Borehole Installation and Sampling

To define vertical extents, Tetra Tech installed boreholes at the site. The total depth of the boreholes ranged from 4'-5' to 24-25' below surface. Deeper sample were not collected due to the shallow groundwater of approximately 27.0' below surface. The borehole drilling



logs are included in Appendix C. Copies of laboratory analysis and chain-of-custody documentation are included in Appendix E.

On January 20, 2016, Tetra Tech returned to the site to supervise the installation of a total of twelve (12) boreholes (BH-1 through BH-12) to assess and define the vertical extent of the impacted areas. In summary, auger holes (AH-3, AH-4, AH-8, AH-15, AH-17, AH-19, AH-20 and AH-22) exceeded the TPH RRAL and were not vertically defined below the RRAL. The areas of auger holes (AH-1, AH-2, AH-3, AH-4, AH-6, AH-7, AH-12, AH-13, AH-14, AH-17 and AH-21) showed chloride concentrations above the delineation concentration of 250 mg/kg and were not vertically defined.

Due to safety concerns with the overhead power lines, one borehole (BH-9) was placed at a midpoint between auger holes (AH-19 and AH-20). All of the remaining boreholes were installed as proposed in the approved Work Plan, dated January 18, 2016. As directed by the NMOCD, a single borehole was recommended in each area (AH-1 and AH-2) and (AH-12, AH-13 and AH-14). The two boreholes (BH-6 and BH-7) were installed in the vicinity of auger holes (AH-1 and AH-14).

An air rotary drilling rig was used to collect soil samples. A small core-barrel sampler was used to collect the samples at selected depth intervals of 0-1', 2-3', 4-5', 6-7 and 9-10' and then five (5) foot intervals thereafter. Tetra Tech inspected the soil samples for lithology characteristics and field screened the samples for conductivity and selected samples for field chlorides. In addition, soil samples were field screened for soil headspace gas survey measurements of the relative concentration of organic vapors in the soil. The Ambient Temperature Headspace (ATH) method was used at the Site for the soil headspace gas survey. The ATH method consists of collecting discrete or composite soil samples from a drilled borehole depth interval and placing the sample in a clean plastic sample bag, leaving a vacant headspace in the top of the bag. The bag was sealed, and after approximately fifteen (15) minutes of ambient temperature storage, the concentration of organic vapors in the sample bag headspace was measured using a photo-ionization detector (PID).

All of the soil samples collected for analyses were preserved in laboratory provided sample containers with standard QA/QC procedures. Samples were shipped under proper chain-of-custody control and analyzed within the standard holding times. Selected soil samples were analyzed for TPH analysis by EPA method 8015 modified and chloride by EPA method 300.0. The laboratory results are summarized in Table 1.

## **Boreholes Sample Results**

Referring to Table 1, all of the soil samples collected from the boreholes BH-3 (AH-8), BH-4 (AH-4), BH-5 (AH-3), BH-8 (AH-15), BH-9 (AH-19 and AH-20), BH-10 (AH-17) and BH-12 (AH-22) did not show any TPH concentrations above the laboratory reporting limit.

In addition, soil samples collected at BH-7 (AH-14) did not show any chloride concentrations above 250 mg/kg. Soil samples collected at BH-10 (AH-17) and BH-11 (AH-21) did show chloride spikes of 4,210 mg/kg and 4,170 mg/kg at 2.0'-3.0' below surface, respectively. However, the chloride concentrations declined with depth to 50.8 mg/kg (BH-10) and 69.5 mg/kg (BH-11) at 19'-20' below surface.



The remaining boreholes; BH-1 (AH-6), BH-2 (AH-7), BH-4 (AH-4), BH-5 (AH-3), and BH-6 (AH-1) did not show chloride concentrations decline below 250 mg/kg at a depth of 24'-25', with concentrations of 286 mg/kg, 455 mg/kg, 1,320 mg/kg, 426 mg/kg, and 370 mg/kg, respectively. Due to shallow groundwater in the area, no samples were collected deeper than 24'-25' below surface.

## <u>Additional Soil Sampling - Horizontal Delineation</u>

Additional auger holes were installed approximately 3.0' outside the visible spill foot print in order to horizontally define extents. A total of sixteen (16) auger holes were installed (AH-1 H-horizontal through AH-16 H-horizontal) to depths ranging between 0-2.5' below surface. The auger hole locations are shown on Figure 3. All of the soil samples collected for analyses were preserved in laboratory provided sample containers with standard QA/QC procedures. Samples were shipped under proper chain-of-custody control and analyzed within the standard holding times. Selected soil samples were analyzed for TPH analysis by EPA method 8015 modified and chloride by EPA method 300.0. The laboratory results are summarized in Table 2.

Referring to Table 2, none of the samples collected at auger holes (AH-1H through AH-3H), and (AH-6H through AH-16H) showed chloride concentrations above 250 mg/kg. However, the area of auger hole (AH-4H) showed a chloride concentration of 531 mg/kg at 0'-1' below surface and deeper samples were not collected due to a dense caliche formation in the area. Additionally, the samples collected at auger hole (AH-5H) showed chloride concentrations increasing with depth from <2.00 mg/kg at 0'-1' to 316 mg/kg at 2.0'-2.5' below surface. Based on the field data, an additional step out (AH-8H) was installed for delineation, which showed chloride concentrations <250 mg/kg.

In addition, the samples collected at auger holes (AH-3H, AH-4H, AH5H, AH-12H, AH-13H, AH-14H and AH-15H) showed TPH concentrations ranging from <14.9 mg/kg to 15.0 mg/kg. The area of auger hole (AH-16H) showed a TPH concentration of 825 mg/kg at 0-0.5' below surface; deeper samples were not collected due to a dense caliche formation in the area.

## **GROUNDWATER INVESTIGATION**

Due to the shallow groundwater at the site, the NMOCD requested delineation of the soils for chlorides to 250 mg/kg. In addition, if the chloride concentrations were not defined within 10 feet from the top of groundwater, a monitor well would be required to assess the groundwater qualities for the area. Based on the soil assessment, some of the boreholes were not vertically defined at 24-25' below surface in the areas. The depth to groundwater in the area shows to be approximately 25'-30' below surface.

Based on the borehole results, Globe proposed to install a total of three (3) monitor wells in order to evaluate the groundwater qualities at the site. The areas of BH-1 (AH-6), BH-2 (AH-7), BH-4 (AH-4), BH-5 (AH-3) and BH-6 (AH-1) were not defined below 250 mg/kg at 24-25' below surface. One monitor well was proposed in the area of BH-4 (AH-4), one between the areas of BH-1 (AH-6) and BH-2 (AH-7) and one between BH-5 (AH-3) and BH-6 (AH-1). The proposed monitor well locations are shown on Figure 6.



The approved Work Plan submitted by Tetra Tech dated June 1, 2016, proposed installing three (3) monitor wells in order to evaluate the groundwater qualities at the site. According to the Addendum to the Work Plan submitted by Tetra Tech, dated August 18, 2016, the NMOCD requested one monitor well installed outside of the spill footprint in the area of AH-4 (BH-4), prior to the soil remediation. The location of monitor well (MW-1) is shown in Figure 6.

## Monitor Well Installation and Construction

On September 20, 2016, Tetra Tech personnel were onsite to supervise the installation of one (1) permanent monitor well (MW-1). During the installation of the well, Tetra Tech field screened the soil with a PID at 5' to 10' intervals down to 20' below surface to evaluate the subsurface soils. The PID readings ranged between 0.2 and 0.8 ppm. Additionally, the field screened intervals were collected for analyses and preserved in laboratory provided sample containers with standard QA/QC procedures. The samples were shipped under proper chain-of-custody control and analyzed within the standard holding times. Selected soil samples were analyzed for TPH analysis by method 8015 (modified), BTEX by method 8021B, and chloride by EPA method 300.0. The laboratory results are summarized in Table 4. The screening log is included in Appendix C.

Referring to Table 4, the samples collected at 10' and 20' below surface did not show any significant TPH or BTEX concentrations. The samples collected showed chloride concentrations ranging from 193 mg/kg (20') and 294 mg/kg (5').

The monitor well was drilled to 50' below surface using an air rotary rig and constructed with 2-inch diameter, screw threaded, schedule 40 PVC casing and 0.020 inch factory slotted scree. The well screen, thirty (30) feet in length, was installed with approximately 20.0' of screen into the groundwater and 10.0' above the groundwater. The well screen was filter packed with graded (20-40) silica sand, which was placed in the annular space between the borehole wall and the screen to a depth of 2.0' above the screen. Bentonite pellets (hydrated) were placed on top of the sand to complete the well, which was then secured with a locking water tight cap and a steel sleeve around the well. Once completed, the monitor well was properly developed and all of the fluids were contained in an onsite drum for proper disposal. The well drilling log is included in Appendix C. The well construction log is included in Appendix D.

## Monitor Well Sampling

On September 22, 2016, Tetra Tech personnel returned to the site measure the depth to water to the nearest 0.01 foot and collect samples. The depth to water was measured to be at 27.95' below surface. Prior to sampling, approximately three (3) casing volumes of water was purged from the well using a dedicated bailer and disposable line. All of the purge water was contained in the onsite drum for proper disposal. The groundwater samples were then labeled and placed in to preserved containers provided by the laboratory and analyzed for BTEX by method 8021B and chlorides by EPA method 300.0. The groundwater sampling results are summarized in Table 5.



Referring to Table 5, the groundwater collected at MW-1 showed BTEX concentrations below the laboratory reporting limit. However, a chloride concentration of 1,610 mg/kg was detected at MW-1.

### **SOIL REMEDIATION**

The NMOCD approved the Addendum to the Work Plan submitted by Tetra Tech dated August 18, 2016. The work plan and the addendum detailed the proposed remediation activities for the impact to the south and to the west of the Globe facility.

On February 27-March 23, 2017, Tetra Tech personnel were onsite to supervise the remediation of the impacted soils. Approximately 4,800 cubic yards were removed and hauled to Sundance Disposal located in Eunice, New Mexico. To prevent vertical migration of the impacted soils, a 40 mil liner was then installed at 5.0' below surface to cap the areas of auger holes (AH-1, AH-2, AH-3, AH-4, AH-6, and AH-7).

Once excavated to the appropriate depth, the areas were backfilled with clean soil to grade. The excavated areas and depths highlighted (green) in Table 1 and shown on Figure 5. The soil remediation details were divided into two areas for simplicity. The South Release Area included the areas of auger holes (AH-1 through AH-14) and the West Release area included the areas of auger holes (AH-15 through AH-24).

During the excavation activities, sidewall samples or bottom hole samples were collected and field screened to confirm the impacted soils with chloride concentrations above 250 mg/kg and TPH concentrations above 100 mg/kg were properly removed from the area. Soil samples were either sampled for TPH and/or chlorides depending on the constituents of concern identified during the investigation. Selected samples were analyzed for chloride by EPA method 300.0 and TPH by method 8021B. Copies of the laboratory analysis chain-of-custody documentation are included in Appendix E. The sidewall sample results are summarized in Table 3. The sidewall sample locations are shown on Figure 5.

### South Release Area

The areas of auger holes (AH-1, AH-2, AH-3, AH-7, AH-13, and AH-14) were excavated to depth of 5.0'-5.5' below surface and the area of auger hole (AH-6) was excavated to a depth of 6.0' below surface. In the area of auger hole (AH-4), which showed deeper chloride impact to the soils, the area was excavated to 19.0' below surface. Additionally, the areas of auger holes (AH-8, AH-9, and AH-12) were excavated to a depth of 1.5'-2.0' below surface. In addition, a total of seventeen (17) sidewall samples were collected in the south area of the Globe facility. Figure 5a shows the sample locations and Table 3 summarizes the sampling results.

Referring to Table 3, the sidewall samples collected at sidewalls (BH-3 WSW and BH-3 ESW) showed TPH concentrations below the laboratory reporting limits. The samples collected at sidewalls (AH-9 WSW, AH-9 SSW, BH-6 SSW, BH-5 SSW, BH-2 WSW, BH-1 WSW, BH-1 SSW, BH-7 NSW, BH-7 NWSW, BH-7 SWSW, BH-7 SESW, and BH-7 NESW) showed chloride concentrations ranging from 6.01 mg/kg to 192 mg/kg. However,



the sidewall samples collected to the east of the excavation, along the adjoining property line (BH-1 ESW and BH-2 ESW) showed chloride concentrations of 4,160 mg/kg and 5,840 mg/kg, respectively. Additionally, two (2) bottom hole samples (BH-7 NBH and BH-7 SBH) were collected in the area of borehole (BH-7), which showed chloride concentrations of 54.4 mg/kg and 144 mg/kg, respectively.

## West Release Area

The areas of auger holes (AH-19 and AH-20) were excavated to a depth of 6" below surface, the areas of auger holes (AH-15, AH-16, AH-17, AH-22, and AH-23) were excavated to a depth of 1.5'-2.0' below surface. In addition, the area of auger hole (AH-21) was excavated to depth of 3.0' below surface. A total of ten (10) sidewall samples were collected during the excavation of the soils in the west area of the Globe facility. Figure 5b shows the samples and Table 3 summarizes the sampling results.

Referring to Table 3, the sidewall sample collected at (AH-17 WSW) showed a chloride concentration of 152 mg/kg. The samples collected at (BH-8 SSW, BH-8 WSW, BH-8 NSW, AH-17 WSW, AH-20 SSW, AH-20 NSW, BH-12 WSW, AH-22 NWSW, and BH-12 NSW) showed TPH concentrations ranging between <10.0 mg/kg and 106 mg/kg. In the area of (AH-19 WSW) elevated TPH concentrations were detected at the original sidewall location and was then expanded an additional 5', which then showed a sidewall concentration of 275 mg/kg. However, after the area was expanded further, a TPH concentration of 548 mg/kg was detected. Further excavation was not performed in this area due to the area sloping uphill and the impact does not appear to be related to the release.

Additionally, two (2) bottom hole samples (AH-17 BH and BH-11 BH) were collected in the areas of AH-17 and BH-11 to confirm the impacted materials were properly removed. The sample collected at (AH-17 BH) showed a chloride concentration of 76.2 mg/kg and the sample collected at (BH-11 BH) showed a TPH concentration of <10.0 mg/kg.

## **CONCLUSIONS**

### Soil Remediation

Approximately 4,800 cubic yards were removed and hauled to Sundance Disposal located in Eunice, New Mexico. All of the impacted soils on Chevron property have been properly removed to the appropriate or proposed depths, including the spill footprint. In addition, the areas of auger holes (AH-1, AH-2, AH-3, AH-4, AH-6, and AH-7) were capped with a 40 mil liner to prevent vertical migration of the deeper impact.

Based on the remediation activities performed at the site, Globe requests closure of the soils issue on the Chevron property. The final C-141 form is included in Appendix A. However, the impacted soils (south area) encountered along the adjoining property line (BH-1 ESW and BH-2 ESW) showed chloride concentration of 4,160 mg/kg and 5,840 mg/kg, respectively. These impacted soils will be properly addressed to assess and proper removal of the impacted soil.



#### **RECOMMENDATIONS**

## Proposed Monitor Well Installation and Construction

As was approved in the Work Plan submitted by Tetra Tech, dated June 1, 2016, two additional monitor wells are proposed to be installed at the site. One monitor well is proposed to be installed between the areas of BH-1 (AH-6) and BH-2 (AH-7) and one monitor well to be installed between the areas of BH-5 (AH-3) and BH-6 (AH-1). Prior to the installation of the monitor wells, appropriate permits will be obtained from the New Mexico Office of the State Engineer (NMOSE).

Tetra Tech will supervise the installation of permanent monitor wells to a total depth of approximately 40-45' below surface using an air rotary rig. The monitor wells will be constructed of 2-inch diameter, screw threaded, schedule 40 PVC casing and 0.020 inch factory slotted screen. The well screens, approximately twenty (20) feet in length, will be installed with approximately 15.0' of screen into the groundwater and 5.0' above the groundwater. The well screens will be filter packed with graded (20-40) silica sand, which will be placed in the annular space between the borehole wall and screen to a depth of approximately two (2) feet above the screen. Bentonite pellets (hydrated) will be placed on top of the sand to complete the well. The wells will be secured with a locking water tight cap, and a steel sleeve will be placed around the well. In addition, the monitor wells (3) will be surveyed by a licensed professional surveyor.

Once completed, the monitor wells will be properly developed and all of the fluids will be contained in drums for proper disposal. At the time of sampling, the well caps will be opened and water level measurements will be collected from the top of the casing. The depth to water measurements will be recorded to the nearest 0.01 foot.

Prior to sampling, approximately three (3) casing volumes of water will be purged from each well using a dedicated bailer and disposable line. All water generated for the purging will be contained in drums for proper disposal. The groundwater samples will be placed into labeled and preserved containers provided by the laboratory and analyzed for chlorides by EPA method 300.0 and BTEX by EPA Method 8021B.

## Proposed Soil Investigation - Off Site

Tetra Tech will investigate the impacted soils along the east property line in the area of (BH-1 ESW) and (BH-2 ESW), which were identified during the excavation when the east sidewall samples were collected along the east property line. The property owner will be contacted to collect soil samples for proper removal of the impacted soils. Soil samples will be collected from the area to assess the soil for chlorides. Once the area is assessed, a work plan will be submitted to the NMOCD for review and approval.



## **EVALUATION AND REPORTING**

Once the proposed monitor wells are installed and the soil assessment is completed, Tetra Tech will assemble all of the data and prepared a report/work plan. The report/work plan will contain discussions of all of the soil and groundwater investigation activities, evaluation and recommendations. If you require any additional information or have any questions or comments concerning this work plan, please call at (432) 682-4559.

Respectfully submitted, TETRA TECH

Ike Tavarez, P.G.


Project Manager/Senior Geologist


Clair Gonzales, Geologist


cc:


Tommy Morris -Globe Kegan Boyer - Chevron


## Figures

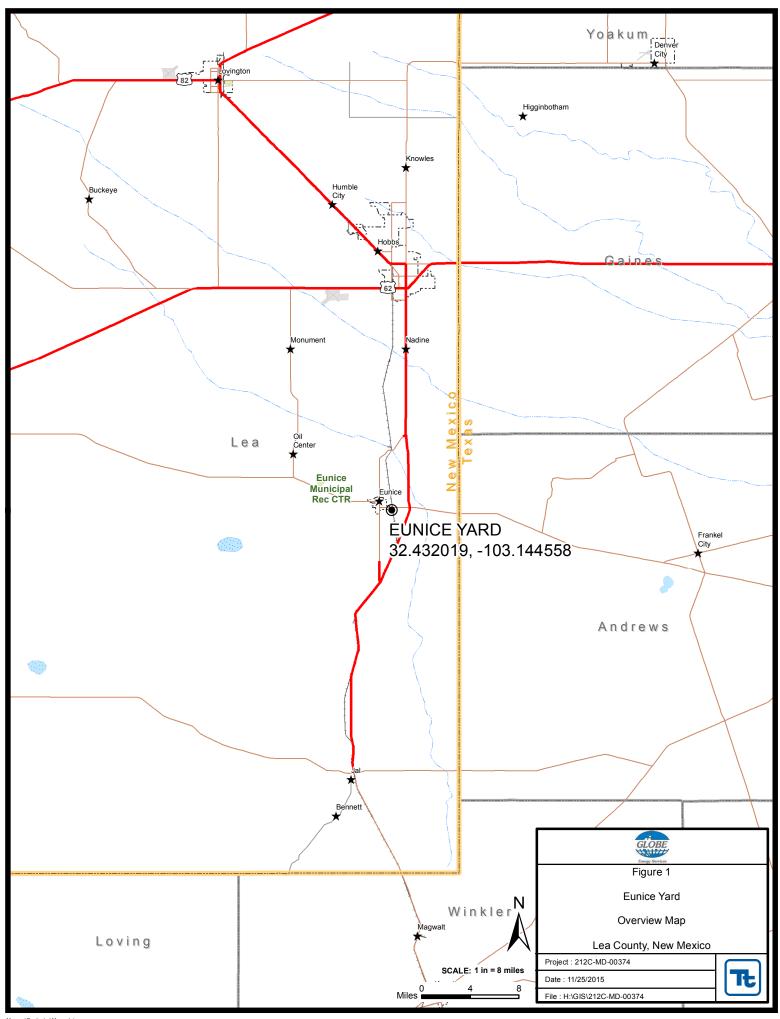


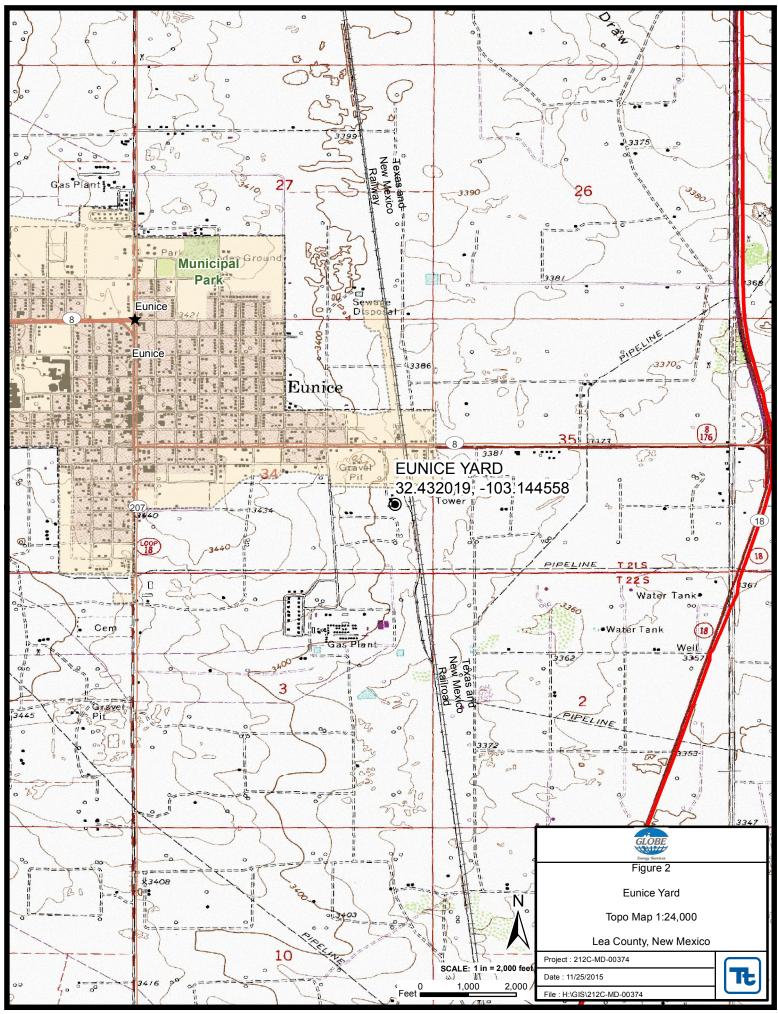


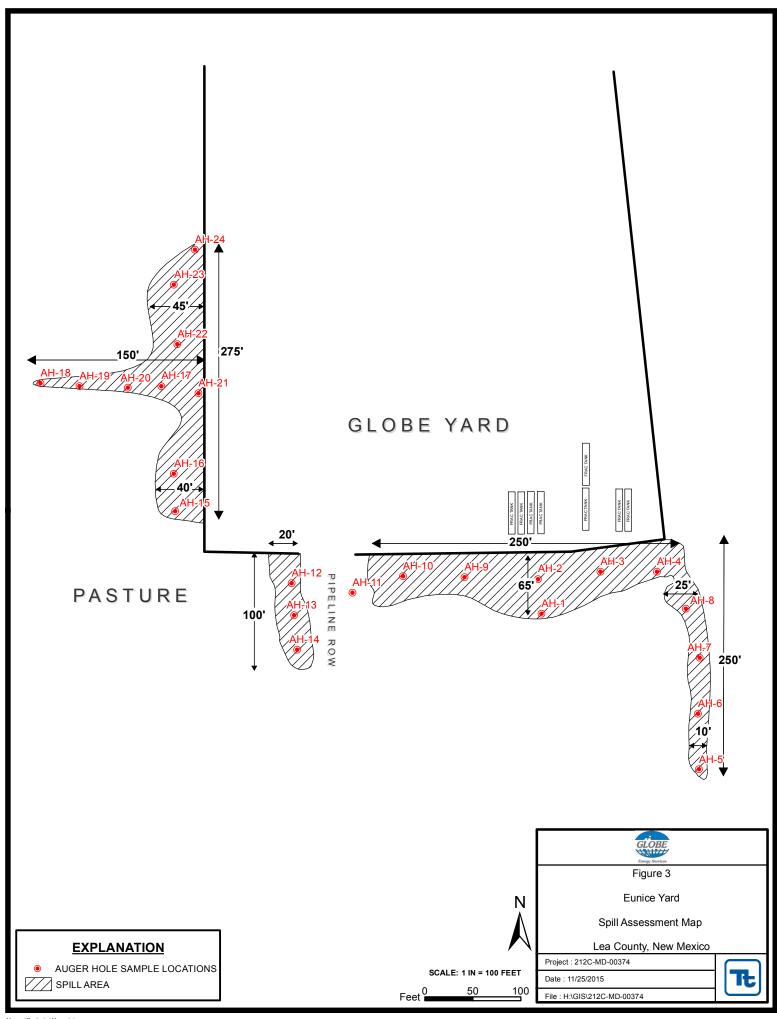


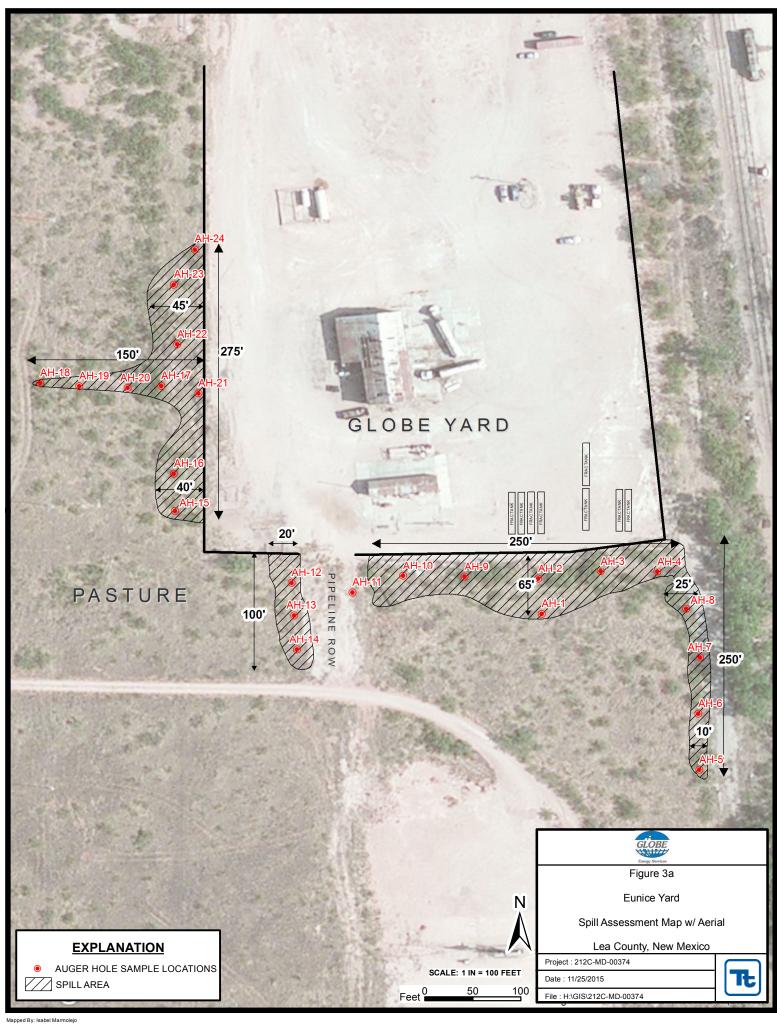

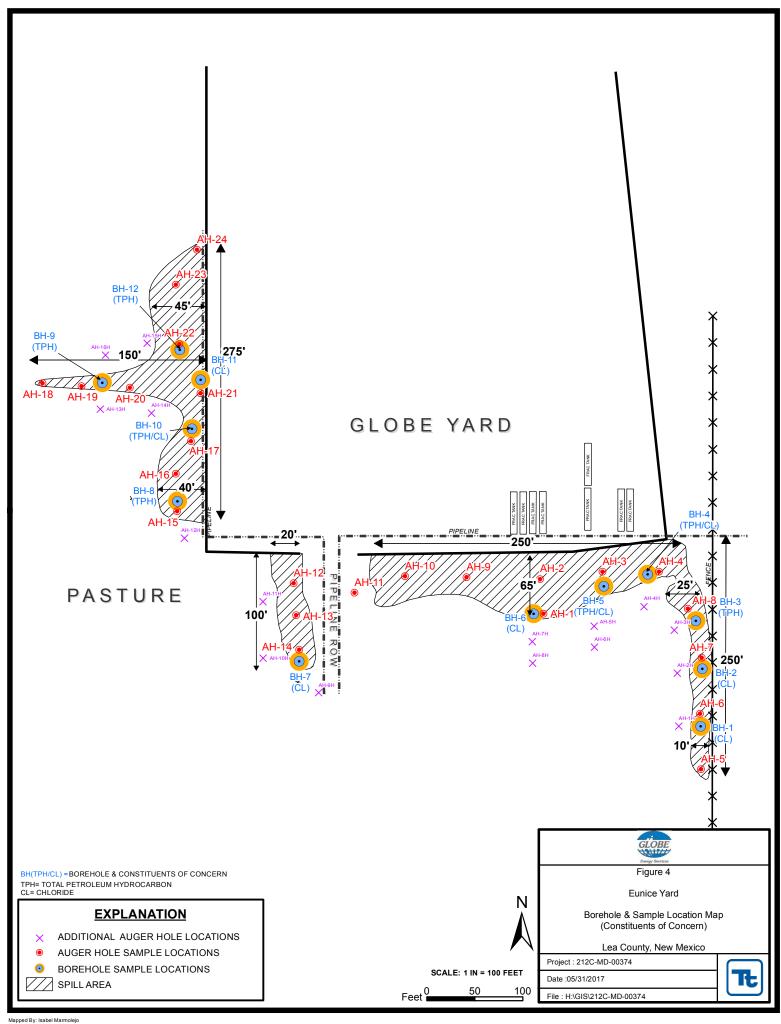

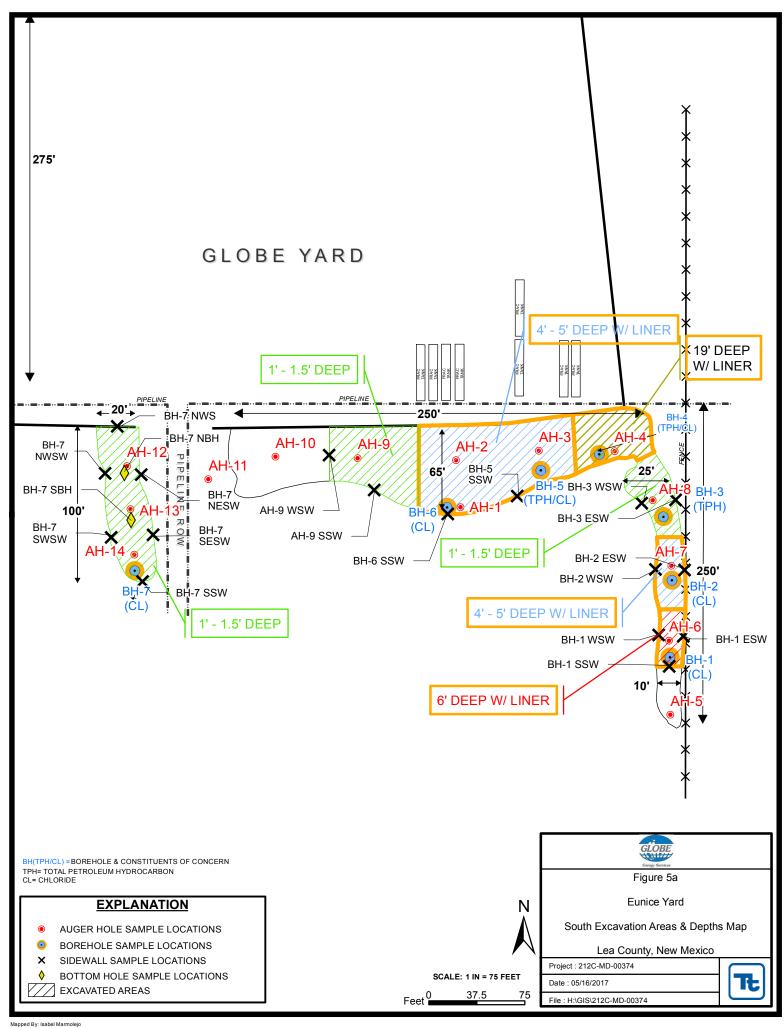

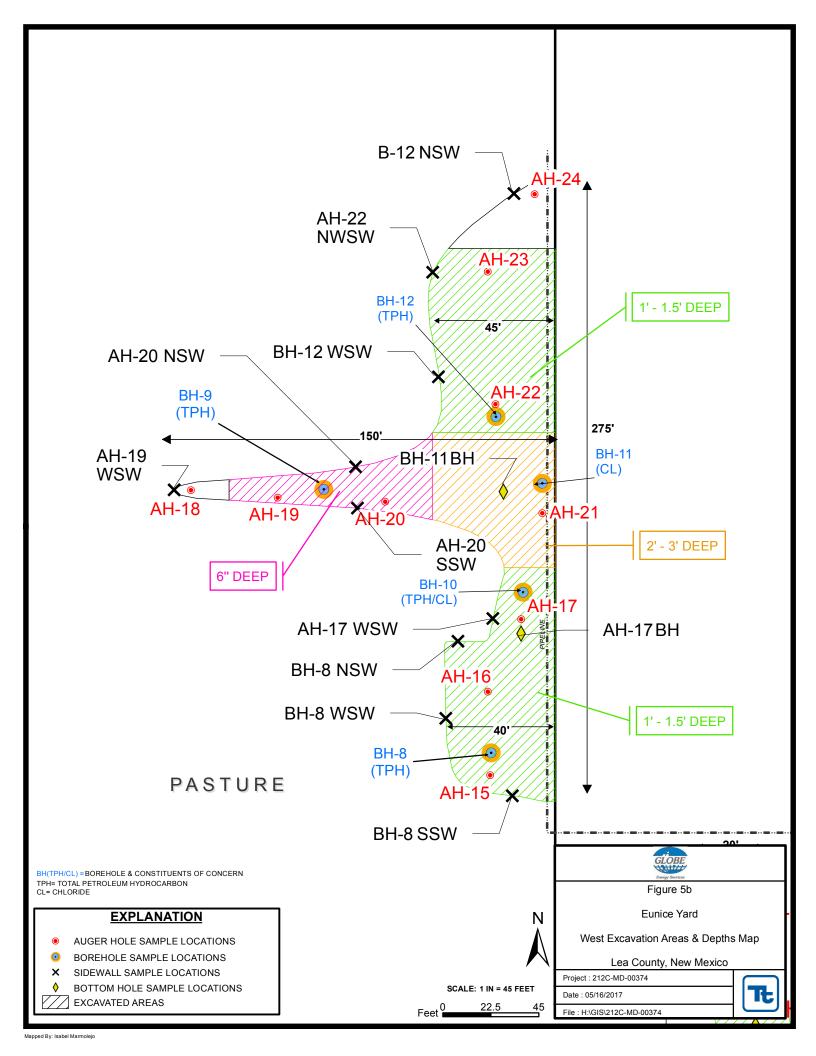

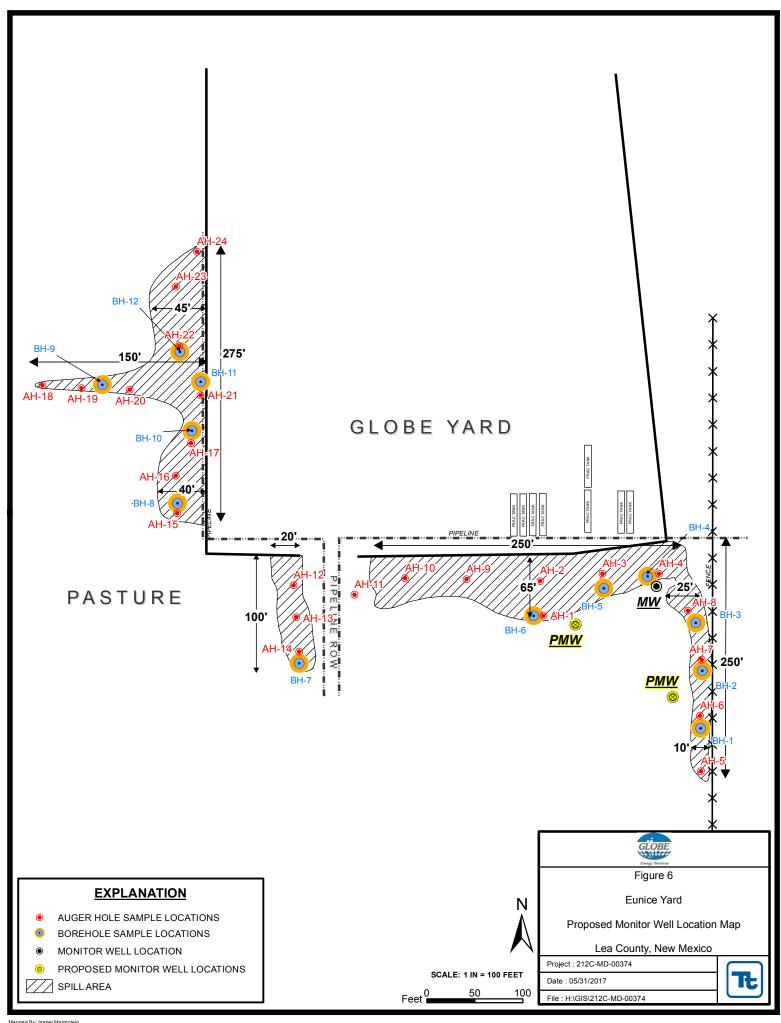

## **Tables**

Table 1
Globe Energy
Globe Eunice Facilty
Soil Assessment
Lea County, New Mexico

0 1 10		Sample	Soil	Status		TPH (	mg/kg)		Benzene	Toluene	Ethlybenzene	Xylene	Total BTEX	Chloride
Sample ID	Sample Date	Depth (ft)	In-Situ	Removed	GRO	DRO	ORO	Total	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)
AH-1	11/19/2015	0-1		X	<15.0	350	<15.0	350	<0.00101	<0.00202	<0.00101	<0.00101	<0.00101	320
	"	1-1.5		Х	16.6	<15.0	<15.0	16.6	-	ı	-	ı	-	1,020
	"	2-2.5		Х	=	-	-	-	-	-	-	-	-	4,590
BH-6	1/21/2016	0-1		Х	=	-	-	-	-	=	=	=	-	525
	II .	2-3		X	-	-	-	-	-	-	-		-	3,700
	"	4-5		Х		-	-	-	-	-	-		-	7,630
	"	6-7	Χ		-	-	-	-	-	-	-	-	-	1,920
	"	9-10	Χ		-	-	-	-	-	-	-	-	-	1,620
	"	14-15	Χ		-	-	-	-	-	-	-	-	-	720
	"	19-20	Х		=	-	-	-	-	-	-	=	-	235
	"	24-25	Χ		-	-	-	-	-	-	-	-	-	370
AH-2	11/19/2015	0-1		Х	<14.9	<14.9	<14.9	<14.9	-	-	-	-	-	3,080
	"	1-1.5		Х	-	-	-	-	-	-	=	-	-	2,800
AH-3	11/19/2015	0-1		X	<15.0	826	<15.0	826	<0.00166	<0.00332	<0.00166	<0.00166	<0.00166	625
BH-5	1/20/2016	0-1		Х	-	-	-	-	-	-	=	-	-	133
	"	2-3		Х	<15.0	<15.0	<15.0	<15.0	-	-	-	-	-	7,070
	II .	4-5		Х	-	-	-	-	-	-	-	-	-	3,150
	II .	6-7	Х		-	-	-	-	-	-	-	-	-	1,340
	"	9-10	Х		-	-	-	-	-	-	-	-	-	234
	"	14-15	Х		-	-	-	-	-	-	-	-	-	146
	"	19-20	Х		-	-	-	-	-	-	-	-	-	44.2
	"	24-25	Х		-	-	-	-	-	-	=	-	_	426

Table 1
Globe Energy
Globe Eunice Facilty
Soil Assessment
Lea County, New Mexico

						TPH (mg/kg)				enzene Toluene				
Sample ID	Sample Date	Sample	Soil	Status		TPH (	mg/kg)		Benzene	Toluene	Ethlybenzene	Xylene	Total BTEX	Chloride
		Depth (ft)	In-Situ	Removed	GRO	DRO	ORO	Total	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)
AH-4	11/19/2015	0-1		Х	116	2,690	<74.9	2,810	<0.00101	<0.00202	<0.00101	<0.00101	<0.00101	676
	"	1-1.5		Х	<15.0	183	38.7	222	-	-	-	-	-	971
	II .	2-2.5		Х	<15.0	223	79.5	303	<0.00101	<0.00202	<0.00101	<0.00101	<0.00101	4,080
	II .	2.5-3		Х	<15.0	133	33.7	167	-	-	1	•	-	5,190
BH-4	1/20/2016	0-1		Х	-	-	-	-	-	-	-	-	-	4,880
	"	2-3		Х	-	-	-	-	-	-	-	-	-	6,460
	II .	4-5		Х	<15.0	<15.0	<15.0	<15.0	-	-	-	-	-	9,060
	"	6-7		Х	-	-	-	-	-	-	-	-	-	6,570
	"	9-10		Х	-	-	-	-	-	-	-	-	-	10,200
	"	14-15		Х	-	-	-	-	-	-	-	-	-	10,100
	"	19-20		Х	-	-	-	-	-	-	-	-	-	3,780
	"	24-25	Х		-	-	-	-	-	-	-	-	-	1,320
AH-5	11/19/2015	0-1		Х	<15.0	<15.0	<15.0	<15.0	-	-	-	-	-	110
	II .	1-1.5		Х	-	-	-	-	-	-	-	-	-	32.2
	п	2-2.5		Х	-	-	-	-	-	-	-	-	-	70.9
	II .	2.5-3		Х	-	-	-	-	-	-	-	-	-	29.7
AH-6	11/19/2015	0-1		Х	<15.0	<15.0	<15.0	<15.0	-	-	-	-	-	3,050
BH-1	1/20/2016	0-1		Х	-	-	-	-	-	-	-	-	-	11.4
	"	2-3		Х	-	-	-	-	-	-	-	-	-	2,740
	"	4-5		Х	-	-	-	-	-	-	-	-	-	8,850
	"	6-7		Х	-	-	-	-	-	-	-	-	-	2,960
	п	9-10	Х		-	-	-	-	-	-	-	-	-	217
	п	14-15	Х		=	-	-	-	-	-	-	-	-	840
	п	19-20	Х		=	-	-	-	-	-	-	-	-	505
	"	24-25	Х		-	_	_	-	-	_	_	_	-	286

## Table 1 Globe Energy Globe Eunice Facilty Soil Assessment Lea County, New Mexico

Sample Date	Sample	Soil	Status		TPH (	mg/kg)	1	Benzene	Toluene	Ethlybenzene	Xylene	Total BTEX	Chloride
Gample Bate	Depth (ft)	In-Situ	Removed	GRO	DRO	ORO	Total	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)
11/19/2015	0-1		Х	<15.0	<15.0	<15.0	<15.0	-	-	-	-	-	588
1/20/2016	0-1		Χ	-	-	-	-	-	-	-	-	-	2,360
"	2-3		Х	-	-	-	-	-	-	-	-	-	8,890
"	4-5		Х	=	-	-	-	-	-	-	-	-	2,030
"	6-7	Х		-	-	-	-	-	-	-	-	-	619
II .	9-10	X		-	1	-	-	-	-	1	1	-	338
II .	14-15	Х		-	ı	-	-	-	-	1	1	-	381
II .	19-20	Χ		-	1	-	-	-	-	-	1	-	99.0
"	24-25	Х		-	-	-	-	-	-	-	-	-	455
11/19/2015	0-1		X	107	1,260	<74.7	1,370	<0.00164	<0.00328	<0.00164	<0.00164	<0.00164	44.1
1/21/2016	0-1		Х										
"	2-3		Х	<14.9	<14.9	<14.9	<14.9	-	-	-	-	-	-
"	4-5	Х											
"	6-7	Х											
II .	9-10	Х											
11/19/2015	0-1		Х	<15.0	<15.0	<15.0	<15.0	-	-	-	-	-	1,370
п	1-1.5		Х	=		-	-	-	-	-	-	-	32.6
11/19/2015	0-1	Х		<15.0	<15.0	<15.0	<15.0	-	-	-	-	-	215
11/19/2015	0-1	Х		<15.0	<15.0	<15.0	<15.0	-	-	-	-	-	64.4
11	1-1.5	Х		-	-	-	-	-	-	-	-	-	69.3
11/19/2015	0-1		Х	<15.0	<15.0	<15.0	<15.0	-	-	-	-	-	1,230
11/19/2015	0-1		Х	<14.9	<14.9	<14.9	<14.9	-	-	-	-	-	610
	1/20/2016  " " " " " " 11/19/2015  1/21/2016  " " " 11/19/2015  11/19/2015  11/19/2015  11/19/2015	11/19/2015   Depth (ft)	Sample Date   Depth (ft)   In-Situ	Depth (ft)   In-Situ   Removed	Sample Date         Depth (ft)         In-Situ         Removed         GRO           11/19/2015         0-1         X         <15.0	Name	Sample Date   Depth (ft)   In-Situ   Removed   GRO   DRO   ORO	Sample Date   Depth (ft)   In-Situ   Removed   GRO   DRO   ORO   Total	Sample Date   Depth (ft)   In-Situ   Removed   GRO   DRO   ORO   Total   (mg/kg)	Sample Date   Depth (ft)   In-Situ   Removed   GRO   DRO   ORO   Total   (mg/kg)   (mg/kg)	Sample Date   Depth (ft)   In-Situ   Removed   GRO   DRO   ORO   Total   (mg/kg)   (mg/kg)   (mg/kg)	Sample Date   Depth (ft)   In-Situ   Removed   GRO   DRO   ORO   Total   (mg/kg)   (mg/kg)   (mg/kg)   (mg/kg)   (mg/kg)	Sample Date   Depth (ft)   In-Situ   Removed   GRO   DRO   ORO   Total   (mg/kg)   (

Table 1
Globe Energy
Globe Eunice Facilty
Soil Assessment
Lea County, New Mexico

		Sample	Soil	Status		TPH (	mg/kg)		Benzene	Toluene	Ethlybenzene	Xylene	Total BTEX	Chloride
Sample ID	Sample Date	Depth (ft)	In-Situ	Removed	GRO	DRO	ORO	Total	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)
AH-14	11/19/2015	0-1		Χ	<15.0	<15.0	<15.0	<15.0	-	-	-	-	-	1,340
BH-7	1/21/2016	0-1		Х	-	-	-	-	-	-	-	-	-	15.3
	n n	2-3		Х	-	-	-	-	-	-	-	-	-	41.5
	п	4-5		Х	-	-	-	-	-	-	-	-	-	8.38
AH-15	11/19/2015	0-0.5		Х	<15.0	566	<15.0	566	<0.000992	<0.00198	<0.000992	<0.000992	<0.000992	8.83
BH-8	1/21/2016	0-1		X										
	II .	2-3		Х	<14.9	<14.9	<14.9	<14.9	-	-	-	-	-	-
	"	4-5	Х											
	"	6-7	Х											
	II	9-10	Χ											
AH-16	11/19/2015	0-1		Х	<15.0	387	<15.0	387	<0.00101	<0.00201	<0.00101	<0.00101	<0.00101	20.4
	п	1-1.5		Х	<15.0	<15.0	<15.0	<15.0	-	-	-	-	-	36.5
AH-17	11/19/2015	0-1		Х	<15.0	283	<15.0	283	-	-	-	-	-	3,210
BH-10	1/21/2016	0-1		Х	-	-	-	-	-	-	-	-	-	131
	п	2-3		Х	<15.0	<15.0	<15.0	<15.0	-	-	-	-	-	4,210
	II .	4-5	Х		-	-	-	-	-	-	-	-	-	259
	"	6-7	Х		-	-	-	-	-	-	-	-	-	128
	"	9-10	Х		ı	-	-	-	=	-	-	-	-	254
	"	14-15	Х		-	1	-	-	-	-	-	-	-	196
	"	19-20	Х		-	1	-	-	-	-	-	-	-	50.8
	"	24-25	Х		-	-	-	-	-	-	-	-	-	76.1

## Table 1 Globe Energy Globe Eunice Facilty Soil Assessment Lea County, New Mexico

		Sample	Soil	Status		TPH (	mg/kg)		Benzene	Toluene	Ethlybenzene	Xylene	Total BTEX	Chloride
Sample ID	Sample Date	Depth (ft)	In-Situ	Removed	GRO	DRO	ORO	Total	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)
AH-18	11/19/2015	0-0.5		Х	<15.0	24.7	<15.0	24.7	-	-	-	-	-	47.9
AH-19	11/19/2015	0-0.5		Х	<15.0	224	<15.0	224	-	-	-	-	-	14.6
<b>BH-9</b> (AH-19 & AH-20)	1/21/2016	0-1		Х										
	ıı .	2-3	Х		<15.0	<15.0	<15.0	<15.0	-	-	-	-	-	-
	"	4-5	Х											
	"	6-7	Х											
	II .	9-10	Х											
AH-20	11/19/2015	0-0.5		Х	<15.0	299	<15.0	299	-	-	-	-	-	36.8
AH-21	11/19/2015	0-1		Х	<15.0	320	<15.0	320	<0.000996	<0.00199	<0.000996	<0.000996	<0.000996	15.4
	"	1-1.5		Х	<15.0	36.7	<15.0	36.7	-	-	-	-	-	727
BH-11	1/21/2016	0-1		Х	-	-	-	-	-	-	-	-	-	<2.00
	"	2-3		Х	-	-	-	-	-	-	-	-	-	4,170
	II .	4-5	Х		-	-	-	-	-	-	-	-	-	82.2
	"	6-7	Х		-	-	-	-	-	-	-	-	-	14.3
	"	9-10	Х		-	-	-	-	-	-	-	-	-	78.0
	"	14-15	Х		-	-	-	-	-	-	-	-	-	40.7
	II .	19-20	Х		-	-	-	-	-	-	-	-	-	69.5
AH-22	11/19/2015	0-1		Х	<14.9	530	<14.9	530	<0.00101	<0.00202	<0.00101	<0.00101	<0.00101	8.36
	"	1-1.5		Х	<15.0	375	<15.0	375	<0.00164	<0.00329	<0.00164	<0.00164	<0.00164	7.64
BH-12	1/21/2016	2-3		Х	<15.0	<15.0	<15.0	<15.0	-	-	-	-	-	-
AH-23	11/19/2015	0-1		Х	<15.0	<15.0	<15.0	<15.0	-	-	-	-	-	345
	"	1-1.5		Х	-	-	-	-	-	-	-	-	-	284
	"	2-2.5	Х		-	-	-	-	-	-	-	-	-	104
AH-24	11/19/2015	0-1	Х		<15.0	<15.0	<15.0	<15.0	-	-	-	-	-	30.5



## Table 2 Globe Energy Globe Eunice Facilty Soil Assessment - Horizontal Delineation

## Lea County, New Mexico

Sample ID	Sample Date	Sample	Soil	Status		TPH (	mg/kg)		Chloride
Sample ID	Sample Date	Depth (ft)	In-Situ	Removed	GRO	DRO	ORO	Total	(mg/kg)
AH-1 horizontal	1/21/2016	0-1	Х		-	-	-	-	2.33
AH-2 horizontal	1/21/2016	0-1	Х		-	-	-	-	<2.00
	II .	1-1.5	Х		-	-	-	-	2.93
AH-3 horizontal	1/21/2016	0-1	Х		<14.9	<14.9	<14.9	<14.9	-
AH-4 horizontal	1/21/2016	0-1	Х		<15.0	<15.0	<15.0	<15.0	531
AH-5 horizontal	1/21/2016	0-1	Х		<15.0	<15.0	<15.0	<15.0	<2.00
	"	1-1.5	Х		-	-	-	-	3.45
	"	2-2.5	Χ		-	-	-	-	316
AH-6 horizontal	1/21/2016	0-1	Χ		-	-	-	-	2.80
	"	1-1.5	Χ		-	1	ı	ı	<2.00
	"	2-2.5	X		-	-	-	-	4.00
AH-7 horizontal	1/21/2016	0-1	Х		-	-	-	-	30.1
	"	1-1.5	Х		-	-	-	-	216
AH-8 horizontal	1/21/2016	0-1	Х		-	-	-	-	3.58
	"	1-1.5	Х		-	-	-	-	8.93

## Table 2 Globe Energy Globe Eunice Facilty Soil Assessment - Horizontal Delineation Lea County, New Mexico

Commis ID	Commis Data	Sample	Soil	Status		TPH (	mg/kg)		Chloride
Sample ID	Sample Date	Depth (ft)	In-Situ	Removed	GRO	DRO	ORO	Total	(mg/kg)
AH-9 horizontal	1/21/2016	0-1	Χ		-	-	-	-	5.52
	"	1-1.5	Χ		1	-	-	-	9.80
All 40 havinantal	4/04/0046	0.4	V						44.0
AH-10 horizontal	1/21/2016	0-1	Х		-	-	-	-	11.3
	"	1-1.5	Χ		-	-	-	-	18.9
AH-11 horizontal	1/21/2016	0-1	Х		-	-	-	-	3.34
AH-12 horizontal	1/21/2016	0-1	Х		<14.9	<14.9	<14.9	<14.9	-
AH-13 horizontal	1/21/2016	0-0.5	Х		<15.0	<15.0	<15.0	<15.0	4.31
AH-14 horizontal	1/21/2016	0-0.5	Х		15.0	<15.0	<15.0	15.0	18.8
AH-15 horizontal	1/21/2016	0-1	Х		<15.0	<15.0	<15.0	<15.0	<2.00
	"	1-1.5	Χ		-	-	-	-	<2.00
AH-16 horizontal	1/21/2016	0-0.5	Х		23.4	711	91.0	825	2.62

( - ) Not Analyzed

## Table 3 Globe Energy Globe Eunice Yard Soil Remediation - Confirmation Sampling

## Lea County, New Mexico

O was to ID	0	Sample	BEB	Soil	Status		TPH (	mg/kg)		Chloride
Sample ID	Sample Date	Depth (ft)	Sample Depth (ft)	In-Situ	Removed	GRO	DRO	ORO	Total	(mg/kg)
		So	uth Excav	ation A	rea					
BH-1 East Sidewall	3/14/2017	-	-	Χ		-	-	-	-	4,160
BH-1 West Sidewall	3/14/2017	-	-	Х		-	-	-	-	48.0
BH-1 South Sidewall	3/15/2017	-	-	Х		-	-	-	-	192
BH-2 West Sidewall	3/14/2017	-	-	Х		-	-	-	-	48.0
BH-2 East Sidewall	3/14/2017	-	-	Х		-	-	-	-	5,840
BH-3 West Sidewall	3/14/2017	-	-	Х		<10.0	<10.0	<10.0	<10.0	-
BH-3 East Sidewall	3/14/2017	-	-	Х		<10.0	<10.0	<10.0	<10.0	-
BH-5 South Sidewall	3/15/2017	-	-	Х		-	-	-	-	96.0
BH-6 South Sidewall	3/15/2017	-	-	Х		-	-	-	-	144
AH-9 South Sidewall	3/14/2017	-	-	Х		-	-	-	-	32.0
AH-9 West Sidewall	3/14/2017	-	-	Х		-	-	-	-	80.0
BH-7 Bottom Hole North	3/3/2017	-	1.5	Х		-	-	-	-	54.4
BH-7 South West Sidewall	3/3/2017	-	-	Х		-	-	-	-	6.61
BH-7 North West Sidewall	3/3/2017	-	-	Х		-	-	-	-	6.01
BH-7 South Sidewall	3/3/2017	-	-	Х		-	-	-	-	5.47
BH-7 North Sidewall	3/3/2017	-	-	Х		-	-	-	-	68.7
BH-7 North East Sidewall	3/3/2017	-	-	Х		-	-	-	-	12.4
BH-7 South East Sidewall	3/8/2017	-	-	Х		-	-	-	-	192
BH-7 South Sidewall	3/8/2017	-	-	Х		-	-	-	-	144
BH-7 South Bottom Hole	3/8/2017	-	5.5	Χ		-	-	-	-	144

## Table 3 Globe Energy Globe Eunice Yard

## Soil Remediation - Confirmation Sampling Lea County, New Mexico

Sample ID	Sample Date	Depth (ft)	Sample							Chloride
		Dopair (it)	Depth (ft)	In-Situ	Removed	GRO	DRO	ORO	Total	(mg/kg)
		W	est Excava	ation Ar	ea					
BH-8 North Sidewall	3/1/2017	-	-	Χ		<15.0	<15.0	<15.0	<15.0	-
BH-8 West Sidewall	3/1/2017	-	-		Χ	<15.0	308	62.2	370	-
	3/8/2017	-	-	Х		<10.0	37.4	68.3	106	-
BH-8 South Sidewall	3/1/2017	-	-		Х	<15.0	178	30.5	209	-
	3/8/2017	-	-	Χ		<10.0	<10.0	<10.0	<10.0	-
BH-11 Bottom Hole	3/8/2017	-	2.0		Х	<10.0	185	246	431	112
	3/10/2017		2.5		Х	<10.0	141	171	312	-
	3/20/2017		3.0	Χ		<10.0	<10.0	<10.0	<10.0	-
BH-12 North Sidewall	3/8/2017	-	-	Х		<10.0	14.6	17.1	31.7	-
BH-12 West Sidewall	3/8/2017	-	-	Х		<10.0	<10.0	<10.0	<10.0	-
AH-17 West Sidewall	3/1/2017	-	-		Х	<15.0	952	209	1,160	152
	3/8/2017	-	-		X	<10.0	161	191	352	•
	3/10/2017	-	-	Χ		<10.0	<10.0	<10.0	<10.0	-
AH-17 Bottom Hole	3/1/2017	-	2.0	Х		-	-	-	-	76.2
AH-19 West Sidewall	3/1/2017	-	-		Х	<15.0	808	218	1,030	-
	3/8/2017	-	-		Х	<10.0	113	162	275	-
	3/10/2017	-	-	Χ		<50.0	239	309	548	-
AH-20 North Sidewall	3/1/2017	-	-		Х	<15.0	1,680	395	2,080	-
	3/8/2017	-	-		Х	<10.0	133	175	308	-
	3/10/2017	-	-		Χ	<50.0	311	370	681	-
	3/20/2017	-	-	Χ		<10.0	<10.0	<10.0	<10.0	-
AH-20 South Sidewall	3/1/2017	-	-		Х	<15.0	1,610	380	1,990	-
	3/8/2017	-	-		Х	<10.0	422	478	900	-
<b> </b>	3/10/2017	-	-		Χ	<50.0	170	219	389	-
	3/20/2017	-	-	Х		<10.0	<10.0	<10.0	<10.0	-
AH-22 North West Sidewall	3/1/2017	-	-		Х	<15.0	375	108	483	-
	3/5/2017	-	-	Χ		<10.0	<10.0	<10.0	<10.0	-

( - ) Not Analyzed Excavated Areas

Table 4
Globe Energy Services
Eunice Yard
MW-1 - Soils Analysis
Lea County, New Mexico

0 1 15		Sample	Soil	Status	7	ΓPH (mg/k	g)	Benzene	Toluene	Ethlybenzene	Xylene	Total BTEX	Chloride
Sample ID	Sample Date	Depth (ft)	In-Situ	Removed	GRO	DRO	Total	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)
MW-1	9/20/2016	5	Х		-	-	-	-	-	-	-	-	294
	"	10	Χ		<15.0	<15.0	<15.0	<0.00149	<0.00149	<0.00149	<0.00199	<0.00149	197
	"	15	Х		-	-	-	-	-	-	-	-	239
	"	20	Х		<15.0	21.9	21.9	<0.00149	<0.00149	<0.00149	<0.00198	<0.00149	193

( - ) Not Analyzed

# Table 5 Globe Energy Services MW-1 - Groundwater Analysis Eunice Yard Lea County, New Mexico

Sample ID	Sample Date	Benzene (mg/L)	Toluene (mg/L)	Ethlybenzene (mg/L)	Xylene (mg/L)	Total BTEX (mg/L)	Chloride (mg/L)
MW-1	9/22/2016	<0.00200	<0.00150	<0.00200	<0.00200	<0.00150	1,610

## **Photos**





View West – Area of AH-1 and AH-2



View East - Area of AH-4





View South – Area of AH-7 and AH-8



View South- Area of AH-5 and AH-6





View South - Area of AH-12, AH-13 and AH-14



View Northeast – Area of AH-15 and AH-16





View West - Area of AH-17, AH-18 and AH-19



View Northeast - Area of AH-22, AH-23, and AH-24





View East - Area of BH-1



View East – Area of BH-2





View North - Area of BH-3



View West - Area of BH-4





View North - Area of BH-5



View North - Area of BH-6





View East – Area of BH-8



View North – Area of BH-10, BH-11, and BH-12





View West - Area of BH-9



View North - Area of MW-1





View South - Excavated Area of BH-1



View South – Excavated Area of BH-2 and BH-3





View East - Excavated Area of BH-4



View East – Excavated Area of BH-5





View Southeast - Excavated Area of BH-6



View West – Excavated Area of AH-9





View South – Excavated Area of BH-7



View South - Lined Area of BH-1 and BH-2





View Northeast - Lined Area of BH-4



View West – Lined Area of BH-5 and BH-6





View South – Backfilled Area of BH-1, BH-2, and BH-3



View East – Backfilled Area of BH-4, BH-5, and BH-6





View Southwest - Backfilled Area of AH-9



View South - Backfilled Area of BH-7





View South - Excavated Area of AH-15 and AH-16



View South – Excavated Area of AH-17 and AH-21





View West- Excavated Area of AH-19 and AH-20



View North – Excavated Area of AH-22 and AH-23





View North – Excavated Area of AH-22 and AH-23



View South – Backfilled Area of AH-15 and AH-16





View South – Backfilled Area of AH-17



View North - Backfilled Area of AH-21





View West – Backfilled Area of AH-19 and AH-20



View North – Backfilled Area of AH-22 and AH-23

## Appendix A

District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 S. First St., Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

#### State of New Mexic Energy Minerals and Natural

RECEIVED

By JKeyes at 3:27 pm, Nov 05, 2015

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505 Submit 1 Copy to appropriate District Office in accordance with 19.15.29 NMAC.

### **Release Notification and Corrective Action**

					0	PERAT	OR		al Report  Final Report				
Name of Co	ompany: (	Globe Energ	y Servic	es		Contact: Tommy Morris							
		ve. Eunice,		31		Telephone No.: (325) 207-7775							
Facility Na	ne: Eunic	e Fluid Ser	vices	V-0	Fac	Facility Type: Fluid Hauling							
Surface Ow	ner: Chev	ron USA In	ic.	Mineral Own	ier	API No.							
				LOCATI	ION (	OE BEI	FASE						
Unit Letter	Section	Township	Range			uth Line	Feet from the	East/West Line	County				
1	34	218	37E						Lea				
Medical Comments	L			Latitude 32.43356		Longitud F RELI		00					
Type of Rele	ase: Produ	ced Water		THEFOI			Release: Unkno	wn Volume	Recovered: None				
Source of Re							our of Occurrence	e: Date and	Hour of Discovery:				
						Unknown		October	26 <sup>th</sup> , 2015				
Was Immedi	ate Notice (		Var.	No Not Requi		If YES, To							
			ies L	No   Not Kedui		Jamie Key		th					
By Whom? 'Was a Water							our: October 26						
was a water	course Rea		Yes 🗵	1 No	100	n yes, vo N/A	iume impacting i	ine watercourse.					
70 771		pacted, Descr											
N/A													
Dogoribo Cox	on of Drobl	em and Reme	dial Antio	n Tokon *									
migrated off	site onto th	ne adjacent pi	operty.		aple the	e areas of			v Mexico. The fluids face soils and present a				
Describe Are	a Affected	and Cleanup /	Action Tal	cen.*			A						
				e Energy's property	line; o	utside the	fence						
regulations a public health should their or or the environ	Il operators or the envi operations h nment. In a	are required to ronment. The save failed to a	report as acceptant dequately ICD accep	nd/or file certain relea ce of a C-141 report b investigate and reme	ise notif by the N ediate co	fications ar IMOCD ma ontamination	nd perform correct arked as "Final R on that pose a thr	tive actions for rel cport" does not rel eat to ground wate	suant to NMOCD rules and eases which may endanger feve the operator of liability r, surface water, human health compliance with any other				
		. /					OIL CON	SERVATION	DIVISION				
Signature:	-11	//.			-								
orginature.	700	77 رخ			An	proved by	Environmental S	nacialists /an	* Hlyer				
Printed Name	101	nmy Me	rris		Ap	proved by	Environmental 5	pecialist,					
Title: /	SE D	rector			Ap	proval Dat	e: 11/05/2015	Expiration	01/06/2015 Date:				
E-mail Addre	ess: tom	my.morr	is@ge	es/lc.com :325-207-7775	Con	screte site s	Approval: amples required.		Attached				
Date: //- 5	1/5	oto If Nonces	Phone	:363-601-1775	ren	nediate per	NMOCD guidel otos of remediat	ines.					
Allach Addi	nonai She	ets If Necess	ai y		Ge	omegen pii	o to remediat	ion required.	nJXK1530955218 pJXK1530955355				

### Appendix B

## Water Well Data Average Depth to Groundwater (ft) Globe Eunice Facility Lea County, New Mexico

	:	20 Sc	uth	3	7 East			20 S	outh	3	8 East	:	20 9	South	39 East
6 <b>3</b>	<b>7</b> 5	38	4 <b>22</b>	3	2	1	6	5	4	3	2	1	6	5	4
7 3	<b>36</b> 8	35	9	10	11	12	7	8	9	10	11	12	7	8	9
18	1	7	16	15	14	13 <b>78</b>	18	17	16	15	14	13	18	17	16
19	2	0	21	22	23	24	19	20	21	22	23	24	19	20	21
<b>35</b> 30	2	9	28	27	26	25	30	29	28	27	26	25	30	29	28
31	3	2	33 198	34	35	36	31	32	33	34	35	36	31	32	33
		21 Sc		3	6 East	ı	· ·	21 S	outh	3	7 East		21 9	South	38 East
6	5		4	3	2	1	6 <b>73</b>	5		3	2	1	6	5	4
7	8		9	10 <b>200</b>	11	12	7	8	9	10	11	12	7	8	9
18	1	7	16 <b>195</b>	15	14	13	18	17	16	15	14	13	18	17	16
<b>106</b> 19	2	0	21	22	23130	24	19	20	<b>70</b> 21	22	23	24	19	20	21
30	2	9	28	27	1 <b>50</b> 26	25	30	<b>98</b> 29	28	<b>53</b> 27	26	25	30	29	28
31	3	2	33	34	35	148 36	31	<b>85</b> 32	71 33 100	76 34 <b>2</b>	9 35 48	36	31	32	33
		22.5	outh	36	East	l	l <u>L</u>	22	South	37	East		22 9	South	38 East
6	5		4	3	2	1	6		4	3	2	1	6	5	4
195	2	12				137									
7	8	1	9	10	11	12	7	8	9 90	10	11	12	7	8	9
18	1	7	16 <b>170</b>	15	14	13	18 <b>190</b>	17	16	15 <b>125</b>	14 <b>65</b>	13	18	17	16
19	2	0	21	22 22	23	24	19	20	21 <b>65</b>	22	23	24	19	20	21
30	2	9	28	27	26	25	30	29	28	27	26	25	30	29	28
31	3	2	33	<b>160</b> 34	35 181	118 36	31	32	33	<b>53</b> 34	<b>65</b> 35	36	31	32	33
	- 1		l	1	187	1				1	1	1			1

- 88 New Mexico State Engineers Well Reports
- 105 USGS Well Reports
- 90 Geology and Groundwater Conditions in Southern Lea, County, NM (Report 6) Geology and Groundwater Resources of Eddy County, NM (Report 3)
- 34 NMOCD Groundwater Data
- 123 Tetra Tech installed temporary wells and field water level
- 143 NMOCD Groundwater map well location



### New Mexico Office of the State Engineer Water Column/Average Depth to Water

(A CLW##### in the POD suffix indicates the POD has been replaced & no longer serves a water right file.)

(R=POD has been replaced, O=orphaned,

C=the file is

(quarters are 1=NW 2=NE 3=SW 4=SE)

closed) (quarters are smallest to largest) (NAD83 UTM in meters)

(In feet)

	POD Sub-			Q									Water
POD Number	Code basin	County	64	16	4	Sec	Tws	Rng	X	Y	Well	Water	Column
CP 00835		LE			3	34	21\$	37E	673454	3589786*	145		
CP 00943 POD1		LE	1	3	1	34	21S	37E	673166	3590405 🌑	142		
CP 01145 POD1		LE	2	2	2	34	215	37E	674514	3590848 🌑	90		
CP 01358 POD1		LE	2	1	4	34	21\$	37E	674134	3589539 🌑	65	48	17
CP 01358 POD2		LE	4	4	2	34	215	37E	674497	3589676 🌑	42	29	13
CP 01358 POD3		LE	4	4	1	34	21\$	37E	674434	3589782 🌑	45	32	13
CP 01358 POD4		LE	4	2	3	34	21S	37E	674307	3589974	45	40	5
CP 01358 POD5		LE	4	2	1	34	215	37E	674306	3590035 🌑	58	41	17
CP 01358 POD6		LE	4	2	3	34	215	37E	674271	3589921 🌑	26		

Average Depth to Water:

38 feet

Minimum Depth:

29 feet

Maximum Depth:

48 feet

Record Count: 9

**PLSS Search:** 

Section(s): 34

Township: 21S

Range: 37E



## New Mexico Office of the State Engineer Water Column/Average Depth to Water

(A CLW##### in the POD suffix indicates the POD has been replaced & no longer serves a water right file.)

(R=POD has been replaced, O=orphaned,

C=the file is closed)

(quarters are 1=NW 2=NE 3=SW 4=SE)

(quarters are smallest to largest) (NAD83 UTM in meters)

(In feet)

Transcription in the second se	olobea)	14000		-	- '			.a. goot)	(.47100)	o crist in thetera)		(III leet)
DOD N	POD Sub-			Q								Depth Water
POD Number	Code basin C								X	Y		Water Column
CP 00014		LE	1	3	2	23	21\$	37E	675492	3593749*	84	
CP 00017		LE	2	1	2	27	215	37E	674106	3592513* 🌑	101	
CP 00111		LE		2	3	36	218	37E	676864	3590052* 🌑	90	
CP 00133		LE	2	2	4	35	218	37E	676159	3590137*	80	
CP 00134		LE	1	1	1	24	21\$	37E	676289	3594166* 💨	85	
CP 00137		LE	2	2	1	13	215	37E	676862	3595783* 🌑	65	
CP 00138		LE	3	2	2	35	21\$	37E	675944	3590741*	70	
CP 00162		LE	1	4	2	09	21\$	37E	672621	3596915*	120	
CP 00163		LE	1	4	2	09	21\$	37E	672621	3596915*	120	
CP 00164		LĘ	2	1	1	21	21\$	37E	671665	3594080*	120	
CP 00197		LE	1	4	1	01	21\$	37E	676611	3598599*	85	
CP 00212		LE	2	2	1	14	218	37E	675254	3595753* 🌑	46	
CP 00214		LE	2	1 4	4	35	218	37E	675757	3590129*	80	
CP 00220		LE	1	1 ;	3	25	215	37E	676332	3591753*	75	
CP 00221		LE	2	1 :	3	35	21S	37E	674953	3590115* 🚳	290	
CP 00223		LE	3	2 4	4	35	21S	37E	675959	3589937* 🌑	110	
CP 00224	1	LE ·	4	3 :	3	23	215	37E	674902	3592730*	96	
CP 00225	1	LE .	2	2 4	4	35	215	37E	676159	3590137* 🌑	85	
CP 00226	1	LE	1 -	4 4	4	26	218	37E	675937	3591344* 💨	80	
CP 00227	I	LE :	2	3 4	4	26	215	37E	675735	3591336* 🌑	85	
CP 00228	ı	LE -	4 :	3 4	4	26	21\$	37E	675735	3591136* 🌑	90	
CP 00229	I	LE .	4 :	3 4	1	35	21S	37E	675764	3589527* 💨	85	
CP 00230	!	LE :	3 :	2 3	3	26	21S	37E	675126	3591531* 💨	85	
CP 00235	1	LE :	2 :	2 1	1	23	215	37E	675283	3594144* 🌑	81	
CP 00236	ı	LE :	3	1 2	2 :	23	21\$	37E	675485	3593952*	83	
CP 00238	ı	LE :	3 :	3 2	2 :	23	21S	37E	675492	3593549* 🐠	81	

(A CLW##### in the POD suffix indicates the POD has been replaced & no longer serves a water right file.)

(R=POD has been replaced, O=orphaned,

C=the file is closed)

(quarters are 1=NW 2=NE 3=SW 4=SE)

(quarters are smallest to largest) (NAD83 UTM in meters)

(In feet)

water right life.)	ciosea)	(qua	πe	5 8	are	sma	llest to	o largest	) (NAD8	3 U i M in meters)		(In feet	)
POD Number	POD Sub- Code basin (	Country			0 0		. Tour					Depth	
CP 00239	Code Dasiii (	LE						37E	675485	3594152* 🚳	Well 89	Water	Column
CP 00240		LE	4	2	1	23	218	37E	675283	3593944*	72		
CP 00241		LE	4	2	1	23	21\$	37E	675283	3593944*	76		
CP 00242		LE	3	4	2	28	218	37E	672708	3591889*	112		
CP 00249		LE	2	3	2	27	218	37E	674113	3592111*	102		
CP 00250		LE	2	3	2	27	215	37E	674113	3592111*	101		
CP 00251		LE	2	3	4	22	215	37E	674099	3592915* 🚳	103		
CP 00252		LE	4	2	4	22	215	37E	674493	3593125* 🚳	106		
CP 00253		LE	3	4	2	27	218	37E	674315	3591918* 🌑	101		
CP 00293		LE	2	4	1	27	215	37E	673711	3592104*	80		
CP 00322		LE			3	28	215	37E	671818	3591366* 🌑	138	73	65
CP 00346		LE	1	3	1	27	21\$	37E	673110	3592096* 🌑	90		
CP 00447		LE	2	4	4	18	21S	37E	669647	3594451*	95		
CP 00552		LE		2	4	04	215	37E	672700	3598022*	90	75	15
CP 00553		LE		2	4	04	218	37E	672700	3598022*	90	75	15
CP 00554		LE		2	2	16	218	37E	672744	3595610*	80	70	10
CP 00562		LE	1	2	2	23	21S	37E	675887	3594159* 🌑	136	65	71
CP 00676		LE		4	4	18	218	37E	669548	3594352* 🌑	140	106	34
CP 00700		LE			2	23	215	37E	675794	3593851*	75	65	10
CP 00711		LE	4	2	2	28	218	37E	672900	3592291* 🚳	100	65	35
CP 00726		LE		2	4	33	21S	37E	672844	3589980*	125	100	25
CP 00735		LE		2	4	28	215	37E	672816	3591588* 💨	105		
CP 00736		LE		3	1	27	21\$	37E	673211	3591997* 🚳	120	76	44
CP 00749		LE	2	4	3	28	21S	37E	672118	3591271*	123	75	48
CP 00835		LE			3	34	21S	37E	673454	3589786*	145		
CP 00877		LE				06	21S	37E	668920	3598153* 🌑	150	73	77
CP 00881		LE		4	4	22	218	37E	674402	3592824*	95	53	42
CP 00895		LE		1	1	20	21S	37E	669957	3593956* 🏐	163		
CP 00914 EXPL		LE	4	3	1	36	21S	37E	676554	3590346*	72		

(A CLW##### in the POD suffix indicates the POD has been replaced & no longer serves a water right file.)

(R=POD has been replaced, O=orphaned,

C=the file is

(quarters are 1=NW 2=NE 3=SW 4=SE)

(quarters are smallest to largest) (NAD83 UTM in meters) closed)

(In feet)

mater right meny	cioscaj	(quu	141	<b>.</b> .		SIIIG	iicat ic	, largest	/ (147000	O TWITT INCIGIS)		(111.1881	,
	POD Sub-		Q	Q	Q						Depth	Depth	Water
POD Number	Code basin								X	Υ	Well	The second second	Column
CP 00943 POD1		LE	1	3	1	34	218	37E	673166	3590405	142		
CP 00965 POD1	R	LE	1	3	4	28	215	37E	672333	3591346 🌑	123	60	63
CP 00965 POD2		LE	1	3	4	28	215	37E	672273	3591336 🌑	135		
CP 00966 POD1		LE	1	3	4	28	21S	37E	672306	3591367 🌑	154		
CP 00985 POD1		LE	4	4	2	19	215	37E	669595	3593453 🌑	160		
CP 00986 POD1		LE	4	3	4	06	215	37E	669110	3597437 🌑	154		
CP 01026 POD1		LE	1	1	3	17	218	37E	669809	3594958 🌑	167	95	72
CP 01077 POD1		LE	1	2	2	33	21S	37E	672710	3590940 🌑	80	45	35
CP 01141 POD2		LE	3	4	3	15	21S	37E	673541	3594250 🌑	40		
CP 01141 POD3		LE	3	4	3	15	21S	37E	673541	3594250 🌑	40		
CP 01141 POD4		LE	3	4	3	15	215	37E	673541	3594250 🌑	45		
CP 01145 POD1		LE	2	2	2	34	21\$	37E	674514	3590848 🌑	90		
CP 01185 POD1		LE		1	3	14	21S	37E	674598	3594689 🌑	70		
CP 01185 POD2		LE		1	3	14	215	37E	674623	3594674 🌑	70		
CP 01185 POD3		LE		1	3	14	215	37E	674592	3594620 🜑	70		
CP 01185 POD4		LE		1	3	14	218	37E	674633	3594610 🌑	70		
CP 01221 POD1		LE	4	4	4	11	21S	37E	676254	3588506 🌑	75	60	15
CP 01222 POD1		LE	2	2	2	35	215	37E	676079	3591029 🌑	58	48	10
CP 01222 POD2		LE	2	2	2	35	21\$	37E	676079	3591029 🌑	65	48	17
CP 01222 POD3		ŁE	2	2	2	35	21\$	37E	676052	3591029 🌑	60	48	12
CP 01222 POD4		LE	2	2	2	35	21\$	37E	676105	3590999 🌑	60	44	16
CP 01245 POD1		LE	1	4	3	18	21S	37E	668677	3594410 🔴	220		
CP 01274 POD1		LE	4	3	1	26	215	37E	674993	3591843 🌑	60		
CP 01274 POD2		LE	4	3	1	26	21S	37E	674993	3591843 🌑	60		
CP 01302 POD1		LE	3	3	3	28	21S	37E	671454	3591072 🌑	162	100	62
CP 01358 POD1		LE	2	1	4	34	21\$	37E	674134	3589539 🌑	65	48	17
CP 01358 POD2		LE	4	4	2	34	218	37E	674497	3589676 🌑	42	29	13
CP 01358 POD3		LE	4	4	1	34	215	37E	674434	3589782 🌑	45	32	13
CP 01358 POD4		LE	4	2	3	34	215	37E	674307	3589974	45	40	5

(A CLW##### in the POD suffix indicates the POD has been replaced & no longer serves a

water right file.)

(R=POD has been replaced, O=orphaned,

C=the file is

(quarters are 1=NW 2=NE 3=SW 4=SE)

closed) (quarters

(quarters are smallest to largest) (NAD83 UTM in meters)

(In feet)

POD Number	POD Sub- Code basin	County	Q 64	(Nadi	100	Sec 1	Tws	Rng	×	Y			Water Column
CP 01358 POD5		LE	4	2	1 3	34 2	215	37E	674306	3590035 🌑	58	41	17
CP 01358 POD6		LE	4	2	3 3	34 2	21\$	37E	674271	3589921 🌑	26		
CP 01540 POD1	CP	LE	1	1	1 3	35 2	21S	37E	674374	3590848 🌑	51	36	15
CP 01574 POD1	CP	LE	2 4	4	4 1	15 2	21S	37E	674563	3594599 🌑	68	57	11
CP 01574 POD2	СР	LE	1 :	3 :	3 1	14 2	218	37E	674654	3594594 🌑	68	57	11
CP 01575 POD1	CP	LE	1 :	2	1 2	22 2	21\$	37E	673543	3594200 🍩	40	35	5
CP 01575 POD2	CP	LE	2 :	2	1 2	22 2	21\$	37E	673610	3594192 🍩	35	35	0

Average Depth to Water:

60 feet

Minimum Depth:

29 feet

Maximum Depth:

106 feet

**Record Count: 91** 

PLSS Search:

Township: 21S

Range: 37E

## Appendix C

Client:	Globe Energy Services
Site Name	Eunice Yard
Boring/Well:	BH-1
GPS	32.43107, -103.14390
Project #:	212C-MD-00374
Total Depth	25'
Date Installed:	1/20/2016

DEPTH (Ft)	SAMPLE DESCRIPTION	NOTES	PID (ppm)	CONDUCTIVITY (ppm)	CHLORIDE KIT
0-1	Fine to mediums brown/red sand	No Stain or odor	-	123	-
2-3	Dense caliche	No Stain or odor	-	2,007	-
4-5	Dense caliche	No Stain or odor	-	3,550	-
6-7	Dense caliche	No Stain or odor	-	1,320	-
9-10	Dense caliche	No Stain or odor	-	346	-
14-15	Dense caliche	No Stain or odor	-	740	-
19-20	Friable caliche, limestone & chert	No Stain or odor	-	753	800
24-25	Red sandstone and chert	No Stain or odor	-	807	-

Client:	Globe Energy Services
Site Name	Eunice Yard
Boring/Well:	BH-2
GPS	32.43139, -103.4388
Project #:	212C-MD-00374
Total Depth	25'
Date Installed:	1/20/2016

		_			
DEPTH (Ft)	SAMPLE DESCRIPTION	NOTES	PID (ppm)	CONDUCTIVITY (ppm)	CHLORIDE KIT
0-1	Fine brown sand & calcareous fine tan sand	No Stain or odor	-	1,820	-
2-3	Dense caliche	No Stain or odor	-	4,420	-
4-5	Dense caliche	No Stain or odor	-	1,240	-
6-7	Dense caliche	No Stain or odor	-	487	-
9-10	Friable caliche	No Stain or odor	-	358	-
14-15	Friable caliche	No Stain or odor	-	512	375
19-20	Friable caliche	No Stain or odor	-	315	-
24-25	Red sandstone & chert	No Stain or odor	-	435	-

Client:	Globe Energy Services
Site Name	Eunice Yard
Boring/Well:	BH-3
GPS	32.43147, -103.14384
Project #:	212C-MD-00374
Total Depth	10'
Date Installed:	1/20/2016

DEPTH (Ft)	SAMPLE DESCRIPTION	NOTES	PID (ppm)	CONDUCTIVITY (ppm)	CHLORIDE KIT
0-1	Brown to red silty sand - damp	No Stain or odor	3.20	-	-
2-3	Dense caliche	No Stain or odor	38.4	-	-
4-5	Dense caliche	No Stain or odor	35.5	-	-
6-7	Dense caliche	No Stain or odor	42.3	-	-
9-10	Friable caliche	No Stain or odor	21.8	-	-

Client:	Globe Energy Services
Site Name	Eunice Yard
Boring/Well:	BH-4
GPS	32.43159, -103.14395
Project #:	212C-MD-00374
Total Depth	25'
Date Installed:	1/20/2016

DEPTH (Ft)	SAMPLE DESCRIPTION	NOTES	PID (ppm)	CONDUCTIVITY (ppm)	CHLORIDE KIT
0-1	Brown to red silty sand	No stain / faint odor	38.2	3,750	-
2-3	Dense caliche	No stain / faint odor	36.4	3,330	-
4-5	Dense caliche & fine red sand	No stain / faint odor	27.5	3,910	-
6-7	Dense calcieh	No Stain or odor	19.5	5,300	-
9-10	Friable caliche	No Stain or odor	23.2	5,500	-
14-15	Friable caliche	No Stain or odor	-	6,250	-
19-20	Friable caliche	No Stain or odor	-	3,100	-
24-25	Coarse red to brown sandstone	No Stain or odor	-	1,190	-

Client:	Globe Energy Services
Site Name	Eunice Yard
Boring/Well:	BH-5
GPS	32.43164, -103.14413
Project #:	212C-MD-00374
Total Depth	25'
Date Installed:	1/20/2016

DEPTH (Ft)	SAMPLE DESCRIPTION	NOTES	PID (ppm)	CONDUCTIVITY (ppm)	CHLORIDE KIT
0-1	Brown to red medium to fine sand	No stain / faint odor	0.9	5,370	-
2-3	Dence caliche	No Stain or odor	1.5	4,860	-
4-5	Dense caliche & fine red sand	No Stain or odor	23.0	2,630	-
6-7	Friable caliche & fine red sand	No Stain or odor	0.7	1,030	-
9-10	Friable caliche & fine red sand	No Stain or odor	0.0	587	•
14-15	Friable caliche & fine red sand	No Stain or odor	-	418	-
19-20	Red sandstone & friable caliche	No Stain or odor	-	374	-
24-25	Red sandstone & chert	No Stain or odor	-	497	500

Client:	Globe Energy Services
Site Name	Eunice Yard
Boring/Well:	BH-6
GPS	32.43153, -103.14435
Project #:	212C-MD-00374
Total Depth	25'
Date Installed:	1/21/2016

		•			
DEPTH (Ft)	SAMPLE DESCRIPTION	NOTES	PID (ppm)	CONDUCTIVITY (ppm)	CHLORIDE KIT
0-1	Brown to red medium to fine sand - damp	No Stain or odor	-	307	-
2-3	Dense caliche & fine red sand - dry	No Stain or odor	-	4,360	-
4-5	Dense caliche & fine red sand	No Stain or odor	-	4,620	-
6-7	Dense caliche & fine red sand	No Stain or odor	-	1,380	•
9-10	Dense caliche	No Stain or odor	-	1,670	•
14-15	Friable caliche	No Stain or odor	-	935	-
19-20	Friable caliche	No Stain or odor	-	570	-
24-25	Red sandstone & chert	No Stain or odor	-	717	-

Client:	Globe Energy Services
Site Name	Eunice Yard
Boring/Well:	BH-7
GPS	32.43149, -103.14503
Project #:	212C-MD-00374
Total Depth	5'
Date Installed:	1/21/2016

DEPTH (Ft)	SAMPLE DESCRIPTION	NOTES	PID (ppm)	CONDUCTIVITY (ppm)	CHLORIDE KIT
0-1	Brown to red medium to fine sand - damp	No Stain or odor	-	145	-
2-3	Dense caliche	No Stain or odor	-	280	180
4-5	Dense caliche	No Stain or odor	-	196	100

Client:	Globe Energy Services
Site Name	Eunice Yard
Boring/Well:	BH-8
GPS	32.43191, -103.14549
Project #:	212C-MD-00374
Total Depth	10'
Date Installed:	1/21/2016

DEPTH (Ft)	SAMPLE DESCRIPTION	NOTES	PID (ppm)	CONDUCTIVITY (ppm)	CHLORIDE KIT
0-1	Dense caliche & fine brown sand	Faint stain/no odor	0.3	-	-
2-3	Dense caliche	No stain / faint odor	1.1	-	-
4-5	Dense caliche	No Stain or odor	4.8	•	-
6-7	Dense caliche	No Stain or odor	1.3	•	-
9-10	Friable caliche	No Stain or odor	0.4	-	-

Client:	Globe Energy Services
Site Name	Eunice Yard
Boring/Well:	BH-9
GPS	32.43212, -103.14559
Project #:	212C-MD-00374
Total Depth	10'
Date Installed:	1/21/2016

DEPTH (Ft)	SAMPLE DESCRIPTION	NOTES	PID (ppm)	CONDUCTIVITY (ppm)	CHLORIDE KIT
				(ррііі)	
0-1	Medium to fine brown sand	No stain / faint odor	3.7	-	-
2-3	Dense caliche	No stain / faint odor	8.1	-	-
4-5	Dense caliche & fine brown sand	No stain / faint odor	0.6	-	-
6-7	Friable caliche & fine brown sand	No Stain or odor	3.1	-	-
9-10	Friable caliche & fine brown sand	No Stain or odor	0.1	-	-

Client:	Globe Energy Services
Site Name	Eunice Yard
Boring/Well:	BH-10
GPS	32.43207, -103.14552
Project #:	212C-MD-00374
Total Depth	25'
Date Installed:	1/21/2016

DEPTH (Ft)	SAMPLE DESCRIPTION	NOTES	PID (ppm)	CONDUCTIVITY (ppm)	CHLORIDE KIT
0-1	Brown to red medium to fine sand - damp	No stain / faint odor	1.0	295	-
2-3	Dense caliche	No stain / faint odor	3.5	3,010	-
4-5	Dense caliche	No Stain or odor	5.5	610	-
6-7	Dense caliche	No Stain or odor	1.2	285	-
9-10	Friable caliche	No Stain or odor	1.2	500	•
14-15	Friable caliche	No Stain or odor	-	365	-
19-20	Medium red to brown sand	No Stain or odor	-	195	180
24-25	Medium red to brown sand	No Stain or odor	-	225	200

Client:	Globe Energy Services
Site Name	Eunice Yard
Boring/Well:	BH-11
GPS	32.43199, -103.14542
Project #:	212C-MD-00374
Total Depth	20'
Date Installed:	1/21/2016


DEPTH (Ft)	SAMPLE DESCRIPTION	NOTES	PID (ppm)	CONDUCTIVITY (ppm)	CHLORIDE KIT
0-1	Medium brown sand	No Stain or odor	-	138	-
2-3	Dense caliche	No Stain or odor	-	3,260	-
4-5	Dense caliche & medium brown sand	No Stain or odor	-	398	-
6-7	Friable caliche	No Stain or odor	-	204	-
9-10	Friable caliche	No Stain or odor	-	380	400
14-15	Friable caliche	No Stain or odor	-	165	160
19-20	Medium red to brown sand	No Stain or odor	-	180	-

Client:	Globe Energy Services
Site Name	Eunice Yard
Boring/Well:	BH-12
GPS	32.43224, -103.14540
Project #:	212C-MD-00374
Total Depth	10'
Date Installed:	1/21/2016

DEPTH (Ft)	SAMPLE DESCRIPTION	NOTES	PID (ppm)	CONDUCTIVITY (ppm)	CHLORIDE KIT
0-1	Medium brown sand	Mod. Stain/faint odor	3.7	-	-
2-3	Dense caliche	No stain / faint odor	0.3	-	-
4-5	Dense caliche	No Stain or odor	3.0	-	-
6-7	Friable caliche	No Stain or odor	4.1	-	-
9-10	Friable caliche	No Stain or odor	2.1	-	-

	SAMPL	E LOG		
Client:	Globe Energy Services	TD:	50'	
Site Name	Eunice Yard	Screen Depth:	20-50'	
Boring/Well:	MW-1	DTW:		
GPS	32.43156, -103.14407			
Project #:	212C-MD-00374			
Total Depth	50'			
Date Installed:	9/20/2016			
			1 , . 1	
DEPTH (Ft)	SAMPLE DESCRIPTION	NOTES	PID (ppm)	CONDUCTIVITY (ppm)
0-1'	Fine red to brown sand	No stain or odor	-	-
1-2'	Fine red to brown sand & dense caliche	No stain or odor	-	-
2-5'	Dense & friable caliche	No stain or odor	-	-
5'	Dense & friable caliche with fine red to brown sand	No stain or odor	-	795
5-9'	Dense & friable caliche with fine red to brown sand	No stain or odor		-
10'	Limestone & fine brown sand	No stain or odor	-	989
10-11'	Limestone & fine brown sand	No stain or odor	-	-
11-15'	Sandy friable caliche	No stain or odor	-	-
15'	Limestone & chert	No stain or odor	-	815
15-20	Limestone & chert	No stain or odor	-	-
20'	Limestone, chert & fine tan sand	No stain or odor	-	715
20-27'	Limestone	No stain or odor	-	-
27-38'	Very dense limestone	No stain or odor	-	-
38-47	Alluvium & red clay	No stain or odor	-	-
47-50'	Red Clay	No stain or odor	-	-

## Appendix D

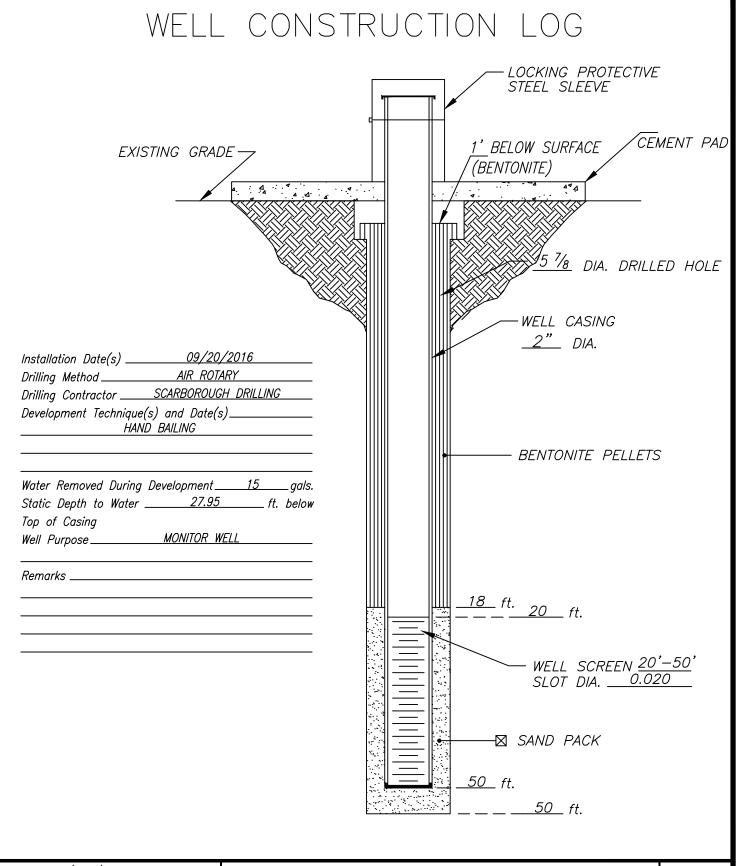

DATE: 09/20/2016

TETRA TECH, INC. MIDLAND, TEXAS CLIENT: GLOBE ENERGY SERVICES

PROJECT: GLOBE EUNICE YARD

LOCATION: LEA COUNTY, NEW MEXICO

WELL NO.

MW-1

212C-MD-00347