

1R - 428-2

REPORTS

DATE:

DEC 30, 2002

IR-428-2

FINAL REPORT

**RICE OPERATING COMPANY
JUNCTION BOX FINAL REPORT**

BOX LOCATION

SWD SYSTEM	JUNCTION	UNIT	SECTION	TOWNSHIP	RANGE	COUNTY	BOX DIMENSIONS - FEET		
Hobbs	Hardin "B" EOL	E	18	18 S	38 E	Lea	Length no box	Width XXX	Depth XXX

LAND TYPE: BLM _____ STATE _____ FEE LANDOWNER Harry G. Huston OTHER _____

Depth to Groundwater <28 feet NMOCD SITE ASSESSMENT RANKING SCORE: 10

Date Started 8/26/2002 Date Completed 12/30/2002 OCD Witness No

Soil Excavated 0 cubic yards Excavation Length n/a Width n/a Depth n/a feet

Soil Disposed 0 cubic yards Offsite Facility n/a Location n/a

FINAL ANALYTICAL RESULTS: Sample Date 8/26/2002 Sample Depth 3'

Procure 5-point composite sample of bottom and 4-point composite sample of sidewalls. TPH,
BTEX and Chloride laboratory test results completed by using an approved lab and testing
procedures pursuant to NMOCD guidelines.

Sample Location	Benzene mg/kg	Toluene mg/kg	Ethyl Benzene mg/kg	Total Xylenes mg/kg	GRO mg/kg	DRO mg/kg	Chlorides mg/kg
SIDEWALLS	<0.005	<0.005	<0.005	<0.015	<10.0	27.2	64
BOTTOM	<0.005	<0.005	<0.005	<0.015	<10.0	20.6	80
REMEDIATED	n/a	n/a	n/a	n/a	n/a	n/a	n/a

General Description of Remedial Action: This junction box is part of
the Hobbs system abandonment, therefore a new box is not required. The box did not
exhibit any visible signs of impact. Field tests of bottom and wall composite samples found
minimal impact below NMOCD guidelines. The box lumber was removed and the hole
was backfilled with clean soil and contoured to the surrounding landscape.

CHLORIDE FIELD TESTS

LOCATION	DEPTH	ppm
Bottom Comp.	3'	53
Wall Comp.	2'	65

**I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST OF MY
KNOWLEDGE AND BELIEF.**

DATE December 30, 2002 PRINTED NAME D. E. Anderson

SIGNATURE  TITLE Projects Leader-Environmental



PHONE (915) 673-7001 • 2111 BEECHWOOD • ABILENE, TX 79603

PHONE (505) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240

ANALYTICAL RESULTS FOR
RICE OPERATING CO.
ATTN: CHRIS RODRIGUEZ
122 W. TAYLOR
HOBBS, NM 88240
FAX TO: (505) 397-1471

Receiving Date: 09/09/02
Reporting Date: 09/11/02
Project Owner: RICE
Project Name: HARDIN "B" EOL JCT. BOX
Project Location: HOBBS SWD SYSTEM

Sampling Date: 08/26/02
Sample Type: SOIL
Sample Condition: COOL & INTACT
Sample Received By: AH
Analyzed By: BC/AH


LAB NO.	SAMPLE ID	GRO	DRO	Cl*
		(C ₆ -C ₁₀) (mg/Kg)	(>C ₁₀ -C ₂₈) (mg/Kg)	(mg/Kg)
ANALYSIS DATE		09/10/02	09/10/02	09/10/02
H7013-1	WALL COMPOSITE	<10.0	27.2	64
H7013-2	BOTTOM COMPOSITE	<10.0	20.6	80
Quality Control		779	836	970
True Value QC		800	800	1000
% Recovery		97.4	104	97.0
Relative Percent Difference		2.4	4.8	1.0

METHODS: TPH GRO & DRO: EPA SW-846 8015 M; Cl: Std. Methods 4500-ClB

*Analyses performed on 1:4 w:v aqueous extracts.

Chemist

Date

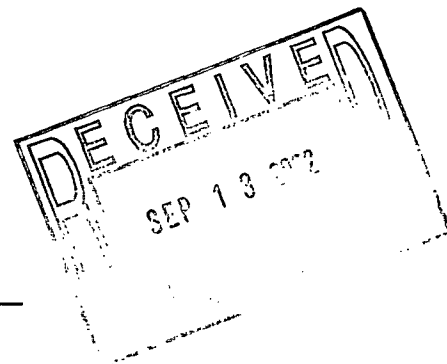

H7013A.XLS

PLEASE NOTE: **Liability and Damages.** Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above-stated reasons or otherwise.



PHONE (915) 673-7001 • 2111 BEECHWOOD • ABILENE, TX 79603

PHONE (505) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240


ANALYTICAL RESULTS FOR
RICE OPERATING CO.
ATTN: CHRIS RODRIGUEZ
122 W. TAYLOR
HOBBS, NM 88240
FAX TO: (505) 397-1471


Receiving Date: 09/09/02
Reporting Date: 09/11/02
Project Owner: RICE
Project Name: HARDIN "B" EOL JCT. BOX
Project Location: HOBBS SWD SYSTEM


Sampling Date: 08/26/02
Sample Type: SOIL
Sample Condition: COOL & INTACT
Sample Received By: AH
Analyzed By: BC

LAB NUMBER	SAMPLE ID	BENZENE (mg/Kg)	TOLUENE (mg/Kg)	ETHYL BENZENE (mg/Kg)	TOTAL XYLENES (mg/Kg)
ANALYSIS DATE		09/10/02	09/10/02	09/10/02	09/10/02
H7013-1	WALL COMPOSITE	<0.005	<0.005	<0.005	<0.015
H7013-2	BOTTOM COMPOSITE	<0.005	<0.005	<0.005	<0.015
Quality Control		0.105	0.110	0.107	0.306
True Value QC		0.100	0.100	0.100	0.300
% Recovery		105	110	107	102.0
Relative Percent Difference		5.6	10.5	4.7	3.9

METHOD: EPA SW-846 8260

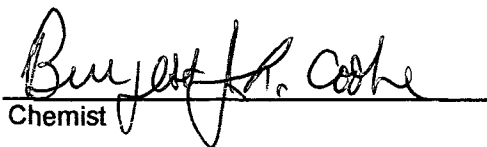
Chemist


Date

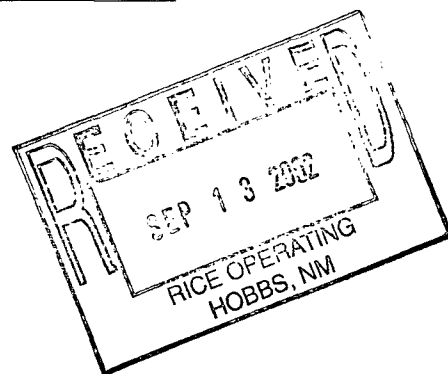

PLEASE NOTE: **Liability and Damages.** Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. **H7013B XLS** Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above-stated reasons or otherwise.

2111 Beechwood, Abilene, TX 79603 101 East Marland, Hobbs, NM 88240
(915) 673-7001 Fax (915) 673-7020 (505) 393-2326 Fax (505) 393-2476

Page of [illegible]

† Cardinal cannot accept verbal changes. Please fax written changes to 505-393-2476.