

HOBBS OCD

SEP 23 2013

RECEIVED

EG 9-26-2013

Devon Energy Corporation
333 West Sheridan
Oklahoma City, Oklahoma 73102-5010

30-025-41434

Hydrogen Sulfide (H₂S) Contingency Plam

For


Mean Green 22 FED 1H


Sec-22, T-26S R-34E 150' FSL & 480' FEL, LAT. = 32.011948'N (NAD83) LONG = 103.270287'W

Lea County NM

Mean Green 22 Fed 1H

This is an open drilling site. H₂S monitoring equipment and emergency response equipment will be used within 500° of zones known to contain H₂S, including warning signs, wind indicators and H₂S monitor.

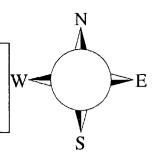

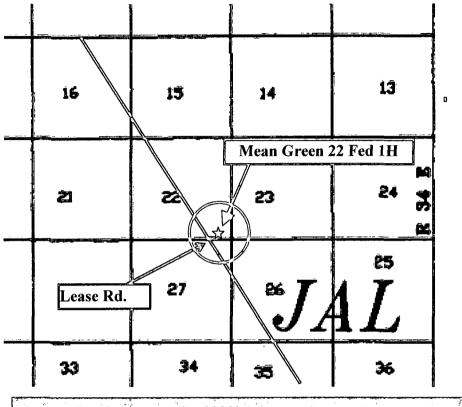

Assumed 100 ppm 3000' () 100 ppm H₂S concentration shall trigger activation of this plan.

Escape

Crews shall escape upwind of escaping gas in the event of an emergency release of gas. Escape can be facilitated from the location entrance West then Northwest on lease road. Crews should then block the road so as not to allow anyone traversing into a hazardous area. The blockade should be at a safe distance outside of the ROE. There are no homes or buildings in or near the ROE.

Assumed 100 ppm ROE = 3000'
100 ppm H₂S concentration shall trigger activation of this plan.

Emergency Procedures

In the event of a release of gas containing H₂S, the first responder(s) must

- Isolate the area and prevent entry by other persons into the 100 ppm ROE.
- Evacuate any public places encompassed by the 100 ppm ROE.
- Be equipped with H₂S monitors and air packs in order to control the release.
- Use the "buddy system" to ensure no injuries occur during the response
- Take precautions to avoid personal injury during this operation.
- Contact operator and/or local officials to aid in operation. See list of phone numbers attached.
- Have received training in the
 - Detection of H₂S, and
 - Measures for protection against the gas,
 - o Equipment used for protection and emergency response.

Ignition of Gas Source

Should control of the well be considered lost and ignition considered, take care to protect against exposure to Sulfur Dioxide (SO₂). Intentional ignition must be coordinated with the NMOCD and local officials. Additionally the NM State Police may become involved. NM State Police shall be the Incident Command on scene of any major release. Take care to protect downwind whenever there is an ignition of the gas

Characteristics of H₂S and SO₂

Common Name	Chemical Formula	Specific Gravity	Threshold Limit	Hazardous Limit	Lethal Concentration
Hydrogen Sulfide	H ₂ S	1.189 Air = 1	10 ppm	100 ppm/hr	600 ppm
Sulfur Dioxide	SO ₂	2.21 Air = 1	2 ppm	N/A	1000 ppm

Contacting Authorities

Devon Energy Corp. personnel must liaison with local and state agencies to ensure a proper response to a major release. Additionally, the OCD must be notified of the release as soon as possible but no later than 4 hours. Agencies will ask for information such as type and volume of release, wind direction, location of release, etc. Be prepared with all information available. The following call list of essential and potential responders has been prepared for use during a release. Devon Energy Corp. Company response must be in coordination with the State of New Mexico's 'Hazardous Materials Emergency Response Plan' (HMER)

Hydrogen Sulfide Drilling Operation Plan

I. HYDROGEN SULFIDE (H₂S) TRAINING

All personnel, whether regularly assigned, contracted, or employed on an unscheduled basis, will receive training from a qualified instructor in the following areas prior to commencing drilling operations on this well:

- 1. The hazards and characteristics of hydrogen sulfide (H₂S)
- 2. The proper use and maintenance of personal protective equipment and life support systems.
- 3. The proper use of H_2S detectors, alarms, warning systems, briefing areas, evacuation procedures, and prevailing winds.
- 4. The proper techniques for first aid and rescue procedures.

In addition, supervisory personnel will be trained in the following areas:

- 1. The effects of H₂S metal components. If high tensile tubular are to be used, personnel will be trained in their special maintenance requirements.
- 2. Corrective action and shut-in procedures when drilling or reworking a well and blowout prevention and well control procedures.
- 3. The contents and requirements of the H₂S Drilling Operations Plan and Public Protection Plan.

There will be an initial training session just prior to encountering a known or probable H₂S zone (within 3 days or 500 feet) and weekly H₂S and well control drills for all personnel in each crew. The initial training session shall include a review of the site specific H₂S Drilling Operations Plan and the Public Protection Plan.

II. HYDROGEN SULFIDE TRAINING

Note: All H_2S safety equipment and systems will be installed, tested, and operational when drilling reaches a depth of 500 feet above, or three days prior to penetrating the first zone containing or reasonable expected to contain H_2S .

1. Well Control Equipment

- A. Flare line
- B. Choke manifold with remotely operated choke
- C. Blind rams and pipe rams to accommodate all pipe sizes with properly sized closing unit
- D. Auxiliary equipment may include if applicable: annular preventer and rotating head.

2. Protective equipment for essential personnel:

A. 30-minute SCBA units located in the doghouse and at briefing areas, as indicated on well site diagram. As it may be difficult to communicate audibly while wearing these units, hand signals shall be utilized.

3. H₂S detection and monitoring equipment:

A. Portable H₂S monitors positioned on location for best coverage and response. These unites have warning lights and audible sirens when H₂S levels of 20 PPM are reached. These units are usually capable of detecting SO₂, which is a byproduct of burning H₂S.

4. Visual warning systems:

- A. Wind direction indicators as shown on well site diagram
- B. Caution/ Danger signs shall be posted on roads providing direct access to locations. Signs will be painted a high visibility yellow with black lettering of sufficient size to be reasonable distance from the immediate location. Bilingual signs will be used when appropriate..

5. Mud program:

A. The mud program has been designed to minimize the volume of H₂S circulated to surface. Proper mud weight, safe drilling practices and the use of H₂S scavengers will minimize hazards when penetrating H₂S bearing zones.

6. Metallurgy:

- A. All drill strings, casings, tubing, wellhead, blowout preventer, drilling spool, kill lines, choke manifold lines, and valves shall be H₂S trim.
- B. All elastomers used for packing and seals shall be H₂S trim.

7. Communication:

- A. Radio communications in company vehicles including cellular telephones and 2-way radio
- B. Land line (telephone) communications at Office

8. Well testing:

- A. Drill stem testing will be performed with a minimum number of personnel in the immediate vicinity, which are necessary to safety and adequately conduct the test. The drill stem testing will be conducted during daylight hours and formation fluids will not be flowed to the surface. All drill-stem-testing operations conducted in an H₂S environment will use the closed chamber method of testing.
- B. There will be no drill stem testing.

Devon Energy Corp. Company Call List

Artesia (575)	Cellular	Office	Home
Foreman – Robert Bell	748_7448	748-0178	746-2991
Asst. Foreman –Tommy Po			
Don Mayberry	•		
Montral Walker	390-5182	748-0193	936-414-6246
Engineer – Marcos Ortiz	.(405) 317-0666	(405) 552-8152	(405) 381-4350

Agency Call List

		•				
<u>Lea</u>	Hobbs					
County	State Police	392-5588				
<u>(575)</u>	City Police	397-9265				
	Sheriff's Office	393-2515				
	Ambulance	911				
	Fire Department	397-9308				
	LEPC (Local Emergency Planning Committee)	393-2870				
	NMOCD					
	US Bureau of Land Management	393-3612				
Eddy	Carlsbad					
County	State Police	885-3137				
(575)	City Police	885-2111				
	Sheriff's Office	887-7551				
	Ambulance	911				
	Fire Department	885-2111				
	LEPC (Local Emergency Planning Committee) 887-3798					
	US Bureau of Land Management					
	New Mexico Emergency Response Commission (Santa Fe) (505)476-9600					
	24 HR					
	National Emergency Response Center (Washington, DC)	, ,				
	Emergency Services					
	Boots & Coots IWC1-800-256-96					
	Cudd Pressure Control(915) 699-01	139 or (915) 563-3356				
	Halliburton(575) 746-2757					
	B. J. Services(575) 746-35	69				
Give	Flight For Life - Lubbock, TX	(806) 743-9911				
GPS	Aerocare - Lubbock, TX	(806) 747-8923				
position:	Med Flight Air Amb - Albuquerque, NM					
-	Lifeguard Air Med Svc. Albuquerque, NM					

Prepared in conjunction with Wade Rohloff

Graphic Safety LLC

Schots A Graphicial cycom

On Box 2734 • Hobbs NM 88240

Strain Crophic Company Co

EXHIBIT C Interim Reclamation & Production Facilities MEAN GREEN 22 FED #1H & 27 FED #1H V-DOOR EAST Î 25' 150' 22 #1H 50' 210' 70' 27 #1H 140' 175' 14' **LEGEND** Well Bore **Topsoil Production Facilities** Interim Reclamation **NORTH**