District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II

811 S. First St., Artesia, NM 88210 Phone: (575) 748-1283 Fax: (575) 748-9720 District III

1000 Rio Brazos Road, Aztec, NM 87410 Phone: (505) 334-6178 Fax: (505) 334-6170 <u>District IV</u>

State of New Mexico

Form C-101 Revised July 18, 2013

Energy Minerals and Natural Resources HOBBS OCD

Oil Conservation Division

☐AMENDED REPORT

1220 South St. Francis Dr.

AUG 0 3 2015

APPLIC	AHC	ハマ ドモント	די ידידוא א כניבורו	O DE	STT T	DE EN	TED N	o io in io a i	REC	Z OD AD	D A ZONE
			* Operator Name	and Add	ress	RE-EN	TER, D	EEPEN	, PLUGBAC	2 OGRID Nun	
ConocoPhill	lips Com	npany rd Rd								217817	
600 N. Dair Houston, Te		79							30-025-4		
4. Proper 311	ty Code 172		Ea	st Vacu	um Gr	Property Na ayburg San	ame n Andres U	nit 3 32 8		6.1	Vell No. 520W
					•	urface Loc					
UL - Lot	Section	Township	Range	Lot	Idn	Feet from		I/S Line	Feet From	E/W Line	County
N	33	178	35E	8. ID	Proposi	ed Bottom		South	1759	West	Lea
UL - Lot	Section	Township	Range	T	Idn	Feet from		/S Line	Feet From	E/W Line	County
N	33	17S	35E			471		South	1759	West	Lea
I		I	_L		9. Pc	ool Inform	ation		L	·.·-	
		,	/acuum; Grayb	ura San		Name					Pool Code 62180
		<u> </u>	acuum, Grayo							-	02180
11. Work	Туре		12. Well Type	AC	laition	al Well In 13. Cable/Rot			^{14.} Lease Type	15. Gr	ound Level Elevation
New \			I Proposed Depth			Rotary 18. Formation			State 19. Contractor		3947' GL 20. Spud Date
N	•	51		MD/5190' TVD Grayburg/San					12/01/2015		
Depth to Groun	d water	•	Dista	nce from	nearest	fresh water we	ell		Distance t	nearest surfac	e water
Туре	<u> </u>	e Size	o system in lieu o 21. Casing Size	Propos		sing and C		ogram g Depth	Sacks of C	ement	Estimated TOC
Surface	12.	.25"	8.625"		24		15	551'	875		0'
Production	7.8	375"	5.50"		15.5	5	51	180' 735			0'
			Casin		4 D.		dditional 1	~	-		
				ased on	hole co		ternal packe		** ** ** * * * * * * * * * * * * * * * *	en surf and pro	oduction casing, set a
			. 22.	Propos	sed Blo	owout Prev	vention Pi	ogram			
	Туре		Working Pressure			,	Test Pressure		Manufacturer		
Annular/Double Ram 3000/3000				Annular 70% or 2100 /3000 Dbl Ram Shaffer/Shaffer				affer/Shaffer			
23. I hereby cert	tify that th	e informati	on given above is t	rue and c	omplete	to the	<u> </u>				
est of my kno	wledge an	d belief. have compl	ied with 19.15.14.5			and/or	Approved B		CONSERVAT	ION DIVIS	SION
Printed name: S	Sucan B. A	Maunder	Maunde	V			Title: Petr	oleum F	Engines T		·
Title: Sr. Regul				·			Approved D	roleum-	Engineer	piration Date:	08/02/17
	·		conocophillips.co	m					7117	ttache	-
Date: 7/27	115		Phone: 281-20				Conditions of	of Approval.	Attached ition:		.0~
			<u> </u>			AUĞ	0 4 2	015	, onaition	or Ap	oroval 🔨

TDAP

(Thermally Deformable Annulus Packer)

The TDAP is a tool developed by BiSN Oil Tools which serves the same function as a traditional inflatable annulus casing packer. The tool has been developed to specifically target wells prone to annulus gas migration.

Composition:

- Tool is made of a bismuth, tin, and lead alloy
- Has a low melting temperature of ~190°F
- Unaffected by H₂S, CO₂, HCl
- Expands during solidification, ensuring a tight metal-to-metal seal
- Has cement ports to allow cement to be pumped through the tool
- Springs contained on the inside and outside of tool, which when the tool is melted, break the channels of cement through the tool

Seals:

- Rubber seals on the inside create positive seal on production casing
- Rubber seals on the outside create positive seal against inside of surface casing
- Seals have been tested for effectiveness on straight pipe with no joints, as well as over the gap
 in pipe with a joint (representing a connection in the surface casing)
- Outside seals still create a vacuum after being run through the equivalent of 7,200'+ of smooth casing and 1560+ connection gaps (representing the number of connections in 60,000' of casing)


Heater:

- Wireline conveyed
- Composed of a thermite mixture with a 10-30 minute heating time
- Initiated by a voltage applied to a nickel resistor igniter

Running Procedure:

- Joint containing the tool is made up to the casing string and run downhole with centralizers immediately above and below the tool
- Tool is positioned in the surface casing by production casing annulus
- Cement job is performed and cement flows through the tool during displacement
- After the well is completed, the drilling rig moves off location
- After the cement is set and prior to completions activity (days after rig release), the heater is lowered on wireline to the position of the tool
- The heater is ignited, melting the tool
- The springs contained in the tool are released, breaking the cement channels

- The heater expends all it's fuel and cools
- The heater is brought back to surface and the melted tool cools, forming a true metal-to-metal, gas-tight seal in the casing by casing annulus

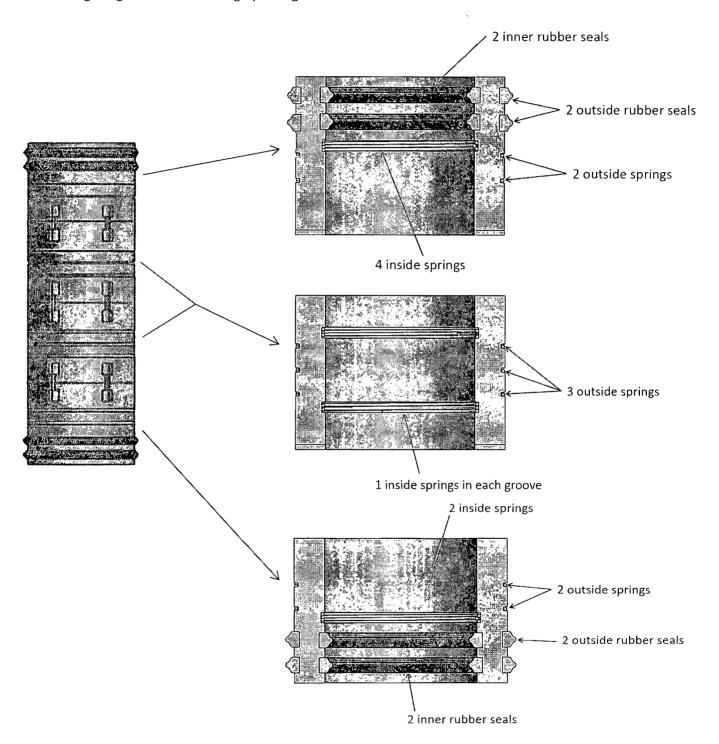

Closed Loop System Design, Operating and Maintenance, and Closure Plan

ConocoPhillips Company Well: EVGBSAU #520W

Location: Section 33, T17S, R35E

Date: 7/24/2015

ConocoPhillips proposes the following plan for design, operating and maintenance, and closure of our proposed closed loop system for the above named well:

1. We propose to use a closed loop system with steel pits, haul-off bins, and frac tanks for containing all cuttings, solids, mud, water, brine, and liquids. We will not dig a pit, use a drying pad, build an earthen pit above ground level, nor dispose of or bury any waste on location.

All drilling waste and all drilling fluids (fresh water, brine, mud, cuttings, drill solids, cement returns, and any other liquid or solid that may be involved) will be contained on location in the rig's steel pits or in haul-off bins or frac tanks as needed. The intent is as follows:

- We propose to use the rig's steel pits for containing and maintaining the drilling fluids.
- We propose to remove cuttings and drilled solids from the mud by using solids control equipment and to contain such cuttings and drilled solids on location in haul-off bins.
- We propose that any excess water that may need to be stored on location will be stored in tanks.

The closed loop system components will be inspected daily during each tour and any necessary repairs will be made immediately. Any leak in the system will be repaired immediately, any spilled liquids and/or solids will be cleaned immediately, and the area where any such spill occurred will be remediated immediately.

2. Cuttings and solids will be removed from the location in haul-off bins by an authorized contractor and disposed of at an authorized facility. For this well, we propose the following disposal facility:

R-360 Inc.

4507 West Carlsbad Hwy, Hobbs, NM 88240, P.O. Box 388; Hobbs, New Mexico 88241

Phone Number: 575.393.1079

The physical address for the plant where the disposal facility is located is Highway 62/180 at mile marker 66 (33 miles East of Hobbs, NM and 32 miles West of Carlsbad, NM).

The Permit Number for R-360 is NM1-006.

A photograph showing the type of haul-off bins that will be used is attached.

- 3. Mud will be transported by vacuum truck and disposed of at R-360 Inc. at the facility described above.
- 4. Fresh Water and Brine will be hauled off by vacuum truck and disposed of at an authorized salt water disposal well. We propose the following for disposal of fresh water and brine as needed:
 - Nabors Well Services Company, 3221 NW County Rd, Hobbs, NM 88240; P.O. Box 5208 Hobbs, NM, 88241, Phone Number: 575.392.2577; Permit SWD 092.
 - Basic Energy Services, 2404 W Texas Ave, Eunice, NM 88231; P.O. Box 1869, Eunice, NM 88231
 Phone Number: 575.394.2545, Facility located at Hwy 18, Mile Marker 19; Eunice, NM.
 - C & C Transport, LLC, P.O. Box 1352, Hobbs, NM 88241 Phone Number: 575.393.0422
 - Sundance Services, Inc., P.O. Box 1737 Eunice, NM 88231 Phone Number: 575.394.2511

Cord Denton
Drilling Engineer, ConocoPhillips Company
Phone: (281) 206-5406

Cell: (832) 754-7363

SPECIFICATIONS

FLOOR 3/16 PL one piece. CROSS MEMBER: 3 x 4.1 channel 16" on


WALLS 3/16" REsolid welded with tubing

center
WALES: 3/16" PL solid welded with tubing top: inside line; hooks.


DOOR: 3/16" PL with tubing frame!
FRONT: 3/16" PL siant formed
PICK U.P. Standard cable with: 2" x 6" x 1/4" rails; guisset at each crossmember.
WHEELS: 10.DIA x 9 long with rease fittings
DOOR: LATCH: 3 lindependent ratchet binders with chains vertical second latch GASKE TS: Extruded rubber seal with metal retainers?
WELDS: All welds continuous except substructure crossmembers.
FINISH: Coated inside and out with direct to metal, rust inhibiting acrylic enamel color coat HYDROTESTING: Full capacity static test DIMEN SIONS: 22=11 long (21'-8" inside), 99" wide (88" inside), see drawing for height OPTIONS: Steel grit blast and special paint; Ampliroll. Heil and Dino pickup.
ROOF: 3/16" PL roof panels with tubing and channel support frame.
LIDS: (2) 68" x 90" metal rolling lids spring loaded: self-raising.
ROLLERS: 4"V-groove rollers with delrin bearings and grease filtings.
OPENING. (2) 60" x 82" openings with 8" divider centered on container.
LATCH: (2) independent ratchet, binders with chains per lid.

ratchet binders with chains per lid GASKETS: Extruded rubber seal with metal retainers

Heavy Duty Split Metal Rolling Lid

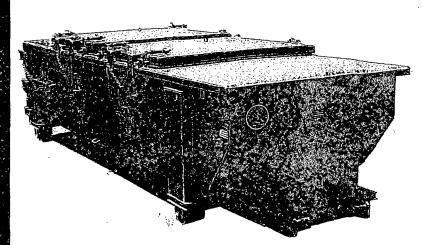

CONT.	Α	В
20 YD	41	53
25 YD	53	65
30 YD	65	77

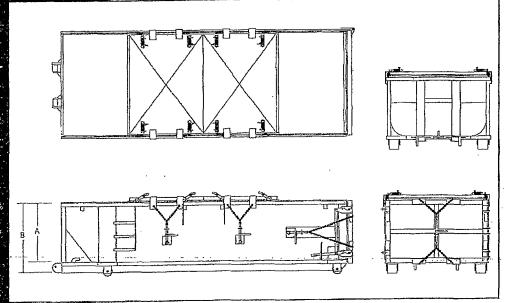



H₂S Contingency Plan

H₂S Contingency Plan Holders:

Attached is an H₂S Contingency Plan for COPC Permian Drilling working in the West Texas and Southeastern New Mexico areas operated by ConocoPhillips Company.

If you have any questions regarding this plan, please call Jet Brown at ConocoPhillips Company, 432.688.6849.

Table of Contents

Section

- I. Purpose
- II. Scope
- III. Procedures
- IV. Emergency Equipment and Maintenance

Emergency Equipment Suppliers General Information H2S Safety Equipment and Monitoring Systems

- V. Emergency Call List
- VI. Public/Media Relations
- VII. Public Notification/Evacuation
- VIII. Forms/Reports



HYDROGEN SULFIDE (H₂S) OPERATIONS

Contingency Plan
For
Permian Drilling Operations

ConocoPhillips Company Mid-Continent Business Unit Permian Asset Area

I. PURPOSE

The purpose of this Contingency Plan is to provide an organized plan of action for alerting and protecting the public following the release of a potentially hazardous volume of hydrogen sulfide. This plan prescribes mandatory safety procedures to be followed in the event of a release of H_2S into the atmosphere from exploration and production operations included in the scope of this plan. The extent of action taken will be determined by the supervisor and will depend on the severity and extent of the H_2S release. Release of H_2S must be reported to the Drilling Superintendent and documented on the IADC report and in Wellview.

Page 4 of 18

III. PROCEDURES

First Employee on Scene — Assess the incident and ensure your own safety. Note the following: Location of the incident. Nature of the incident. — Wind direction and weather conditions. ____ Other assistance that may be needed. Call local supervisory personnel (refer to Section V: Emergency Call List) until personal contact is made with a person on the list. Perform emergency assessment and response as needed. The response may include rescue and/or evacuation of personnel, shutting in a system and/or notification of nearby residents/public (refer to Section VII: Public Notification/Evacuation). Secure the site. Follow the direction of the On-scene Incident Commander (first ConocoPhillips supervisor arriving on-scene). First Supervisor on Scene (ConocoPhillips On-scene Incident Commander) — Becomes ConocoPhillips' On-scene Incident Commander upon arrival to location. - Follow the principles of the **D.E.C.I.D.E.** process below to assess the incident. (Note wind direction and weather conditions and ensure everyone's safety). **D**ETECT the problem ESTIMATE likely harm without intervention CHOOSE response objectives **IDENTIFY** action options **D**O the best option **E**VALUATE the progress Complete the Preliminary Emergency Information Sheet (refer to Section VIII:

_____ Call your supervisor (refer to Section V: Emergency Call List).

Forms/Reports).

H2S Contingency Plan

evacuation of Public Notific personnel or obtaining any	rgency response as necessary. (This may include notification & f all personnel and/or nearby residents/public (refer to Section VII: cation/Evacuation), requesting assistance from ConocoPhillips outside agencies (refer to Section V: Emergency Call List) and v safety equipment that may be required (refer to Section IV: Equipment and Maintenance).
	priate local emergency response agencies of the incident as needed. he appropriate regulatory agencies. (refer to Section V: Emergency
—— Ensure site se	ecurity.
H ₂ S radi	icades and /or warning signs at or beyond the calculated 100 ppm us of exposure (ROE). All manned barricades must be equipped H ₂ S monitor and a 2-way radio.
— Set roac	alblocks and staging area as determined.
	Incident Command Structure by designating appropriate on-scene sonnel as follows:
Recording Se Public Inform Safety/Medic Decontamina	nation Officer ————————————————————————————————————
	ecording Secretary" begin documenting the incident on the "Incident of Section VIII: Forms/Reports).
	quest radio silence on all channels that use your radio tower stating ther notice, the channels should be used for emergency ons only.
—— Perform a Sit	te Characterization and designate the following:
Hot Zone Warm Zone Cold Zone	 Hazardous Area Preparation & Decontamination Area Safe Area

<u>AND</u>

On-Scene Incident Command Post Public Relations Briefing Area Staging Area Triage Area Decontamination Area	(Cold Zone) (Cold Zone) (Cold Zone) (Cold Zone) (Warm Zone)
 Refer all media personnel to ConocoPhillips' On-Scene Public Info Officer (refer to Section VI: Public Media Relations).	
Coordinate the attempt to stop the release of H ₂ S. You should con upstream and downstream valves to shut-off gas supply sources, at or clamping leaks. Igniting escaping gas to reduce the toxicity haz used ONLY AS A LAST RESORT . (It must first be determined be safely ignited, taking into consideration if there is a possibility of flammable atmosphere.)	nd/or plugging ard should be if the gas can
 Once the emergency is over, return the situation to normal by:	
Confirming the absence of H ₂ S and combustible gas through	out the area,
Discontinuing the radio silence on all channels, stating that the incident is over,	ne emergency
Removing all barricades and warning signs,	
Allowing evacuees to return to the area, and	
Advising all parties previously notified that the emergency has	as ended.
 Ensure the proper regulatory authorities/agencies are notified of the to Section V: Emergency Call List).	incident (refer
 Clean up the site. (Be sure all contractor crews have had appropriate HAZWOPER training.)	te
 Report completion of the cleanup to the Asset Environmentalist. (Environmentalist will report this to the proper State and/or Federal	agencies.)

 Fill out all required incident reports and send originals to the Safety Department. (Keep a copy for your records.)
• Company employee receiving occupational injury or illnesses.
• Company employee involved in a vehicle accident while driving a company vehicle.
• Company property that is damaged or lost.
• Accident involving the public or a contractor; includes personal injuries, vehicle accidents, and property damage. Also includes any situation which could result in a claim against the Company.
Hazardous Material Spill/Release Report Form
Emergency Drill Report
 Assist the Safety Department in the investigation of the incident. Review the factors that caused or allowed the incident to occur, and modify operating, maintenance, and/or surveillance procedures as needed. Make appropriate repairs and train or retrain employees in the use and operation of the system.
 If this incident was simulated for practice in emergency response, complete the Emergency Drill Report found in Section VIII: Forms/Reports and submit a copy to the Drilling Manager. (Keep one copy in area files to document exercising of the plan.)

Emergency Procedures Responsibility

In the event of a release of potentially hazardous amounts of H2S, all personnel will immediately proceed upwind/ crosswind to the nearest designated briefing area. The COPC Drilling Rep. will immediately, upon assessing the situation, set this into action by taking the proper procedures to contain the gas and notify appropriate people and agencies.

- 1. In an emergency situation, the Drilling Rep. on duty will have complete responsibility and will take whatever action is deemed necessary to ensure the personnel's safety, to protect the well, and to prevent property damage.
- 2. The Toolpusher will assume all responsibilities of the Drilling Rep. in an emergency situation in which the Drilling Rep. becomes incapacitated.
- 3. Advise each contractor, service company, and all others entering the site that H2S may be encountered and of the potential hazards that may exist.
- 4. Authorize the evacuation of local residents if H2S threatens their safety.
- 5. Keep the number of persons on location to a minimum during hazardous operations.
- 6. Direct corrective actions to control the flow of gas.
- 7. The COPC Drilling Rep. has full responsibility for igniting escaping gas to reduce the toxicity hazard. This should be used **ONLY AS A LAST RESORT**.

IV. EMERGENCY EQUIPMENT and MAINTENANCE

432.580.3770

Emergency Equipment Suppliers

DXP Safety International – Odessa, TX

H₂S monitors
Breathing air including cascade systems
First aid and medical supplies
Safety equipment
H2S Specialist

EnerSafe Inc. – Odessa, TX 432.550.0600

H₂S monitors (personal and fixed) Breathing air including cascade systems First aid and medical supplies Safety equipment

Indian Fire & Safety – Hobbs, NM 575.393.3093

H₂S monitors Breathing air including cascade systems (trailer mounted) 30 minute air packs Safety Equipment

Emergency Equipment and Maintenance (continued)

General Information

Materials used for repair should be suitable for use where H₂S concentrations exceed 100 ppm. In general, carbon steels having low yield strengths and a hardness below RC-22 are suitable. The engineering staff should be consulted if any doubt exists on material specifications.

Appropriate signs should be maintained in good condition at location entrance and other locations as specified in Texas Rule 36 and NMOCD Rule 118.

All notification lists should be kept current with changes in names, telephone numbers, etc.

All shutdown devices, alarms, monitors, breathing air systems, etc., should be maintained in accordance with applicable regulations.

All personnel working in H_2S areas shall have received training on the hazards, characteristics, and properties of H_2S , and on procedures and safety equipment applicable for use in H_2S areas.

H2S Safety Equipment and Monitoring Systems

An H2S emergency response package will be maintained at locations requiring H2S monitoring. The package will contain at a minimum the following:

- 3 Fixed H2S sensors located as follows:
 - 1 -on the rig floor
 - 1 at the Bell Nipple
 - 1 at the Shale Shaker or Flowline
- 1 <u>Entrance Warning Sign</u> located at the main entrance to the location, with warning signs and colored flags to determine the current status for entry into the location.
- $2 \underline{\text{Windsocks}}$ that are clearly visible.
- $1 \underline{\text{Audible}}$ warning system located on rig floor
- 2 <u>Visual</u> warning systems (Beacon Lights)
 - 1 located at the rig floor
 - 1 located in the mud mixing room

Note: All alarms (audible and visual) should be set to alarm at 10 ppm.

- 2 Briefing areas clearly marked
 - 2 SCBA's at each briefing area
 - 1- SCBA located at the Drilling Rep's office

Note:

- 1. All SCBA's must be positive pressure type only.
- 2. All SCBA's must be either Scott or Drager brand.
- 3. All SCBA's face pieces should be <u>size large</u>, unless otherwise specified by the Drilling Supervisor.
- 5 Emergency Escape Packs located at Top Doghouse.

Note: Ensure provisions are included for any personnel working above rig floor in derrick.

1 – <u>Tri or Quad gas monitor</u> located at the Drilling Rep's office. This will be used to determine if the work area is safe to re-enter prior to returning to work following any alarm.

V. EMERGENCY CALL LIST:

The following is a priority list of personnel to contact in an emergency situation:

Supervisory Personnel	Office No.	Home	Cellular
Sam Hyden	432.688.9163	432.561.9958	432.557.1999
Permian Drilling Supt.			
Tim Garrett	432.688.9057		505.330.5638
Jerry Moore	432.688.9057		806.683.6852
Terry Brumley	432.688.6850		432.238.9069
Permian Drilling Field Supt.			
Jet Brown	432.688.6849		432.638.0509
WSER			
R.E. (Gene) True	432.688.9050	281.546.1034	281.217.8492
Operations Manager, Permian			
Conventional Asset			
Kyle O'Dell	432.688.9051		432.250.4912
Safety and Environmental Coordinator			
Gene Schwall	281.206.5159	281.579.2914	713.301.7590
Drilling Mngr.			

EMERGENCY CALL LIST: State Officials

Regulatory Agencies

Texas Railroad Commission512.463.68381701 N. Congress24 Hour Emergency: 512.463.6788

Austin, TX 78701

New Mexico Oil Conservation Commission Office: 575.393.6161

P. O. Box 1980

Hobbs, New Mexico 88240-1980

Bureau of Land Management

 Carlsbad Field Office
 Office: 575.234.5972

 620 E. Greene St.
 Fax: 575.885.9264

Carlsbad, NM 88220 BLM 24 Hr on call # Lea County: 575-393-3612

EMERGENCY CALL LIST: Local Officials

Refer to the <u>Location Information Sheet</u>
Note: The LIS should include any area residents (i.e. rancher's house, etc)

ConocoPhillips Emergency Call List and Location Information Sheet

ConocoPhillips- 281-293-3600

Drilling Superintendent	Sam Hyden	Office: 432-688-9163
		Cell: 432-557-1999
Safety (WSER)	Jet Brown	Office: 432-688-6849
		Cell: 432-638-0509
Drilling Engineer	Cord Denton	Office: 281-206-5406
		Cell: 832-754-7363
	Stephanie Basse	Office: 281-206-5239
		Cell: 832-231-1159
	Nancy Luo	Office: 281-206-5280
		Cell: 281-546-8154
Regulatory Contact	Susan Maunder	Office: 432-688-6913
		Cell: 432-269-4378

Emergency Numbers

Hospital: Lea Co. Regional Medical Center (Hobbs)	575-492-5000
Ambulance: Hobbs Fire Dept.	575-397-9308
Air Ambulance: Care Star	
Aero Star	800-627-2376
Fire Dept. (Hobbs)	575-397-9308
(Maljamar non-emerg)	575-676-4100
State Police (Artesia)	
(Hobbs)	575-392-5580
Sheriff (Lovington)	
Police (Lovington)	
NMOCD	
(Emerg)	
BLM Switchboard	575-393-3612
BLM 24 Hr on Call, Lea County	575-393-3612
New Mexico Emergency Response Comm (Santa Fe)	505-476-9600
New Mexico State Emerg Ops Ctr	505-476-9635
National Emergency Response Center	

Number of Residences within 1 mile of Well: There are no residences within one mile of the well to be drilled.

VI. Public Media Relations

The **Public Information Officer** becomes the ConocoPhillips on-scene contact (once designated by the ConocoPhillips On-Scene Incident Commander).

The Public Information Officer confers with Houston Office's Human Relations Representative, who is responsible for assisting in the coordination of local public relations duties.

If you are the Public Information Officer, answer media questions honestly and <u>only with facts</u>, do not speculate about the cause, amount of damage, or the potential impact of the incident on the community, company, employees, or environment. (This information will be formally determined in the incident investigation.)

If you are not comfortable answering a question or if you are unsure of the answer, use terms such as the following:

- "I do not know. I will try to find out."
- I am not qualified to answer that question, but I will try to find someone who is."
- "It is under investigation."

Note:

Do Not Say "No Comment." (This implies a cover-up.)

Do Not Disclose Names of Injured or Dead! Confer with the Houston Office's Human Relations Representative, who is responsible for providing that information.

VII. Public Notification/Evacuation

Alert and/or Evacuate People within the Exposure Area

Public Notification – If the escape of gas could result in a hazard to area residents, the general public, or employees, the person <u>first</u> observing the leak should take <u>immediate</u> steps to cause notification of any nearby residents. The avoidance of injury or loss of life should be of prime consideration and given top priority in all cases. If the incident is of such magnitude, or at such location as to create a hazardous situation, local authorities will be requested to assist in the evacuation and roadblocks of the designated area until the situation can be returned to normal.

Note: Bilingual employees may be needed to assist in notification of residents.

2. Evacuation Procedures – Evacuation will proceed upwind from the source of the release of H₂S. Extreme caution should be exercised in order to avoid any depressions or low-lying areas in the terrain. The public area within the radius of exposure should be evacuated in a southwesterly and southeasterly direction so as to avoid the prevailing southern wind direction.

Roadblocks and the staging area should be established as necessary for current wind conditions.

Note: In all situations, consideration should be given to wind direction and weather conditions. H₂S is heavier than air and can settle in low spots. Shifts in wind direction can also change the location of possible hazardous areas.

VIII. FORMS & REPORTS

- I. Incident Log
- II. Preliminary Emergency Information Sheet
- III. Emergency Drill Report
- IV. Onshore Hazardous Material Spill/Release Report Form
- V. Immediate Report of Occupational Injury or Illness Report of Accident-Public Contractor Report of Loss or Damage to Company Property Report of Automotive Incident