LEGACY RESERVES OPERATING, L. P.

HYDROGEN SULFIDE (H2S) CONTINGENCY PLAN LEA UNIT 45H

Assumed 100 ppm ROE = 3000'

HORRS OCD

100 ppm H2S concentration shall trigger activation of this plan.

APR 04 2016

This is an open drilling site. H₂S monitoring equipment and emergency response equipment will be rigged up and in use when the company drills out from undersolved surface casing. H₂S monitors, warning signs, wind indicators and flags will be in use.

- A. All personnel shall receive proper H2S training in accordance with Onshore Order 6 III.C.3.a
- B. Briefing Area: Two perpendicular areas will be designated by signs and readily accessible.
- C. Required Emergency Equipment:
 - Well control equipment
 - a. Flare line 150' from wellhead to be ignited by flare gun.
 - b. Choke manifold with a remotely operated choke.
 - c. Mud/Gas Separator.
 - Protective Equipment for essential personnel. Breathing apparatus:
 - a. Rescue Packs (SCBA) 1 unit shall be placed at each briefing area. 2 units shall be stored in the safety trailer.
 - b. Work/Escape packs 4 packs shall be stored on the rig floor with sufficient air hose not to restrict work activity.
 - c. Emergency Escape Packs 4 packs shall be stored in the doghouse for emergency evacuation.

Auxiliary Rescue Equipment:

- a. Stretcher
- b. Two OSHA full body harness
- c. 100 ft. 5/8" OSHA approved rope
- d. One 20# class ABC fire extinguisher
- H2S detection and monitoring Equipment:

The stationary detector with three sensors will be placed in the upper doghouse, set to visually alarm @ 10 ppm and audible @ 14 ppm. Calibrate a minimum of every 30 days or as needed. The sensors will be placed in the following places: Rig floor, Bell nipple, end of flare line or where well bore fluid is being discharged (Gas sample tubes will be stored in the safety trailer).

- Visual warning systems.
 - a. One color code condition sign will be placed at the entrance to the site reflecting the possible conditions at the site.
 - b. A colored condition flag will be on display, reflecting the current condition, at the drilling site.
 - c. Two wind socks will be placed in strategic locations being visible from all angles.

The mud program has been designated to minimize the volume of H2S circulated to surface. The operator will have the necessary mud products to minimize hazards while drilling in H2S bearing zones.

Metallurgy:

- a. All drill strings, casings, tubing, wellhead, blowout preventer, drilling spool, kill lines, choke manifold and lines, shall be suitable for H2S service.
- b. All elastomers used for packing and seals shall be H2S trim.
- Communication:

Communication will be via two way radio in emergency and company vehicles. Cell phones and land lines where available.

H₂S Operations

Though no H₂S is anticipated during the drilling operation, this contingency plan will provide for methods to ensure the well is kept under control in the event an H₂S reading of 100 ppm or more are encountered. Once personnel are safe and the proper protective gear is in place and on personnel, the operator and rig crew essential personnel will ensure the well is under control, suspend drilling operations and shut-in the well (unless pressure build up or other operational situations dictate suspending operations will prevent well control), increase the mud weight and circulate all gas from the hole utilizing the mud/gas separator downstream of the choke, the choke manifold and the emergency flare system located 150' from the well. Bring the mud system into compliance and the H₂S level below 10 ppm, then notify all emergency officers that drilling ahead is practical and safe.

Proceed with drilling ahead only after all provisions of Onshore Order 6, Section III.C. have been satisfied.

Ignition of Gas source

Should control of the well be considered lost and ignition considered, take care to protect against exposure to Sulfur Dioxide (SO₂). Intentional ignition must be coordinated with the NMOCD and local officials. Additionally the NM State Police may become involved. NM State Police shall be the Incident Command on scene of any major release. Take care to protect downwind whenever this is an ignition of the gas.

Characteristics of H₂S and SO₂

Common Name	Chemical Formula	Specific Gravity	Threshold Limit	Hazardous Limit	Lethal Concentration
Hydrogen Sulfide	H ₂ S	1.189 Air = I	10 ppm	100 ppm/hr	600 ppm
Sulfur Dioxide	SO ₂	2.21 Air = I	2 ppm	N/A	1000 ppm

Contacting Authorities

Legacy Reserves Operating's personnel must liaison with local and state agencies to ensure a proper response to a major release. Additionally, the OCD must be notified of the release as soon as possible but no later than 4 hours. Agencies will ask for information such as type and volume of release, wind direction, location of release, etc. Be prepared with all information available including directions to site. The following call list of essential and potential responders has been prepared for use during a release. (Operator Name)'s response must be in coordination with the State of New Mexico's "Hazardous Materials Emergency Response Plan" (HMER).

Emergency Assistance Telephone List

Lea County Sheriff or Police (575) 396-3611 Fire Department (575) 397-9308 Hospital (575) 492-5000 Ambulance 911 Department of Public Safety (392) 392-5588 Oil Conservation Division (575) 748-1823 New Mexico Energy, Minerals & Natural Resources Department (575) 748-1283 LEGACY RESERVES OPERATING LP Office (432) 689-5200 Legacy Reserves Operating LP Office (432) 689-5200 Mike Parrish Cell (432) 689-5200 Senior Engineer: Office (432) 689-5200 Blain Lewis Cell (432) 689-5200 Cernie Hanson Cell (432) 689-5200 Executive Vice President of Operations Paul Horne Office (432) 689-5200 Safety Coordinator Office (432) 689-5200	PUBLIC SAFETY:			911 or	
Fire Department	Lea County Sheriff or Police		,	(575) 396-3611	
Hospital Ambulance Department of Public Safety Oil Conservation Division New Mexico Energy, Minerals & Natural Resources Department LEGACY RESERVES OPERATING LP Legacy Reserves Operating LP Office (432) 689-5200 Drilling Manager: Mike Parrish Office (432) 689-5200 Senior Engineer: Blain Lewis Office (432) 689-5200 Cell (432) 689-5200 Cell (432) 230-7450 Operations Manager: Coffice (432) 689-5200 Cell (432) 230-9009 Executive Vice President of Operations Paul Horne Safety Coordinator Office (432) 689-5200					
Ambulance Department of Public Safety Oil Conservation Division New Mexico Energy, Minerals & Natural Resources Department LEGACY RESERVES OPERATING LP Legacy Reserves Operating LP Office (432) 689-5200 Drilling Manager: Mike Parrish Office (432) 689-5200 Senior Engineer: Blain Lewis Office (432) 689-5200 Cell (432) 689-5200 Cell (432) 230-7450 Operations Manager: Cell (432) 689-5200 Executive Vice President of Operations Paul Horne Safety Coordinator Office (432) 689-5200 Office (432) 689-5200 Office (432) 689-5200 Office (432) 689-5200					
Oil Conservation Division New Mexico Energy, Minerals & Natural Resources Department LEGACY RESERVES OPERATING LP Legacy Reserves Operating LP Office (432) 689-5200 Drilling Manager: Mike Parrish Cell (432) 689-5200 Senior Engineer: Blain Lewis Operations Manager: Operations Manager: Cell (432) 689-5200 Cell (432) 230-7450 Operations Manager: Office (432) 689-5200 Cell (432) 230-9009 Executive Vice President of Operations Paul Horne Safety Coordinator Office (432) 689-5200				•	
Oil Conservation Division New Mexico Energy, Minerals & Natural Resources Department LEGACY RESERVES OPERATING LP Legacy Reserves Operating LP Office (432) 689-5200 Drilling Manager: Mike Parrish Cell (432) 689-5200 Senior Engineer: Blain Lewis Operations Manager: Operations Manager: Cell (432) 689-5200 Cell (432) 230-7450 Operations Manager: Office (432) 689-5200 Cell (432) 230-9009 Executive Vice President of Operations Paul Horne Safety Coordinator Office (432) 689-5200	Department of Public Safety			(392) 392-5588	
New Mexico Energy, Minerals & Natural Resources Department (575) 748-1283 LEGACY RESERVES OPERATING LP Legacy Reserves Operating LP Office (432) 689-5200 Drilling Manager: Office (432) 689-5200 Mike Parrish Cell (432) 689-5200 Senior Engineer: Office (432) 689-5200 Blain Lewis Cell (432) 230-7450 Operations Manager: Office (432) 689-5200 Ernie Hanson Cell (432) 230-9009 Executive Vice President of Operations Paul Horne Safety Coordinator Office (432) 689-5200					
LEGACY RESERVES OPERATING LPLegacy Reserves Operating LPOffice (432) 689-5200Drilling Manager: Mike ParrishOffice (432) 689-5200Senior Engineer: Blain LewisOffice (432) 689-5200Operations Manager: Ernie HansonOffice (432) 689-5200Executive Vice President of Operations Paul HorneOffice (432) 689-5200Safety CoordinatorOffice (432) 689-5200	New Mexico Energy, Minerals & Natural Resources Department				
Drilling Manager: Mike Parrish Senior Engineer: Blain Lewis Office (432) 689-5200 Cell (432) 689-5200 Cell (432) 230-7450 Operations Manager: Ernie Hanson Office (432) 689-5200 Cell (432) 230-9009 Executive Vice President of Operations Paul Horne Safety Coordinator Office (432) 689-5200			Office	(432) 689-5200	
Mike Parrish Cell (432) 664-2150 Senior Engineer: Blain Lewis Office (432) 689-5200 Cell (432) 230-7450 Operations Manager: Ernie Hanson Office (432) 689-5200 Cell (432) 230-9009 Executive Vice President of Operations Paul Horne Safety Coordinator Office (432) 689-5200	Logady (10001100 opoluting Li		011100	(402) 000 0200	
Mike Parrish Cell (432) 664-2150 Senior Engineer: Blain Lewis Office (432) 689-5200 Cell (432) 230-7450 Operations Manager: Ernie Hanson Office (432) 689-5200 Cell (432) 230-9009 Executive Vice President of Operations Paul Horne Safety Coordinator Office (432) 689-5200	Drilling Manager:		Office	(432) 689-5200	
Senior Engineer: Blain Lewis Office (432) 689-5200 Cell (432) 230-7450 Operations Manager: Ernie Hanson Office (432) 689-5200 Cell (432) 230-9009 Executive Vice President of Operations Paul Horne Safety Coordinator Office (432) 689-5200				· •	
Blain Lewis Cell (432) 230-7450 Operations Manager: Ernie Hanson Office (432) 689-5200 Cell (432) 230-9009 Executive Vice President of Operations Paul Horne Safety Coordinator Office (432) 689-5200				(· /	
Operations Manager: Ernie Hanson Office (432) 689-5200 Cell (432) 230-9009 Executive Vice President of Operations Paul Horne Safety Coordinator Office (432) 689-5200	Senior Engineer:		Office	(432) 689-5200	
Ernie Hanson Cell (432) 230-9009 Executive Vice President of Operations Paul Horne Safety Coordinator Office (432) 689-5200	Blain Lewis		Cell	(432) 230-7450	
Ernie Hanson Cell (432) 230-9009 Executive Vice President of Operations Paul Horne Safety Coordinator Office (432) 689-5200					
Executive Vice President of Operations Paul Horne Safety Coordinator Office (432) 689-5200			•		
Paul Horne Safety Coordinator Office (432) 689-5200	Ernie Hanson	Ce	II (43	2) 230-9009	
			Office	(432) 689-5200	
	Safety Coordinator	Office	e (432) 689-5200		
Randy Williams Cell (432) 260-5566	Randy Williams	J	Celi	(432) 260-5566	

LEGACY SAFETY

Hobbs (575) 393-7233

(575) 605-6715

Field Operations Manager: Buddy Boydston

Cell (575) 631-0820

Operations Manager:

Danny Owens Cell

Evacuee Description:

Residents: THERE ARE NO RESIDENTS WITHIN 3000' ROE.

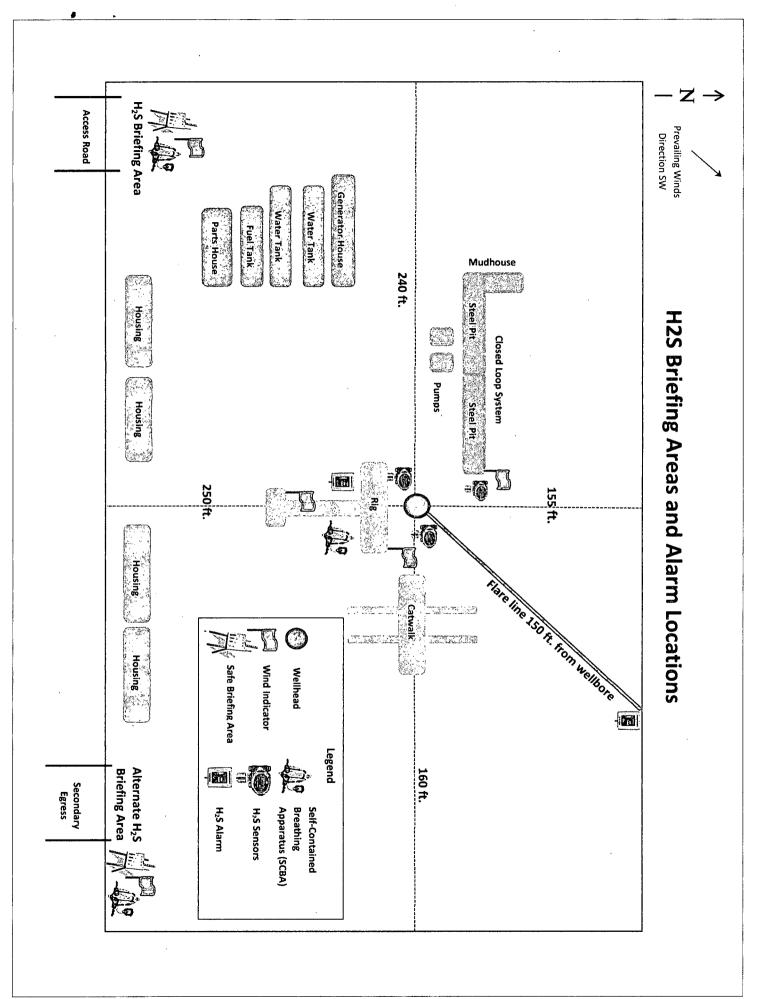


EXHIBIT C

Interim Reclamation & Production Facilities LEA UNIT 45H V-DOOR EAST

