Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Hobbs

FORM APPROVED OMB NO. 1004-0137

BUREAU OF LAND MANAGEMENT	Expires: January 31, 2018
BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.	5. Lease Serial No. NMNM107392 6. If Indian, Allottee or Tribe Name
SUBMIT IN TRIPLICATE - Other instructions on page 2	7. If Unit or CA/Agreement, Name and/or No.
CELL	8. Well Name and No.

abandoned well. Use form 3160-3 (APD) for such p SUBMIT IN TRIPLICATE - Other instructions on 1. Type of Well CAP FEDERAL 01 ☑ Oil Well ☐ Gas Well ☐ Other 2. Name of Operator ABIGAIL MONTGOMERY 9. API Well No COG OPERATING LLC 30-025-36469-00-S3 E-Mail: Abbym@bcmandassociates.com 3b. Phone No. (include area code) Ph: 432-580-7161 10. Field and Pool or Exploratory Area 3a. Address ONE CONCHO CENTER 600 W ILLINOIS AVENUE MIDLAND, TX 79701-4287 4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 11. County or Parish, State Sec 6 T20S R32E NENW 660FNL 2100FWL LEA COUNTY, NM 12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION ☐ Acidize Deepen ☐ Production (St Notice of Intent INT TO PA ☐ Alter Casing ☐ Hydraulic Fracturing □ Reclamation P&A NR ☐ Subsequent Report ☐ Recomplete □ Casing Repair ■ New Construction P&AR ☑ Plug and Abandon ☐ Final Abandonment Notice ☐ Change Plans □ Temporarily A

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.

☐ Plug Back

1. Tag cement plug @ 10570'. 2. Set 5 1/2" CIBP @ 9950'. Circulate hole w/ mud laden fluid. Pressure test csg. Spot 25 sx cmt @ 9950-9850'.

3. Spot 25 sx cmt @ 7350-7250*. (Bone Spring) 7380 - 7200*.
4. Spot 25 sx cmt @ 4425-4324*. WOC & Tag. (8 5/8 Shoe, Delaware) 4425 - 4200*.
5. Spot 30 sx cmt @ 2970-2720*. WOC & Tag. (DV Tool, Yates) 2970*. - 2700*.
6. Spot 25 sx cmt @ 913-813*. WOC & Tag (13 3/8 Shoe, Rustler) 7. Spot 25 sx cmt @ 100'-Surface.
8. Cut off well head verific cmt to surface.

☐ Convert to Injection

8. Cut off well head, verify cmt to surface, weld on Dry Hole Marker.

SEE ATTACHED FOR CONDITIONS OF APPROVAL

☐ Water Disposa

14. I hereby certify that the foregoing is true and correct. Electronic Submission #382453 verified by the BLM Well Information System For COG OPERATING L.C, sent to the Hobbs Committed to AFMSS for processing by PRISCILLA PEREZ on 08/22/2017 (17PP0598SE)					
Name (Printed/Typed)	ABIGAIL MONTGOMERY	Title	AGENT		
Simulations	(Flataria Submission)	Data	07/05/0047		
Signature	(Electronic Submission)	Date	07/25/2017		
THIS SPACE FOR FEDERAL OR STATE OFFICE USE					
Approved By OMAR A	LOMAR	TitleP	ETROLEUM ENGINEER	Date 12/07/2017	
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.		Office	Hobbs		
Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United					


States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2) ** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED **

SIN

New PBTB 10,570 (4/14/2012) 1866 708, 801-New PBTD @ 12,360 (2/10/2010) 8998409.88 15,960 VI. 12,8,51 JTEA 15 17 # P.110, @ 12,940' 12,451 - 12,580' (148 holes) llug trog bollateri MOTTOM rod pump v rods +32, cm4 CIBR 12395 ON 2/16/2015 570Y 08 , 65811 - ,55811 = Atoka 14 58.58 9, EM CIBP@ 11, 800' 1072,11 @ 20T-951 7+ ,06,00,01 298 7 LEVED 010 NS orzo1 .tms top DUTOO1 10,712' (1) 27/8" bull plug 087 18/22 15.(1) - 9988 - 10,000 24 holes Bone Spring (1) 2718" x 4' slotted sub Aolenst, topos Ju tos LLACE GJOHL alogin potass lastrabant "18/15 (1) · pdt 081 "8/52 2th (01) 087 "815 , At (2) (1) 2, x 2 2/8" MAN Ker 506 3n3 087 #5.0 "81 5 280 EUE : (210c, dol) gridul 204 "8/1 Pr 848" 32 + J-55 both stagus clre. DND Stage 15255x X2 000 3 pot 2 72 1 Production -2015 105 PS 2920' Circulated 2 ND Stage 1300 SX ~ 12/14" hole stuming for blb X2 00 T 28 sts 72 1 ,298 0 D VTZ 23-T # 42 18 8/2 E1 Intermediate -Chalated 1, Surface - LOTS SX, : twamed Susan completed 10-12-2004 1898 KB Patros - 20 - 05 buds 79 HISE Lea County API 30-025-36469 MN Lap Federal #1

SIN

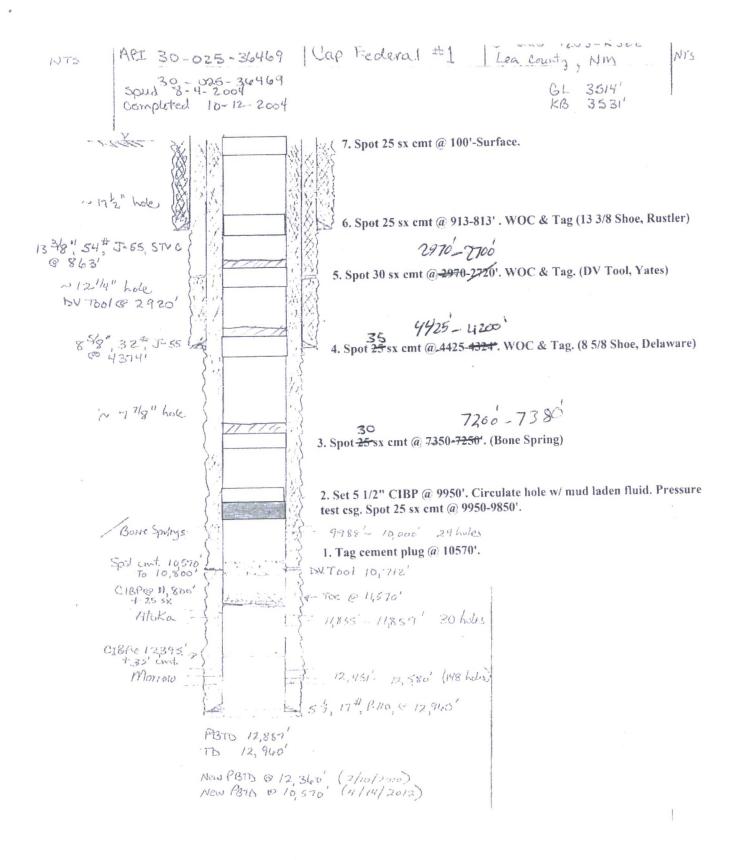

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.