
Form 3160 (June 2015) DEP	UNITED STATES PARTMENT OF THE INTE		D Hobbs	OMB Expires	M APPROVED No. 1004-0137 : January 31, 2018	
	BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON W				5. Lease Serial No. NMLC 032511E		
	Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.				6. If Indian, Allottee or Tr	ibe Name	
	SUBMIT IN TRIPLICATE - Other instructions on page			8 2018	7. If Unit of CA/Agreeme	nt, Name and/or No.	
	. Type of Well · ☐ Oil Well ✓ Gas Well ☐ Other			THE	8 Well Name and No. Langlie Fed #3		
2. Name o	f Operator Herman L. Loeb	LLC /	REC	EIVE	9. API Well No. 30-025-2	26951 2/887	
3a. Addres		3b. P	Phone No. <i>(include area co</i> 3) 943-2227	ode)	10. Field and Pool or Exp Jalmat		
	4. Location of Well (Footage, Sec., T.,R.,M., or Survey Description) Unit letter J, 1,650' FSL, 1,650' FEL, Sec 8, 25S, 37E				11. Country or Parish, Sta Lea Co. NM	te	
	12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE 1						
TY	TYPE OF SUBMISSION				TYPE OF ACTION		
V No	tice of Intent	Acidize	Deepen Hydraulic Fracturing		luction (Start/Resume) amation	INT TO PA	
Sub	osequent Report	Casing Repair	New Construction		omplete	P&A R	
Fin	al Abandonment Notice	Change Plans	Plug Back		porarily Abandon er Disposal		
1245 2: F surfa 7,50 597 3: T	ress test squeeze to 500 ace. If circ is established p 0'. If no injection rate esta ag cmt plug to confirm dep to surface and leave inside	eeze slotted liner w/50 sx cmt. psi. Set CIBP @ 2,650 [°] . Spot omp cmt until good cmt to surfa ablished spot 100 sx cmt @ 1,9 pth. Spot 9.5 ppg salt gel spac e full. nake sure all annulus's are full o	9.5 ppg salt gel spacer ce and leave inside full. 00'. er fr/top of plug to 400'.	lf no circ b Perf @ 405	ut injection rate establisi 7355 5'. Establish circ up liner	ned pmp 100 sx & displace to annulus & pmp cmt until good	
		SEE ATTACHE	D FOR				
		CONDITIONS ()F APPROVAL	-			
14. I hereb	14. I hereby certify that the foregoing is true and correct. Name (Printed/Typed)			Agent for Hermal L. Loeb LLC Title			
Signa	ture ? Preke	Prolly	Date		01/02/201	8	
		THE SPACE FO	OR FEDERAL OR	STATE OI	FICE USE		
Approved by Holls			Title	S.P.E.	Da	te 1/12/18	
certify that		ched. Approval of this notice does equitable title to those rights in the nduct operations thereon.		CFO			
		43 U.S.C Section 1212, make it a c nents or representations as to any r			llfully to make to any depa	rtment or agency of the United States	
(Instruct	ions on page 2)				FOI	OCD OI 18 2018	
					WW	IOCD OILIBICOIS	

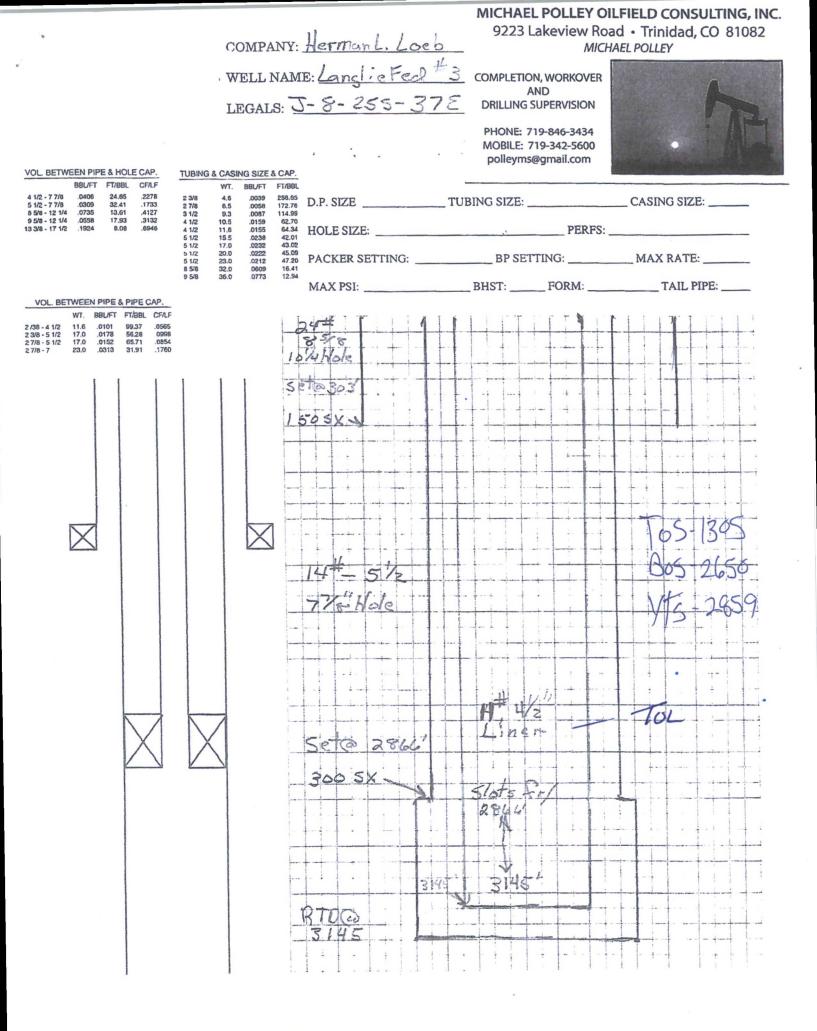

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within **<u>ninety (90)</u>** days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.**

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.